



WBA11CG060CG70224

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	96,454 km
Manufacturer	BMW	Next maintenance in	3,200 km
Type / Model	530e	Main inspection (Report on hand)	03/2026
Vehicle Identification number	WBA11CG060CG70224	Power / Engine displacement	135 kW / 1,998 ccm
First registration	8 Mar 2021	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
3	Roof	Roof - dent(s) - Smooth repair work
4	Front bumper	Air-inlet grille - Broken / torn - Replace
5	2nd wheel set	1 alloy rim - Scratched - Loss in value
6	Front bumper	Front bumper - Scratched - Smart repair
7	Vehicle glazing	Windscreen - Stone chips - Replace
8	Rear bumper	Rear bumper - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Front, Provided by user / customer

Detected repainting

No.	Location
1	Mudguard - right side

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 3 Apr 2025
Protocol number: 39158568
Delivery date: 3 Apr 2025



Auto Plus

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100V	Dunlop	Winter tyres	7mm - 7mm	o.k.	
2	245/45 R18 100V	Dunlop	Winter tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100Y	Goodyear	Summer tyres	5mm - 5mm	o.k.	
2	245/45 R18 100Y	Goodyear	Summer tyres	5mm - 5mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, N.i.O

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 3 Apr 2025

Protocol number: 39158568

Delivery date: 3 Apr 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	530e	Mileage (Read)	96,454 km
Vehicle Identification number	WBA11CG060CG70224	First registration	8 Mar 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was established during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

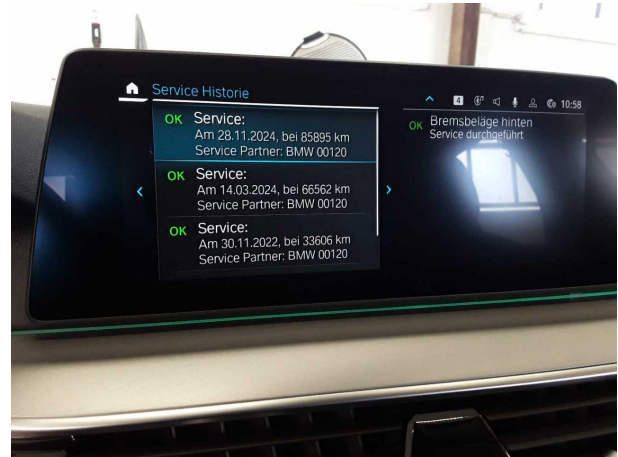


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

Pictures of damage



Damage #1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage #1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage #2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage #2: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage #3: Roof: Roof - dent(s) - Smooth repair work



Damage #3: Roof: Roof - dent(s) - Smooth repair work



Damage #4: Front bumper: Air-inlet grille - Broken / torn - Replace



Damage #4: Front bumper: Air-inlet grille - Broken / torn - Replace



Damage #5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #5: 2nd wheel set: 1 alloy rim - Scratched - Loss in value




Damage #6: Front bumper: Front bumper - Scratched - Smart repair



Damage #6: Front bumper: Front bumper - Scratched - Smart repair




Damage #7: Vehicle glazing: Windscreen - Stone chips - Replace

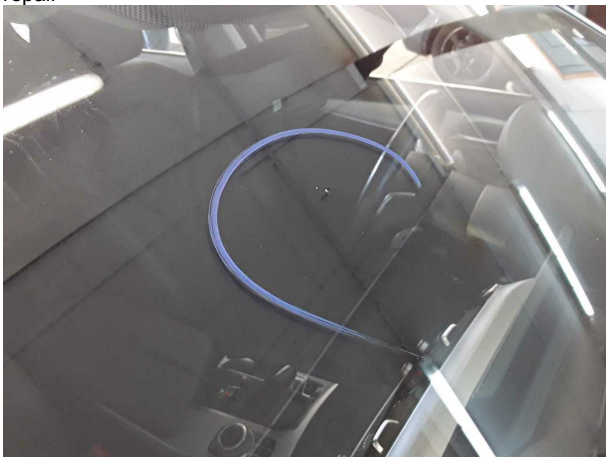

Damage #7: Vehicle glazing: Windscreen - Stone chips - Replace



Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint

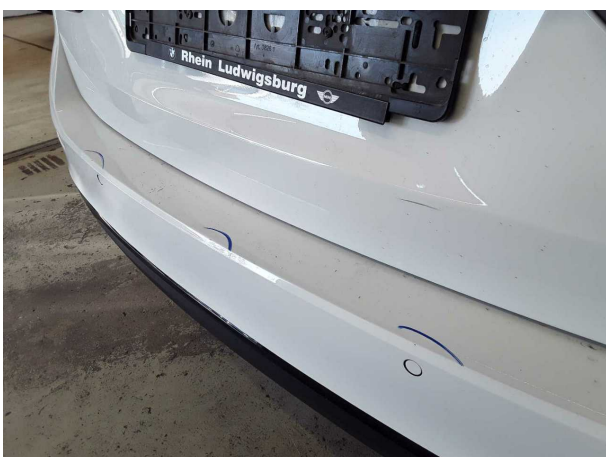

Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen


Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 3 Apr 2025
Protocol number: 39158568
Delivery date: 3 Apr 2025



Auto Plus

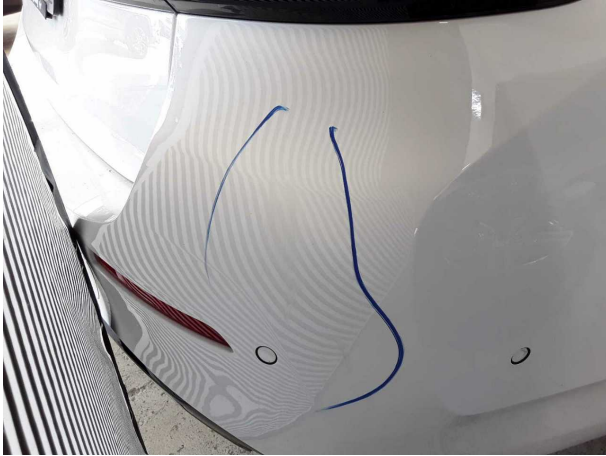

Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint