



WBA6N310X0FK89720

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	97,302 km
Manufacturer	BMW	Next maintenance in	19,000 km
Type / Model	330e	Main inspection (Read from ZBI)	02/2026
Vehicle Identification number	WBA6N310X0FK89720	Power / Engine displacement	135 kW / 1,998 ccm
First registration	4 Feb 2021	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front - Worn - No deduction
2	Side panel - rear right side	Side panel - Scratch(es) - Cover / polish
3	2nd wheel set	1 alloy rim - Scratched - Loss in value
4	Front bumper	Front bumper - Scratched - Smart repair
5	Interior	Separation net (fehlt) - Replace
6	Rear bumper	Rear bumper - Scratched - Paint
7	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
8	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Replace

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction
3	Vehicle glazing	Windscreen with lane departure assistant (OhneRissbildung) - Stone chips - No deduction
4	Bonnet	Bonnet (Steinschläge) - No deduction

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Side right, Provided by user / customer

Detected repainting

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 28 Apr 2025

Protocol number: 39500040

Delivery date: 28 Apr 2025



Auto Plus

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98H	Goodyear	Winter tyres	2mm - 2mm	Not o.k.	
2	225/50 R17 98H	Goodyear	Winter tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	255/40 R18 99Y	Goodyear	Summer tyres	4mm - 4mm	o.k.	
2	255/40 R18 99Y	Goodyear	Summer tyres	6mm - 6mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, N.i.O

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 28 Apr 2025
Protocol number: 39500040
Delivery date: 28 Apr 2025



Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	330e	Mileage (Read)	97,302 km
Vehicle Identification number	WBA6N310X0FK89720	First registration	4 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

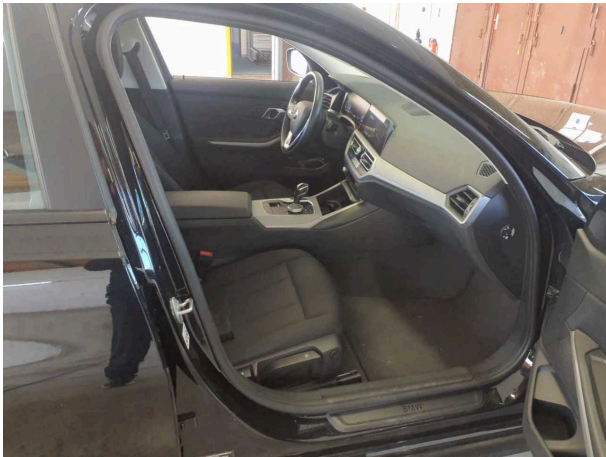


Figure 7: Interior



Figure 8: Misc.



Figure 9: Misc.



Figure 10: Misc.



Figure 11: Misc.

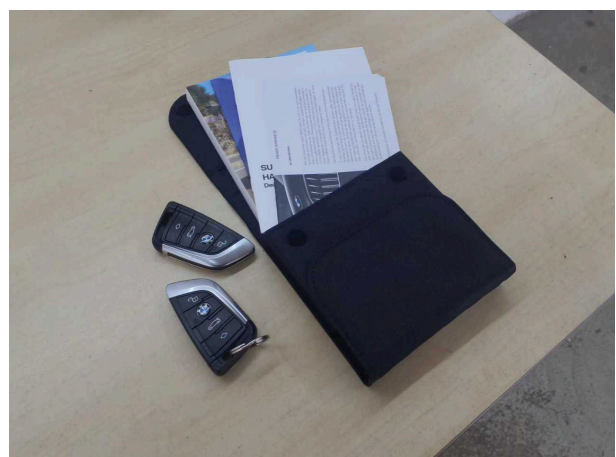


Figure 12: Misc.

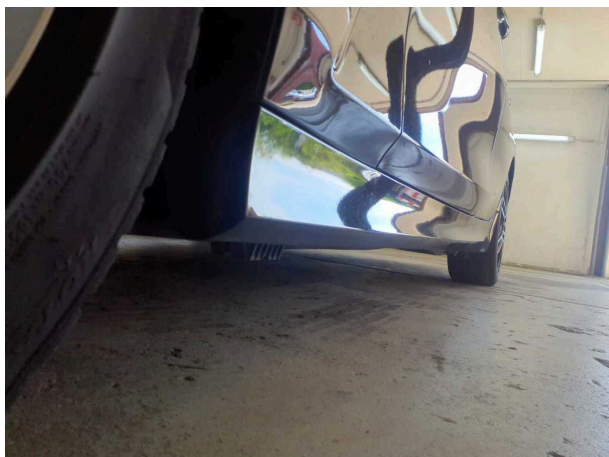


Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

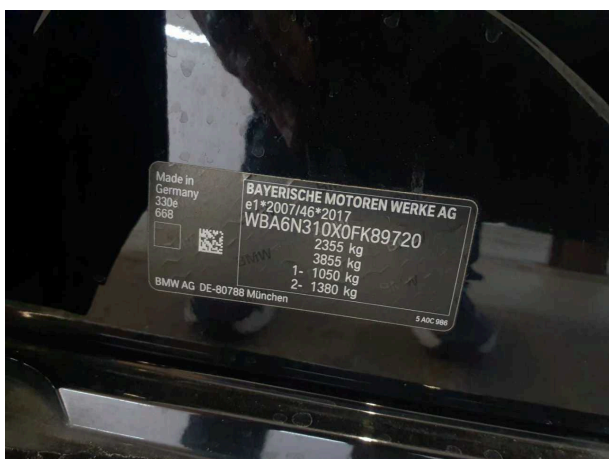


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

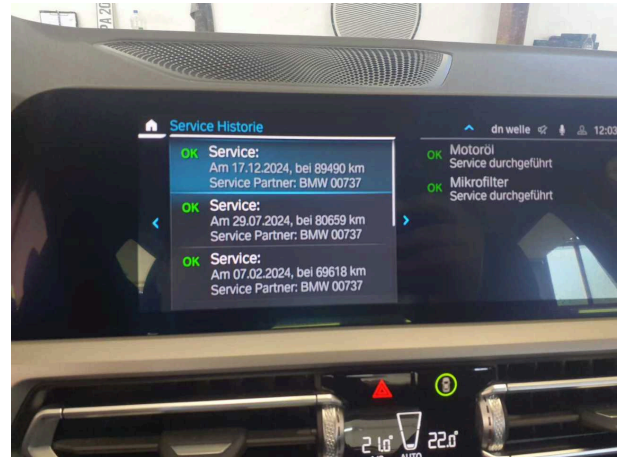


Figure 20: Misc.

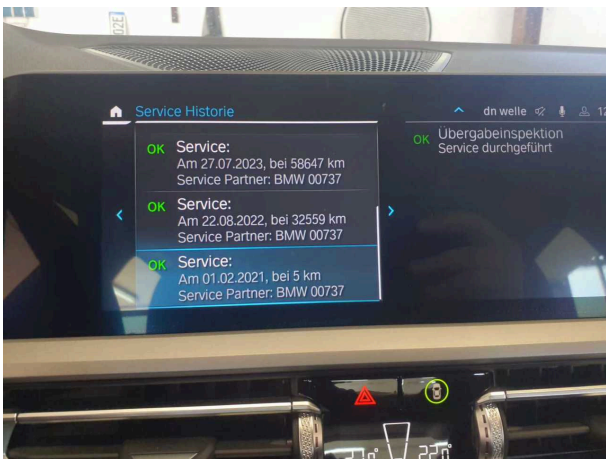


Figure 21: Misc.

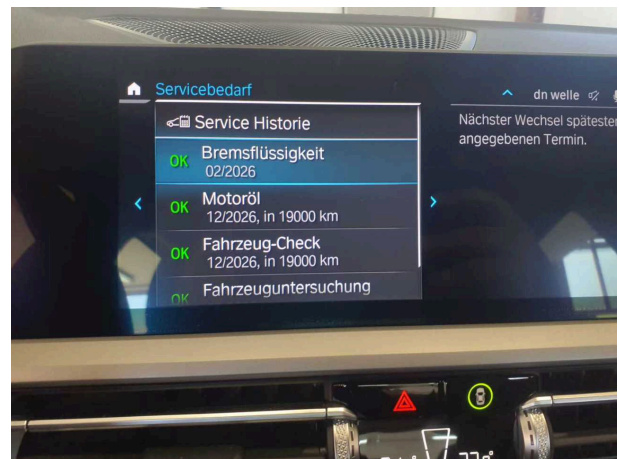


Figure 22: Misc.


Pictures of damage



Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction



Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction

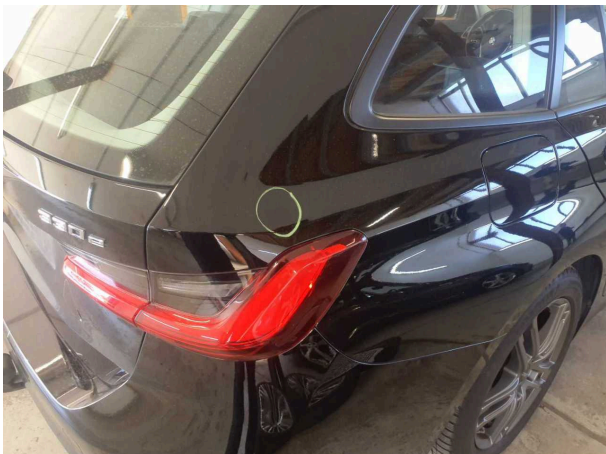

Damage #2: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Damage #2: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Damage #3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value




Damage #3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #4: Front bumper: Front bumper - Scratched - Smart repair




Damage #4: Front bumper: Front bumper - Scratched - Smart repair

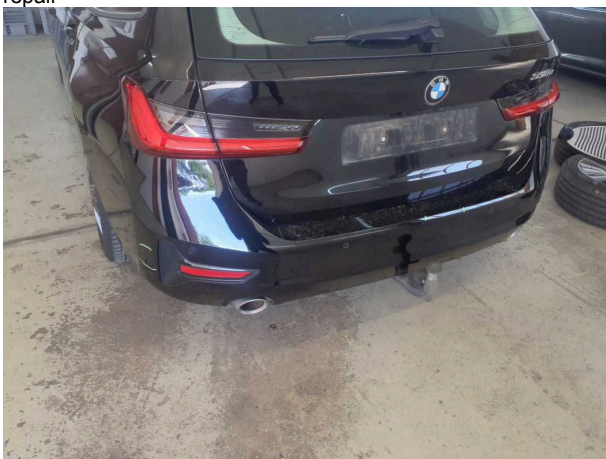

Damage #6: Rear bumper: Rear bumper - Scratched - Paint



Damage #6: Rear bumper: Rear bumper - Scratched - Paint

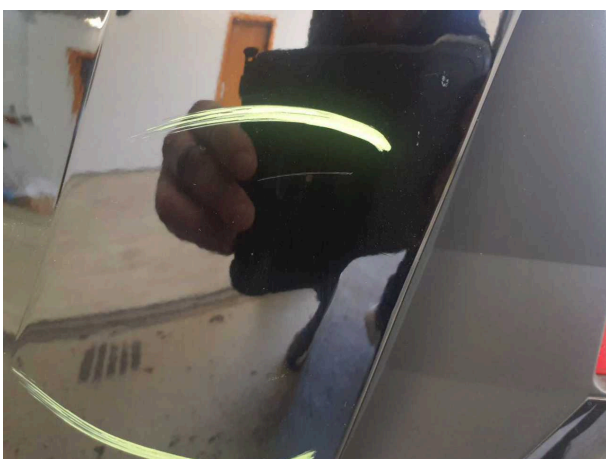


Damage #6: Rear bumper: Rear bumper - Scratched - Paint




Damage #7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage #7: Door - front right side: Door - Dent / paintcoat damage
- Repair and paint

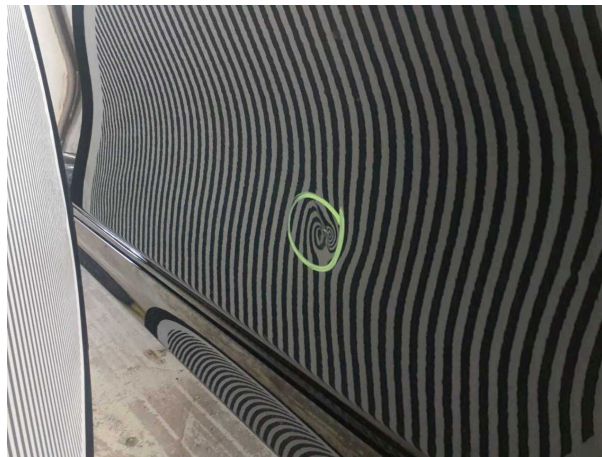


Damage #7: Door - front right side: Door - Dent / paintcoat damage
- Repair and paint

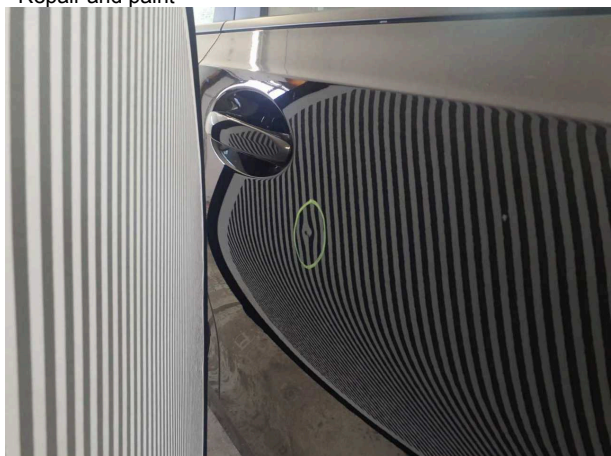

Damage #7: Door - front right side: Door - Dent / paintcoat damage
- Repair and paint



Damage #8: Mudguard - right side: Mudguard - right side -
Dent / paintcoat damage - Replace

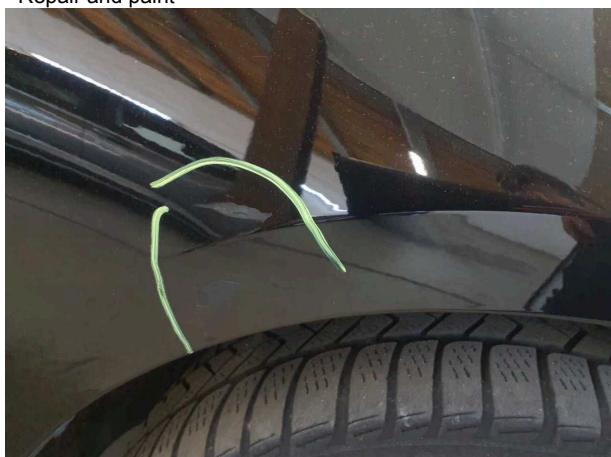

Damage #8: Mudguard - right side: Mudguard - right side - Dent /
paintcoat damage - Replace




Damage #8: Mudguard - right side: Mudguard - right side -
Dent / paintcoat damage - Replace



Damage #8: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Replace



Damage #8: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Replace

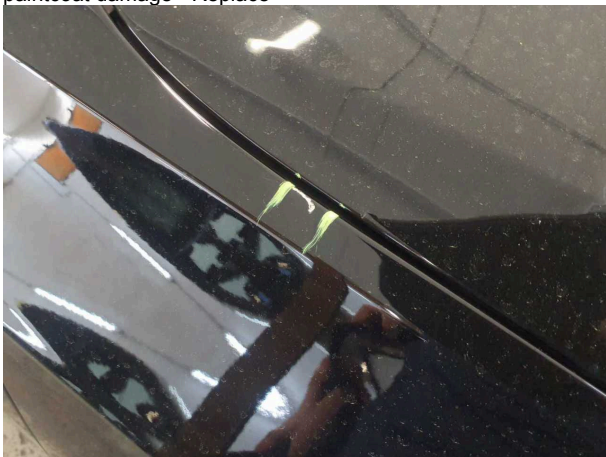

Damage #8: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Replace