



WBA6K31030FL26681

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	52,178 km
Manufacturer	BMW	Next maintenance in	6,000 km
Type / Model	320i	Main inspection (Report not on hand)	04/2026
Vehicle Identification number	WBA6K31030FL26681	Power / Engine displacement	135 kW / 1,998 ccm
First registration	4 May 2021	Upholstery/Colour	/
Last maintenance	04/2024, 40,668 km	Paintwork	
Fuel type	Petrol	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Documents	Main inspection certificate (Fehlt) - Replace
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Sill - left side	Sill - Dent(s) - Smooth repair work
4	Trim / covers	Door trim - front left side - Damaged - Loss in value
5	Trim / covers	Door trim - front right side - Scratched - Loss in value
6	Side panel - rear left side	Sill - Scratched - Smart repair
7	Front bumper	Front bumper - Scratched - Smart repair
8	Sill - right side	Trim - Scratched - Smart repair
9	Electronic systems	Electronic systems (IDrive ohne Funktion) - Specify findings - Perform diagnosis
10	Rear bumper	Rear bumper - Scratched - Repair and paint
11	Door - rear right side	Door - Scratched - Repair and paint
12	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
13	Door - front right side	Door - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Interior	Interior - Abrasion - No deduction
2	Body	Body (Steinschläge) - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part



Previous damages

No.	Previous damage
1	Rear, Provided by user / customer

Detected repainting

No.	Location
1	Side panel - rear left side, Door - rear left side, Door - front left side

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Hankook	Summer tyres	6mm - 6mm	o.k.	
2	225/50 R17 98Y	Hankook	Summer tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/60 R16 96H	Pirelli	Winter tyres	7mm - 7mm	o.k.	
2	205/60 R16 96H	Pirelli	Winter tyres	5mm - 5mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n. i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 18 Sept 2024

Protocol number: 35992719

Delivery date: 18 Sept 2024



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	320i	Mileage (Read)	52,178 km
Vehicle Identification number	WBA6K31030FL26681	First registration	4 May 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was verified during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions that can be reproduced using the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 18 Sept 2024
Protocol number: 35992719
Delivery date: 18 Sept 2024



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

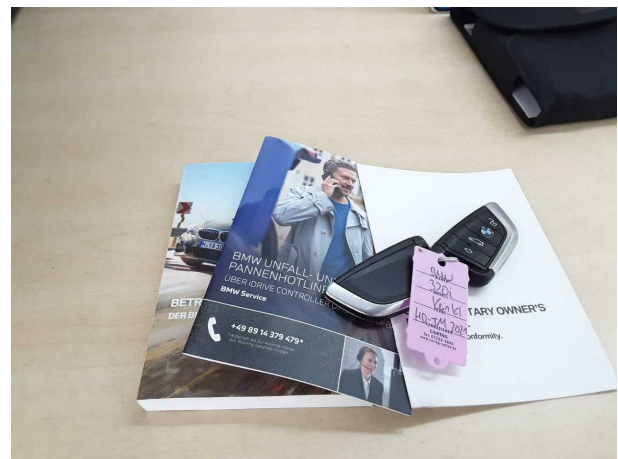


Figure 10: Misc.



Figure 11: Misc.

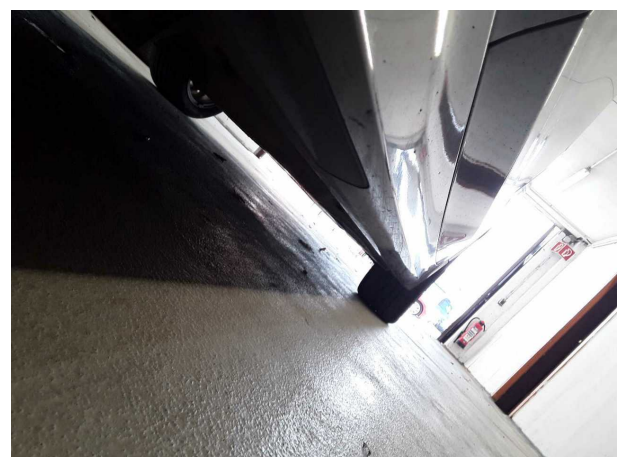


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.

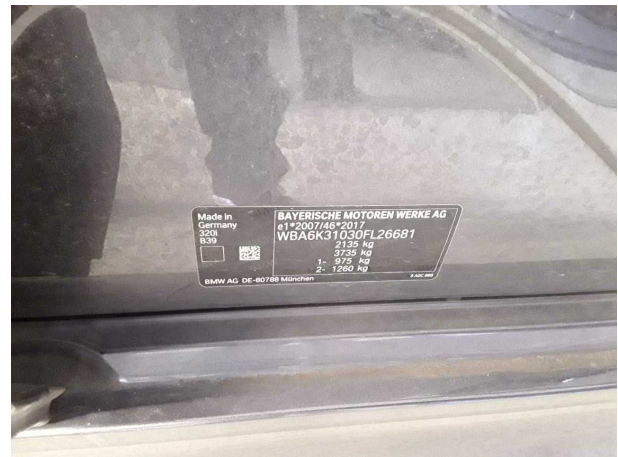


Figure 16: Misc.



Figure 17: Misc.

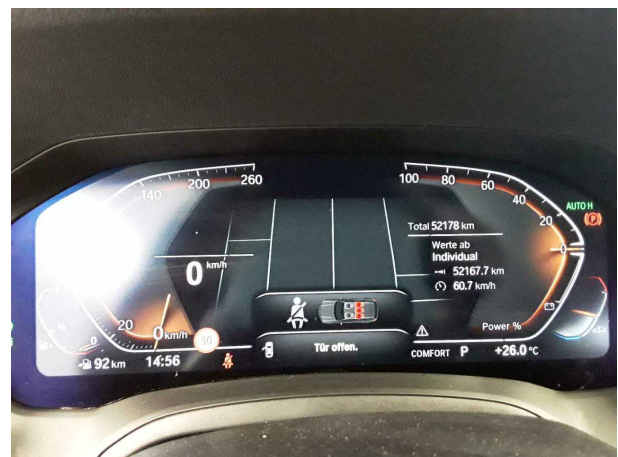


Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 18 Sept 2024
Protocol number: 35992719
Delivery date: 18 Sept 2024



Figure 19: Misc.



Figure 20: Misc.

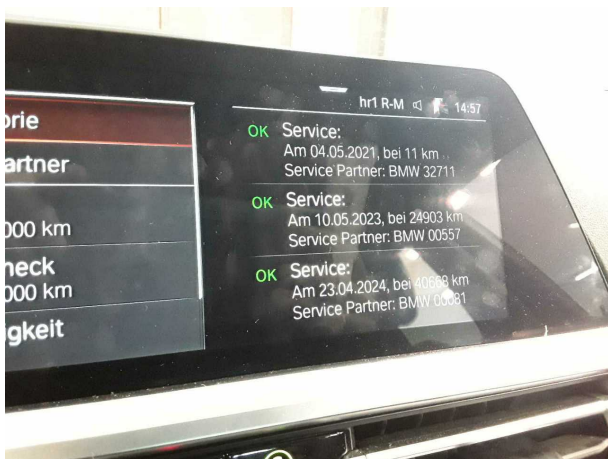


Figure 21: Misc.

Pictures of damage



Damage #2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage #3: Sill - left side: Sill - Dent(s) - Smooth repair work




Damage #4: Trim / covers: Door trim - front left side - Damaged - Loss in value



Damage #3: Sill - left side: Sill - Dent(s) - Smooth repair work



Damage #4: Trim / covers: Door trim - front left side - Damaged... - Loss in value

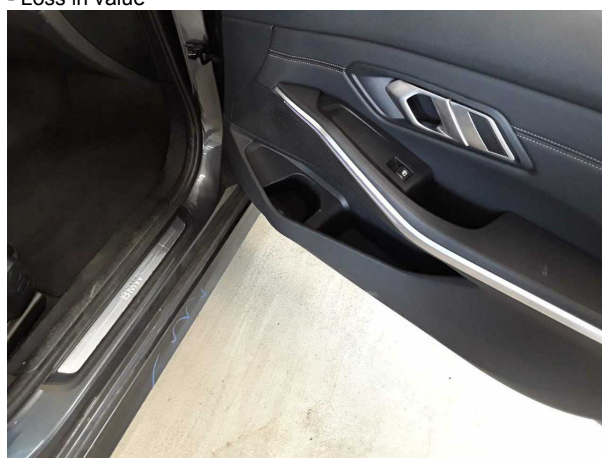


Damage #5: Trim / covers: Door trim - front right side - Scratched - Loss in value



Damage #5: Trim / covers: Door trim - front right side - Scratched - Loss in value



Damage #6: Side panel - rear left side: Sill - Scratched - Smart repair

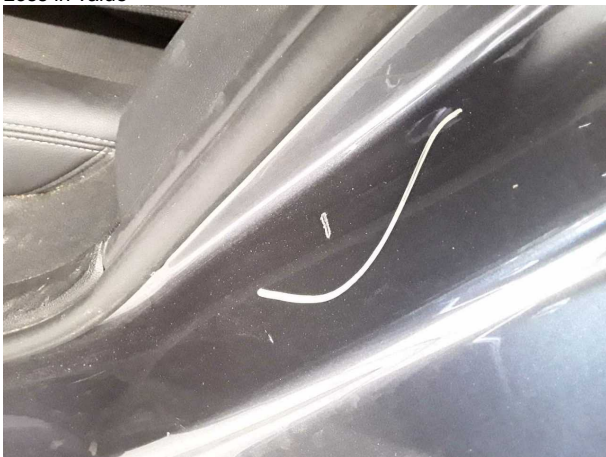

Damage #6: Side panel - rear left side: Sill - Scratched - Smart repair



Damage #7: Front bumper: Front bumper - Scratched - Smart repair



Damage #7: Front bumper: Front bumper - Scratched - Smart repair



Damage #8: Sill - right side: Trim - Scratched - Smart repair



Damage #8: Sill - right side: Trim - Scratched - Smart repair



Damage #10: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #10: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #9: Electronic systems: Electronic systems (iDrive ohne Funktion) - Specify findings - Perform diagnosis



Damage #10: Rear bumper: Rear bumper - Scratched - Repair and paint

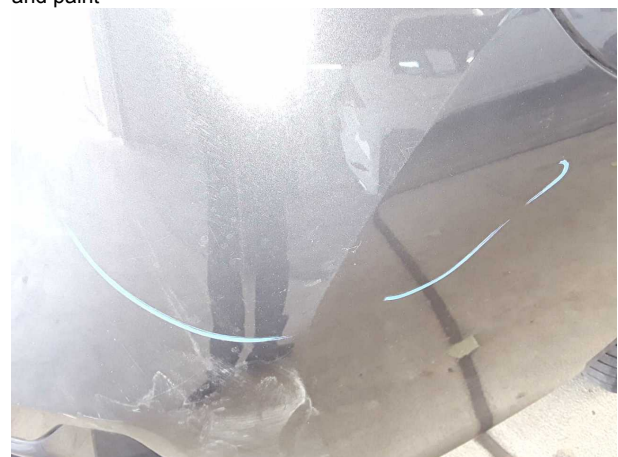

Damage #10: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #11: Door - rear right side: Door - Scratched - Repair and paint



Damage #11: Door - rear right side: Door - Scratched - Repair and paint



Damage #12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

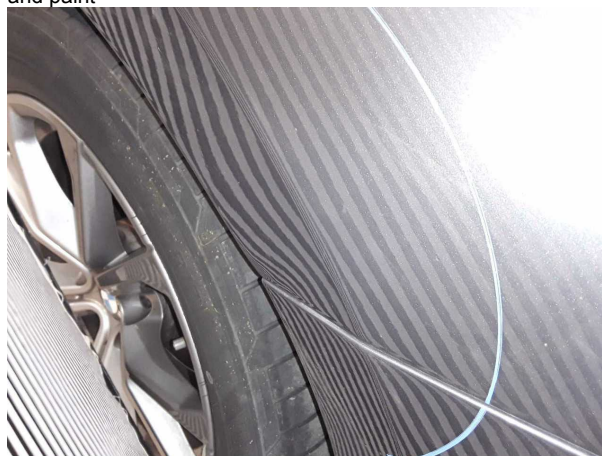

Damage #12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #12: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #13: Door - front right side: Door - Scratched - Repair and paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 18 Sept 2024
Protocol number: 35992719
Delivery date: 18 Sept 2024



Damage #13: Door - front right side: Door - Scratched - Repair and paint