



WBA5P51050FK81137

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	51,179 km
Manufacturer	BMW	Next maintenance in	-2 Monat(e)
Type / Model	330e	Main inspection (Report on hand)	02/2026
Vehicle Identification number	WBA5P51050FK81137	Power / Engine displacement	135 kW / 1,998 ccm
First registration	1 Feb 2021	Upholstery/Colour	/
Last maintenance	02/2024, 33,379 km	Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - Scratch(es) - Cover / polish
2	Wing mirror - right side	Cap - Scratched - Smart repair
3	Sill - left side	Sill - dent(s) - Smooth repair work
4	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
5	Side panel - rear left side	Sill - Scratched - Smart repair
6	Side panel - rear right side	Sill - Scratched - Smart repair
7	Misc.	Inspection / maintenance - Due - Replace
8	Rear bumper	Rear bumper - Scratched - Repair and paint
9	Door - rear right side	Door - Scratched - Repair and paint
10	Front bumper	Front bumper - Scratched - Repair and paint
11	Door - front left side	Door - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Interior	Interior - Abrasion - No deduction
2	Body	Body (Steinschläge) - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 30 Apr 2025
Protocol number: 39524525
Delivery date: 30 Apr 2025



Auto Plus

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98H	Pirelli	Winter tyres	5mm - 5mm	o.k.	
2	225/50 R17 98H	Kleber	Winter tyres	7mm - 7mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Bridgestone	Summer tyres	5mm - 5mm	o.k.	
2	225/50 R17 98Y	Bridgestone	Summer tyres	4mm - 4mm	o.k.	

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					07/2026

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 30 Apr 2025
Protocol number: 39524525
Delivery date: 30 Apr 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	330e	Mileage (Read)	51,179 km
Vehicle Identification number	WBA5P51050FK81137	First registration	1 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior

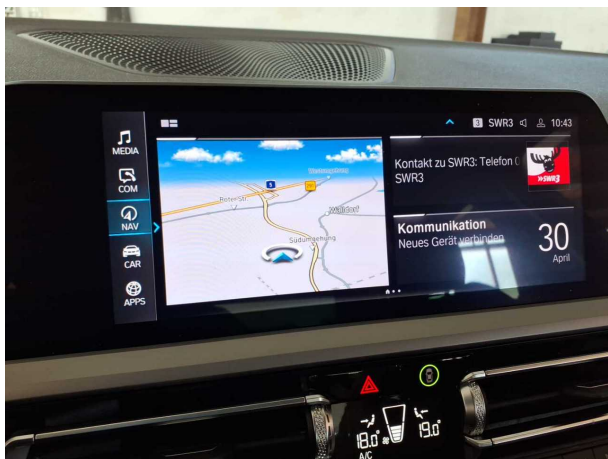


Figure 9: Interior

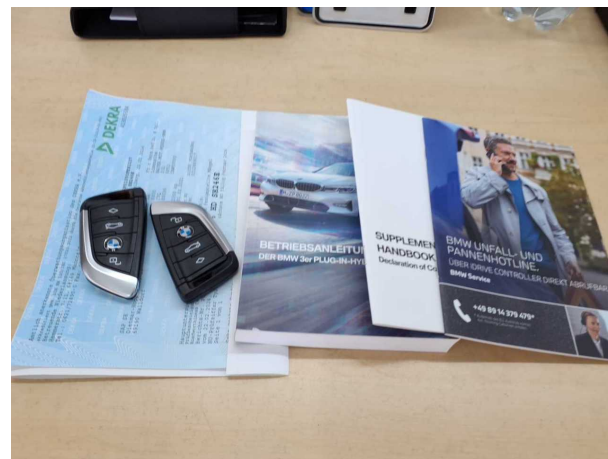


Figure 10: Misc.



Figure 11: Misc.

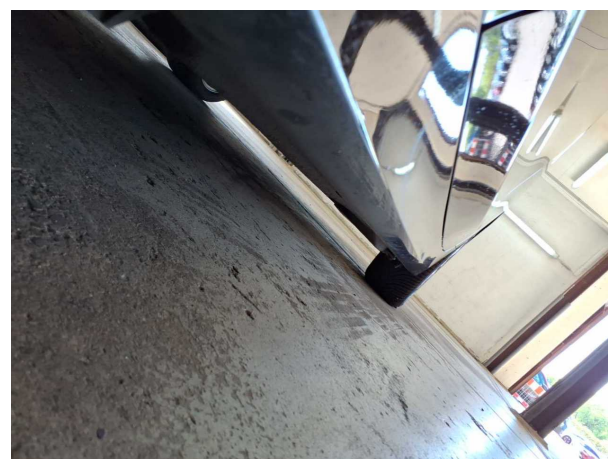


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

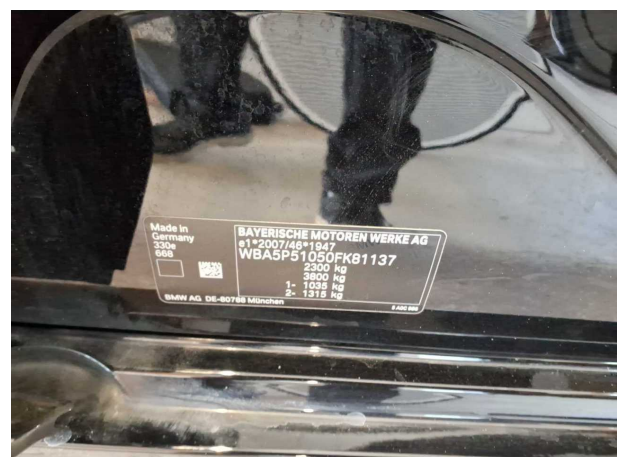


Figure 18: Misc.



Figure 19: Misc.

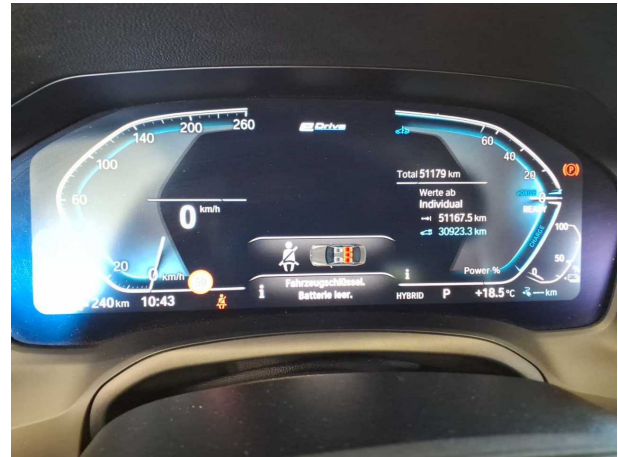


Figure 20: Misc.

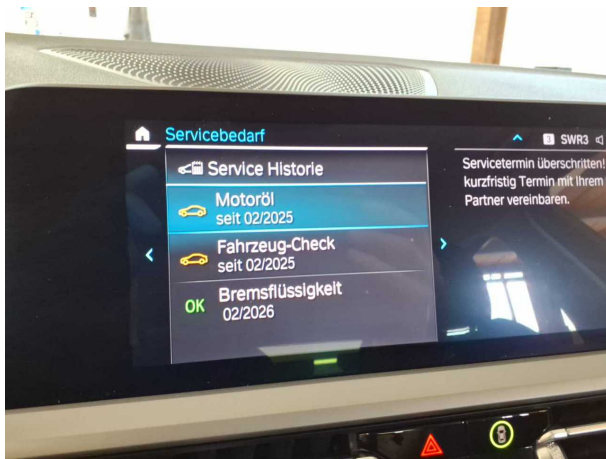


Figure 21: Misc.

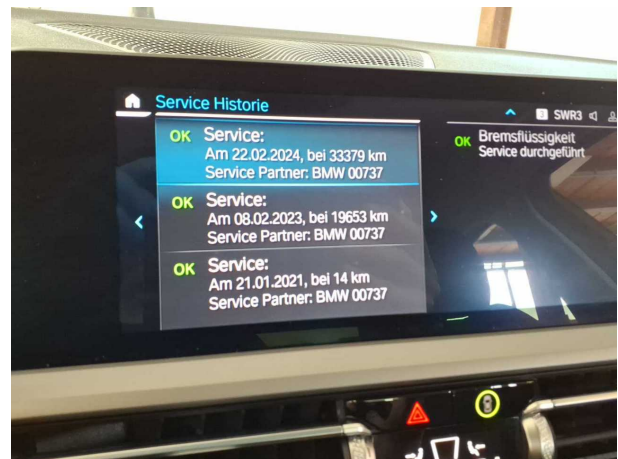


Figure 22: Misc.

Pictures of damage




Damage #1: Door - front right side: Door - Scratch(es) - Cover / polish



Damage #1: Door - front right side: Door - Scratch(es) - Cove...
polish



Damage #2: Wing mirror - right side: Cap - Scratched - Smart repair

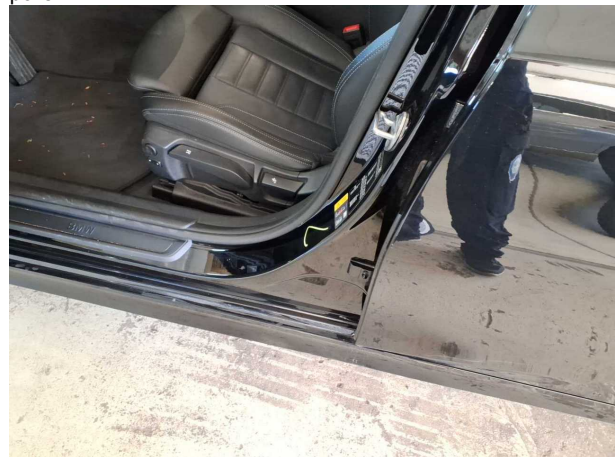


Damage #3: Sill - left side: Sill - dent(s) - Smooth repair work



Damage #3: Sill - left side: Sill - dent(s) - Smooth repair work



Damage #4: Side panel - rear right side: Side panel - dent(s) -
Smooth repair work

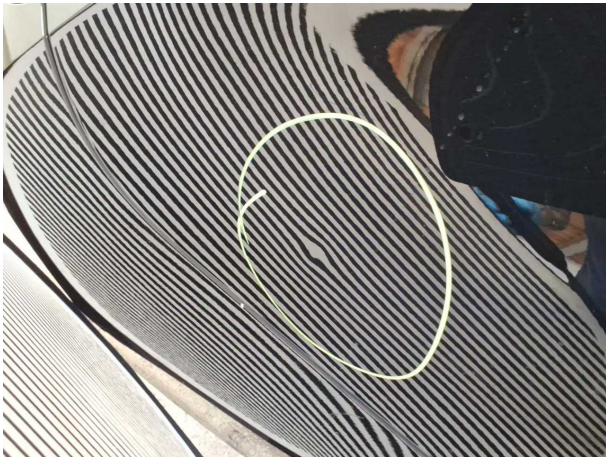

Damage #4: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage #5: Side panel - rear left side: Sill - Scratched - Smart repair




Damage #5: Side panel - rear left side: Sill - Scratched - Smart repair



Damage #5: Side panel - rear left side: Sill - Scratched - Smart repair

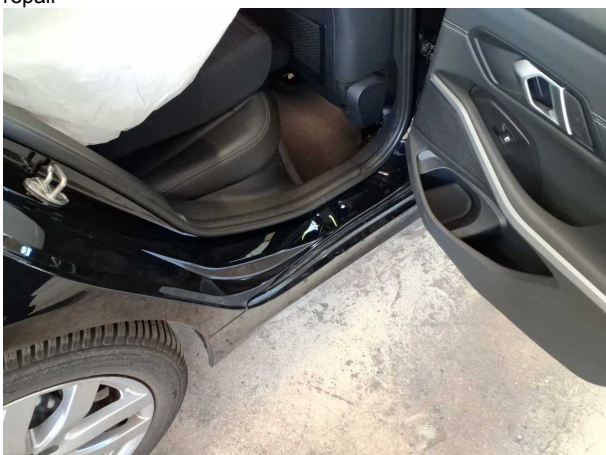

Damage #6: Side panel - rear right side: Sill - Scratched - Smart repair

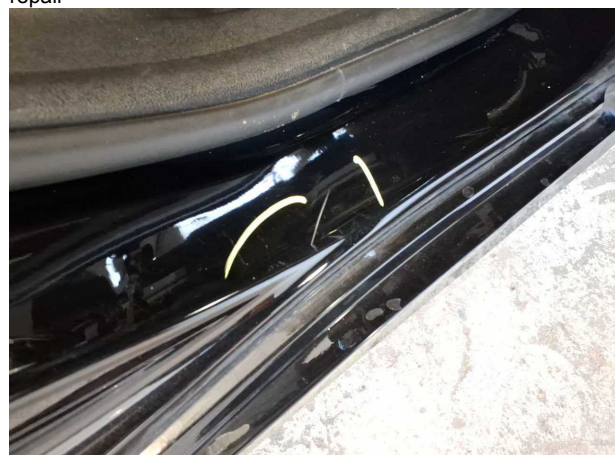

Damage #6: Side panel - rear right side: Sill - Scratched - Smart repair



Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint

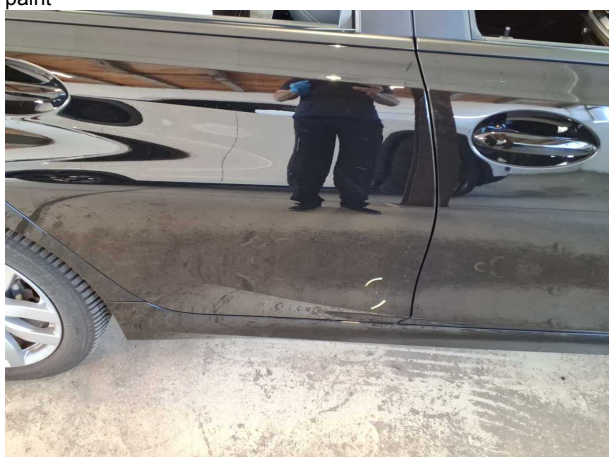

Damage #9: Door - rear right side: Door - Scratched - Repair and paint

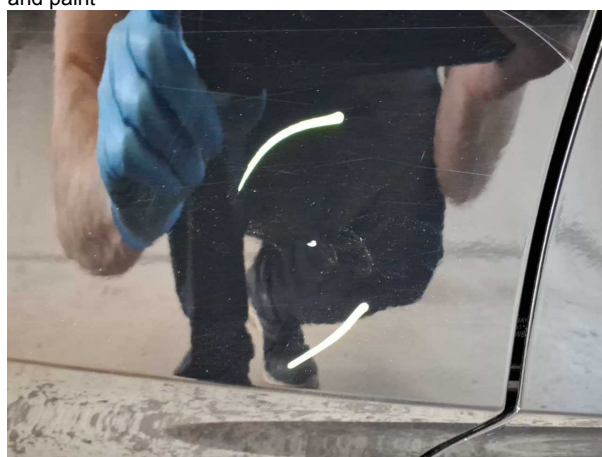

Damage #9: Door - rear right side: Door - Scratched - Repair and paint



Damage #9: Door - rear right side: Door - Scratched - Repair and paint




Damage #10: Front bumper: Front bumper - Scratched - Rep... and paint



Damage #10: Front bumper: Front bumper - Scratched - Repair and paint



Damage #10: Front bumper: Front bumper - Scratched - Rep... and paint

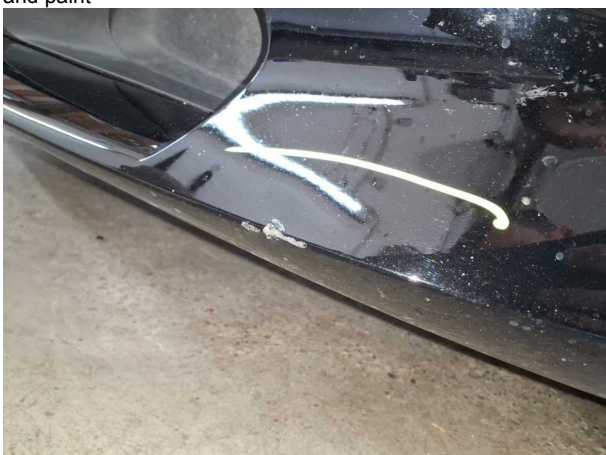

Damage #10: Front bumper: Front bumper - Scratched - Repair and paint



Damage #11: Door - front left side: Door - Scratched - Repair and paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 30 Apr 2025
Protocol number: 39524525
Delivery date: 30 Apr 2025



Auto Plus



Damage #11: Door - front left side: Door - Scratched - Repair and paint



Damage #11: Door - front left side: Door - Scratched - Repair and paint