



WAUZZZFY2L2125716

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	74,392 km
Manufacturer	Audi	Next maintenance in	20 km
Type / Model	Q5 50 TFSI e	Main inspection (Report not on hand)	01/2026
Vehicle Identification number	WAUZZZFY2L2125716	Power / Engine displacement	185 kW / 1,984 ccm
First registration	24 Nov 2020	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Documents	Service book (Wartungsnachweise fehlen) - No deduction
2	Documents	Main inspection certificate (Fehlt) - Replace
3	2nd wheel set	1 tyre - Damaged - Replace
4	Misc.	Inspection / maintenance - Due - Replace
5	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace
6	Door - rear right side	Door - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body (Steinschläge) - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/55 R19 101H	Michelin	Winter tyres	5mm - 5mm	o.k.	
2	235/55 R19 101H	Michelin	Winter tyres	6mm - 6mm	o.k.	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 30 Dec 2024

Protocol number: 37716138

Delivery date: 30 Dec 2024



Auto Plus

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	255/45 R20 101W	Continental	Summer tyres	3mm - 3mm	Not o.k.	
2	255/45 R20 101W	Continental	Summer tyres	4mm - 4mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 30 Dec 2024
Protocol number: 37716138
Delivery date: 30 Dec 2024



Vehicle details

Manufacturer	Audi	Inspection condition	Sufficient
Type / Model	Q5 50 TFSI e	Mileage (Read)	74,392 km
Vehicle Identification number	WAUZZZFY2L2125716	First registration	24 Nov 2020

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was verified during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

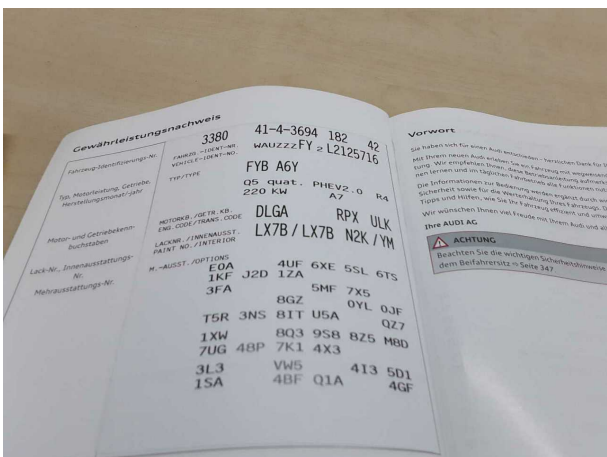


Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

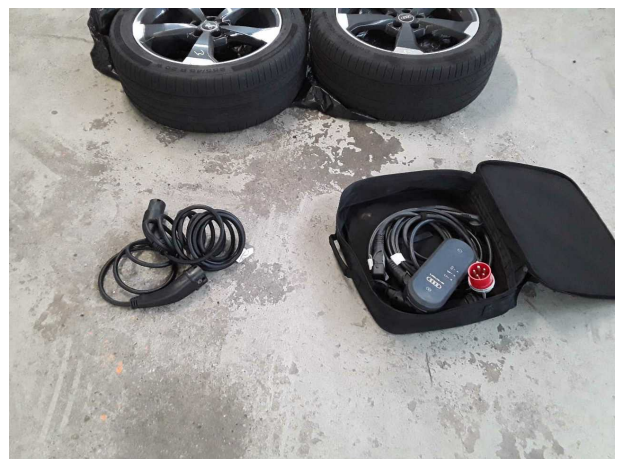


Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 30 Dec 2024
Protocol number: 37716138
Delivery date: 30 Dec 2024



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

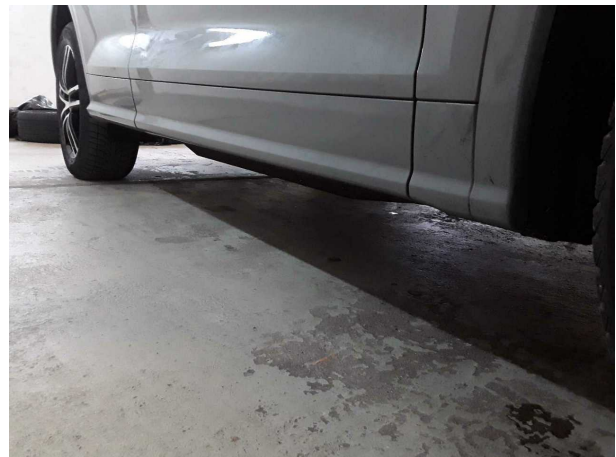


Figure 22: Misc.

Pictures of damage



Damage #3: 2nd wheel set: 1 tyre - Damaged - Replace




Damage #3: 2nd wheel set: 1 tyre - Damaged - Replace



Damage #3: 2nd wheel set: 1 tyre - Damaged - Replace



Damage #4: Misc.: Inspection / maintenance - Due - Replace

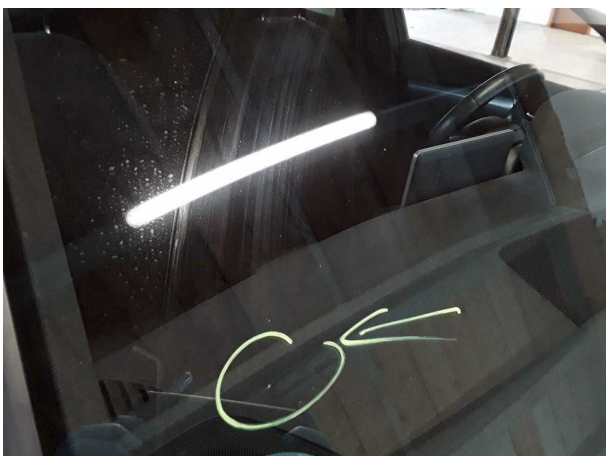

Damage #5: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage #5: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 30 Dec 2024
Protocol number: 37716138
Delivery date: 30 Dec 2024



Damage #6: Door - rear right side: Door - Scratched - Repair and paint



Damage #6: Door - rear right side: Door - Scratched - Repair and paint