



WBAJX21050BU93296

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	129,769 km
Manufacturer	BMW	Next maintenance in	14,000 km
Type / Model	620d	Main inspection (Report on hand)	05/2024
Vehicle Identification number	WBAJX21050BU93296	Power / Engine displacement	140 kW / 1,995 ccm
First registration	7 Mar 2019	Upholstery/Colour	/
Last maintenance	01/2024, 116,812 km	Paintwork	
Fuel type	Diesel	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - Cover / polish
2	Braking system	Brake fluid - Due - Replace
3	Misc.	Main inspection - Due - Replace
4	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
5	Boot lid / rear door	Boot lid - Scratched - Smart repair
6	Rear bumper	Rear bumper - Scratched - Smart repair
7	Side panel - rear left side	Sill - Scratched - Smart repair
8	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
9	Seat - front	Seat - right side (Verkleidung) - Loose - Un- / install
10	Front axle	Air suspension compressor - Specify findings - Perform diagnosis
11	Instrument panel	Indicator light (MIL Brennt) - Specify findings - Perform diagnosis
12	2nd wheel set	Alloy rim set - complete - Scratched - Loss in value

Wear and tear

No.	Component group	Description
1	Door - front left side	Door edge - Scratched - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Body	Body (Steinschläge) - Scratch(es) - No deduction
4	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Detected repainting

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 28 Jun 2024

Protocol number: 34599455

Delivery date: 28 Jun 2024



Auto Plus

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/50 R18 104V	Goodyear	Winter tyres	6mm - 6mm	o.k.	
2	245/50 R18 104V	Goodyear	Winter tyres	5mm - 5mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R19 102Y	Michelin	Summer tyres	4mm - 4mm	o.k.	
2	245/45 R19 102Y	Michelin	Summer tyres	4mm - 4mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung verschmutzt, weitere Beschädigungen können nicht ausgeschlossen werden

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 28 Jun 2024

Protocol number: 34599455

Delivery date: 28 Jun 2024



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	620d	Mileage (Read)	129,769 km
Vehicle Identification number	WBAJX21050BU93296	First registration	7 Mar 2019

Vehicle identification:

The vehicle identification number (VIN) was read and compliance with the documents presented was determined during the inspection by the signatory.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions that can be reproduced using the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Interior



Figure 4: Interior



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior

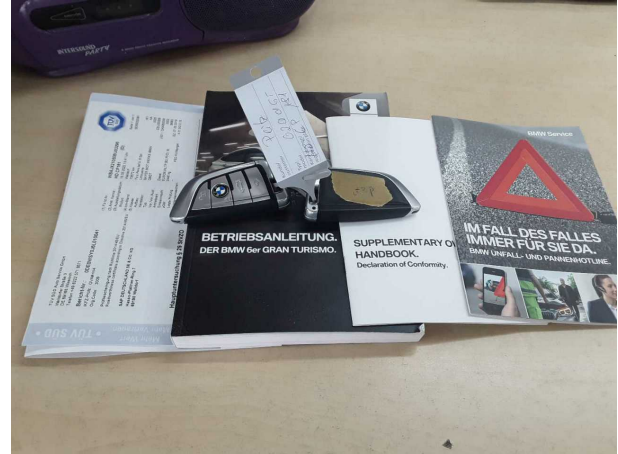


Figure 8: Misc.



Figure 9: Misc.

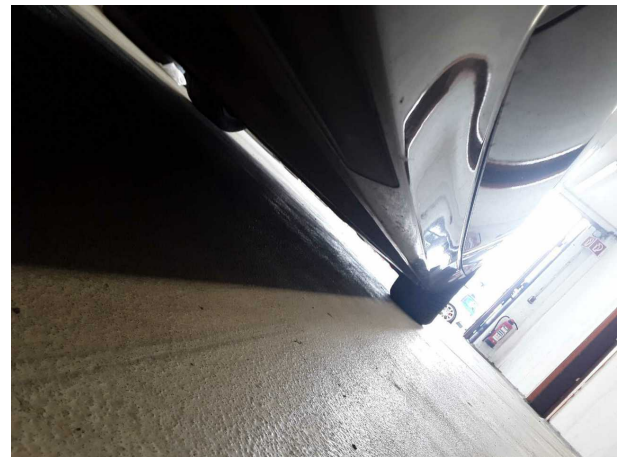


Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.

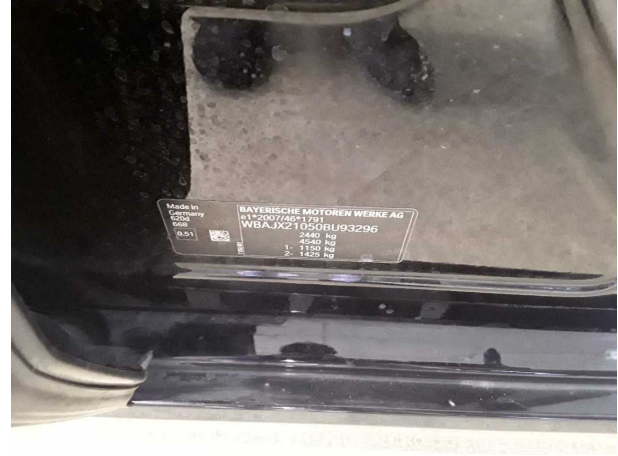


Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

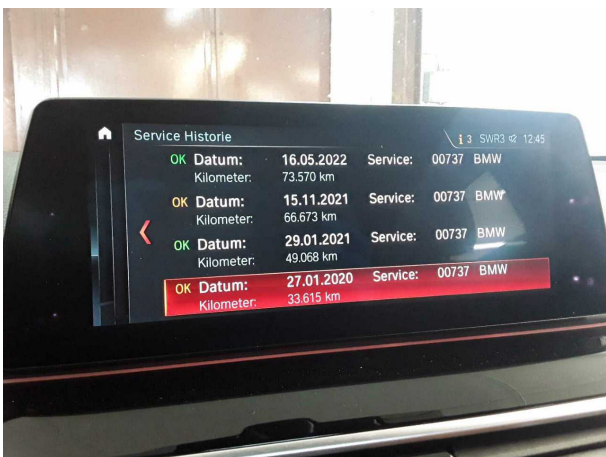


Figure 17: Misc.

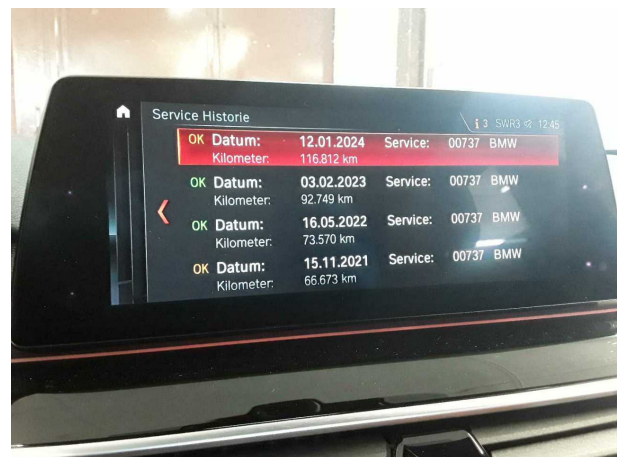


Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 28 Jun 2024
Protocol number: 34599455
Delivery date: 28 Jun 2024



Auto Plus

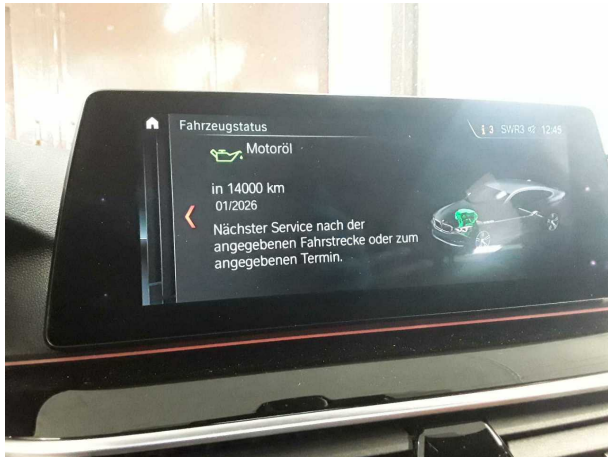


Figure 19: Misc.

Pictures of damage



Damage #1: Door - rear right side: Door - Scratch(es) - Cover / polish




Damage #1: Door - rear right side: Door - Scratch(es) - Cover / polish




Damage #2: Braking system: Brake fluid - Due - Replace




Damage #4: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace

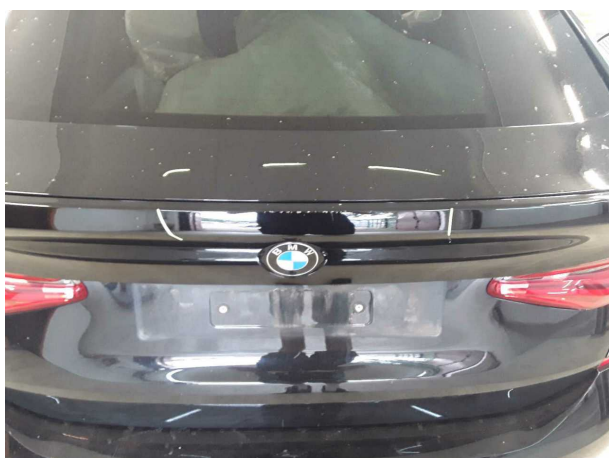

Damage #5: Boot lid / rear door: Boot lid - Scratched - Smart repair

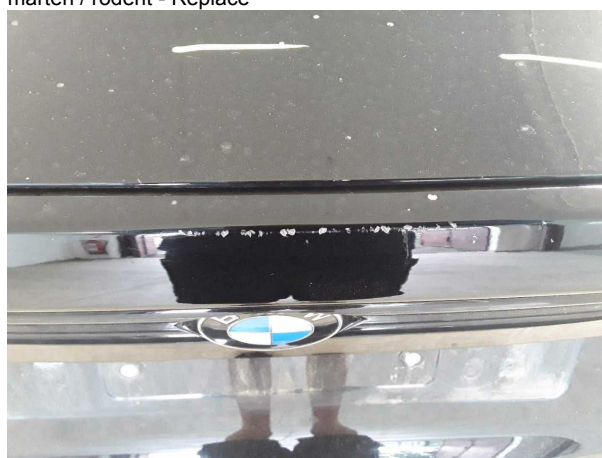

Damage #5: Boot lid / rear door: Boot lid - Scratched - Smart repair

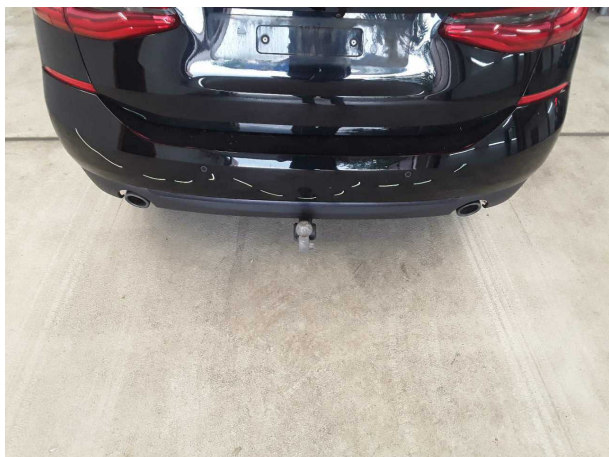

Damage #6: Rear bumper: Rear bumper - Scratched - Smart repair



Damage #6: Rear bumper: Rear bumper - Scratched - Smart repair




Damage #6: Rear bumper: Rear bumper - Scratched - Smart repair




Damage #6: Rear bumper: Rear bumper - Scratched - Smart repair




Damage #7: Side panel - rear left side: Sill - Scratched - Smart repair

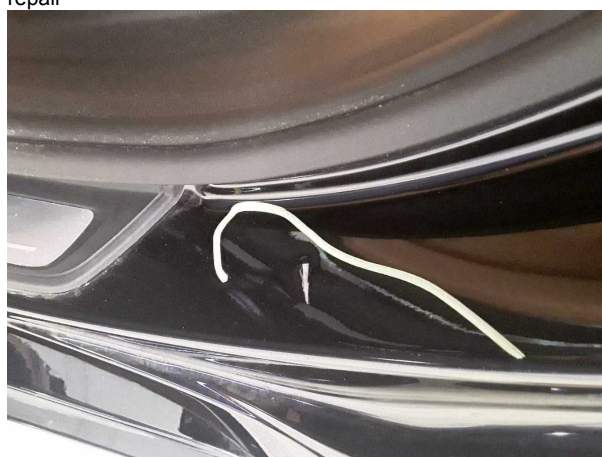


Damage #7: Side panel - rear left side: Sill - Scratched - Smart repair

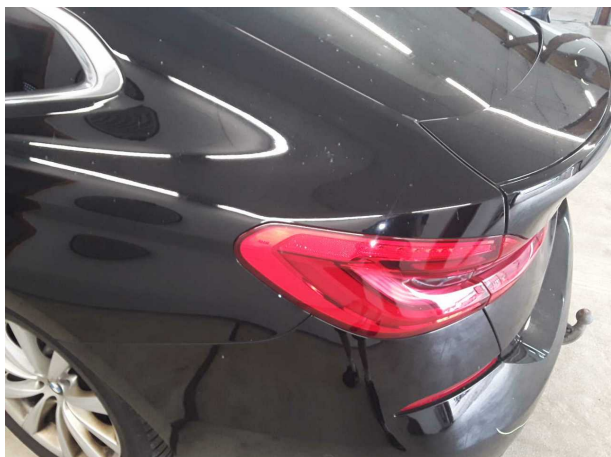


Damage #8: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

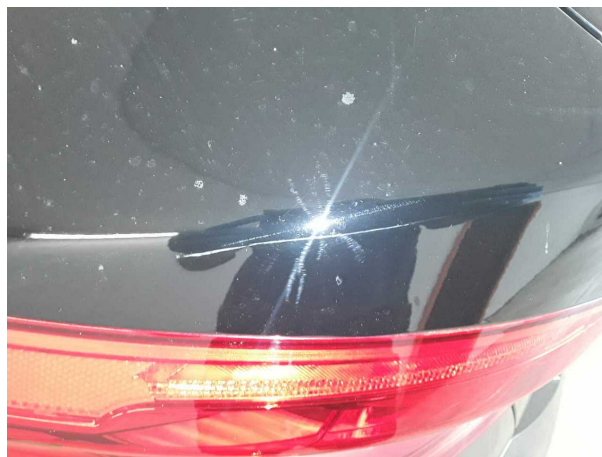


Damage #8: Side panel - rear left side: Side panel - Scratch(...
- Smart repair

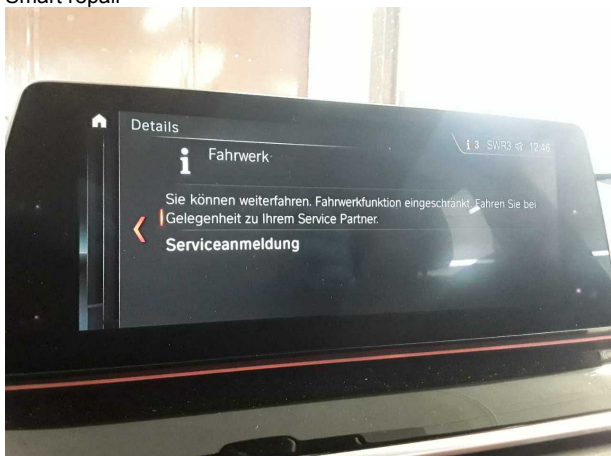


Damage #10: Front axle: Air suspension compressor - Specify findings - Perform diagnosis

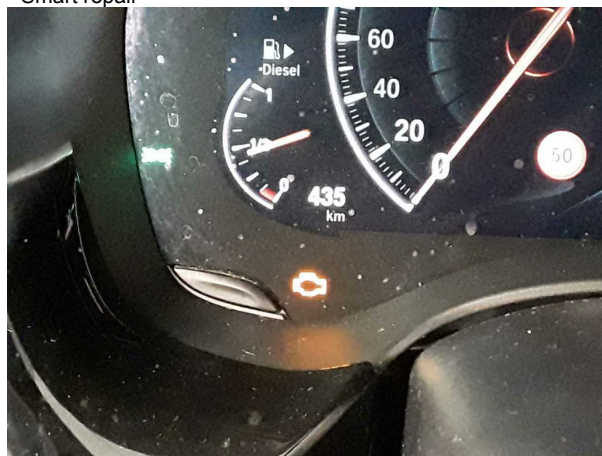

Damage #11: Instrument panel: Indicator light (MIL Brennt) - Specify findings - Perform diagnosis

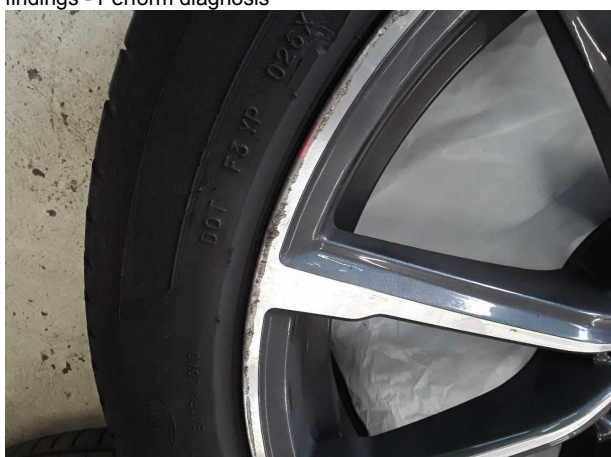

Damage #12: 2nd wheel set: Alloy rim set - complete - Scratched - Loss in value

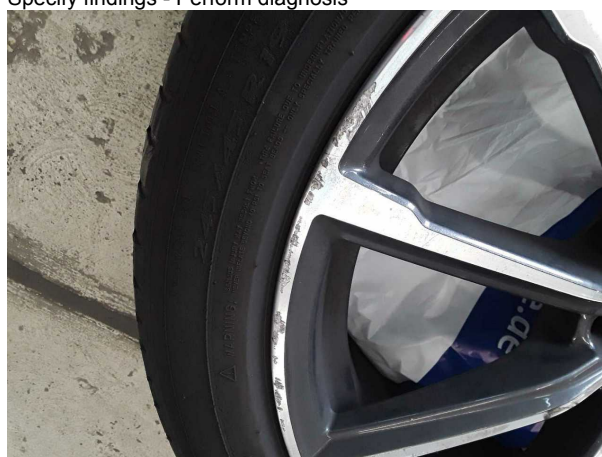

Damage #12: 2nd wheel set: Alloy rim set - complete - Scratched - Loss in value

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 28 Jun 2024
Protocol number: 34599455
Delivery date: 28 Jun 2024



Auto Plus



Damage #12: 2nd wheel set: Alloy rim set - complete - Scratched - Loss in value



Damage #12: 2nd wheel set: Alloy rim set - complete - Scratched - Loss in value