

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
TÜV SÜD Autopartner
Ingenieurbüro MM
Germaniastraße 3
31275 Lehrte

Inspection date: 11 Nov 2024
Protocol number: 36944128
Created by: Gerd Bierschenk
Mohamad Jamen
Inspected by: Mudrek



WBA31ED070FL89683

Vehicle details

Operator	Vertrags-Nummer: 64713077	Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	60,298 km
Manufacturer	BMW	Next maintenance in	3 Monat(e)
Type / Model	320e xDrive	Main inspection (Read from ZBI)	11/2026
Vehicle Identification number	WBA31ED070FL89683	Power / Engine displacement	120 kW / 1,998 ccm
First registration	21 Sept 2021	Upholstery/Colour	Leather / Black
Last maintenance		Paintwork	White
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Braking system	Brake fluid - Due - Replace
2	Front bumper	Front bumper - Scratch(es) - Smart repair
3	Instrument panel	Indicator light (AHK) - on - Diagnosed and repair if necessary
4	Bonnet	Bonnet - Stone chips - Smart repair
5	Misc.	Inspection / maintenance (Digitale Serviceberichte fehlen, 24 Monate/30000 km) - No evidence - Loss in value
6	Body	Underbody panelling - Broken / torn - Replace
7	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
8	Rear bumper	Rear bumper - Broken / torn - Replace

Wear and tear

No.	Component group	Description
The vehicle shows traces of wear and tear corresponding to its age and purpose		

Missing parts

Missing part
Equipment - Vehicle key

Detected repainting

No.	Location
None detectable	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
TÜV SÜD Autopartner
Ingenieurbüro MM
Germaniastraße 3
31275 Lehrte

Inspection date: 11 Nov 2024
Protocol number: **36944128**
Created by: Gerd Bierschenk
Inspected by: Mohamad Jamen
Mudrek



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98V	Bridgestone	Winter tires (with run-flat tires)	6mm - 6mm	o.k.	o.k.
2	225/50 R17 98V	Bridgestone	Winter tires (with run-flat tires)	6mm - 6mm	o.k.	o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Hankook	Summer tires (with run-flat tires)	5mm - 5mm	o.k.	o.k.
2	225/50 R17 98Y	Hankook	Summer tires (with run-flat tires)	5mm - 5mm	o.k.	o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

- Winterradsatz kein Bestandteil des Auslieferungsumfanges.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
TÜV SÜD Autopartner
Ingenieurbüro MM
Germaniastraße 3
31275 Lehrte

Inspection date: 11 Nov 2024
Protocol number: 36944128
Created by: Gerd Bierschenk
Inspected by: Mohamad Jamen
Mudrek



Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	320e xDrive	Mileage (Read)	60,298 km
Vehicle Identification number	WBA31ED070FL89683	First registration	21 Sept 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was verified during the inspection by the undersigned.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be guaranteed to be sufficient for an assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

A handwritten signature in blue ink, appearing to read 'Gerd Bierschenk', written over a horizontal line.

Expert's signature (Gerd Bierschenk)

The current printed copy was produced by electronic means. The named technical expert states that the content correctly represents his or her findings. It is valid without an original signature.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
TÜV SÜD Autopartner
Ingenieurbüro MM
Germaniastraße 3
31275 Lehrte

Inspection date: 11 Nov 2024
Protocol number: 36944128
Created by: Gerd Bierschenk
Inspected by: Mohamad Jamen
Mudrek



Overview pictures



Figure 1: VIN



Figure 2: Diagonal front



Figure 3: Diagonal front



Figure 4: Diagonal rear



Figure 5: Diagonal rear



Figure 6: Mounted tyres



Figure 7: Interior - front



Figure 8: Instrument cluster



Figure 9: Instrument cluster



Figure 10: Instrument panel

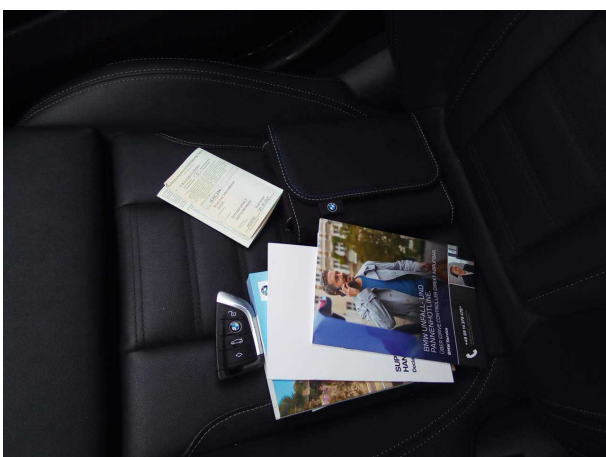


Figure 11: Documents



Figure 12: Additional tyres

Pictures of damage



Damage #1: Braking system: Brake fluid - Due - Replace




Damage #2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage #2: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage #3: Instrument panel: Indicator light (AHK) - on - Diagnosed and repair if necessary

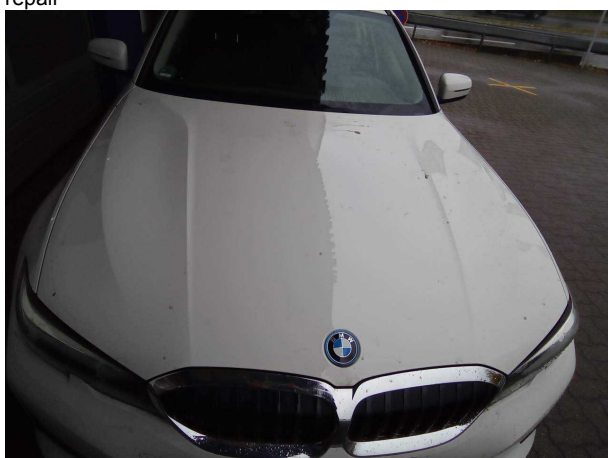


Damage #4: Bonnet: Bonnet - Stone chips - Smart repair




Damage #4: Bonnet: Bonnet - Stone chips - Smart repair



Damage #4: Bonnet: Bonnet - Stone chips - Smart repair

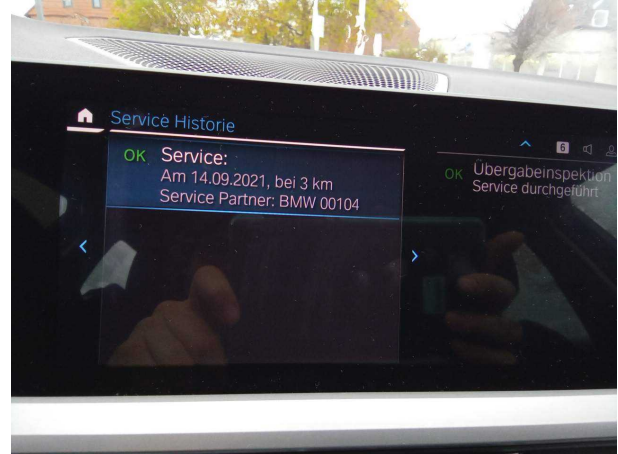

Damage #5: Misc.: Inspection / maintenance (Digitale Serviceberichte fehlen, 24 Monate/30000 km) - No evidence -

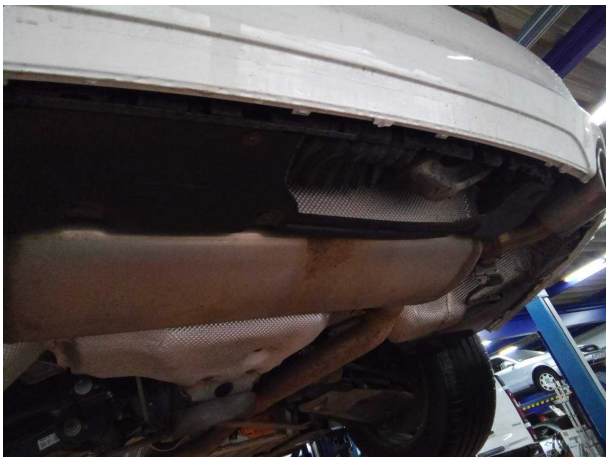

Damage #6: Body: Underbody panelling - Broken / torn - Replace



Damage #6: Body: Underbody panelling - Broken / torn - Replace



Damage #6: Body: Underbody panelling - Broken / torn - Replace



Damage #7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
TÜV SÜD Autopartner
Ingenieurbüro MM
Germaniastraße 3
31275 Lehrte

Inspection date: 11 Nov 2024
Protocol number: 36944128
Created by: Gerd Bierschenk
Inspected by: Mohamad Jamen
Mudrek



Damage #7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Rear bumper: Rear bumper - Broken / torn - Replace



Damage #8: Rear bumper: Rear bumper - Broken / torn - Replace