



WBA6V710305T03597

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	84,124 km
Manufacturer	BMW	Next maintenance in	6,000 km
Type / Model	218i Gran Tourer	Main inspection (Report on hand)	02/2026
Vehicle Identification number	WBA6V710305T03597	Power / Engine displacement	100 kW / 1,499 ccm
First registration	1 Feb 2021	Upholstery/Colour	/
Last maintenance	02/2024, 69,748 km	Paintwork	
Fuel type	Petrol	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front - Worn - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratched - No deduction
3	Wheel / tyres	Alloy rim - rear left side - Scratched - No deduction
4	Wheel / tyres	Alloy rim - front right side - Scratched - No deduction
5	Side panel - rear left side	Side panel - Paint defect - Cover / polish
6	Mudguard - right side	Mudguard - right side - Paint defect - Cover / polish
7	Trim / covers	Door trim - rear right side - Damaged - Loss in value
8	Documents	Log book (Fehlt) - Replace
9	Door - rear left side	Door seal - Damaged - Replace
10	Boot lid / rear door	Boot lid - Dent(s) - Smooth repair work
11	Side panel - rear right side	Sill - Dent(s) - Smooth repair work
12	Door - rear right side	Door - Dent(s) - Smooth repair work
13	2nd wheel set	1 alloy rim - Scratched - Loss in value
14	Roof	Roof rail - right side - Dent(s) - Smooth repair work
15	2nd wheel set	2 tyres (Vorne) - Worn - Replace
16	Rear bumper	Rear bumper - Scratched - Repair and paint
17	Vehicle glazing	Windscreen - Stone chips - Replace
18	Front bumper	Front bumper - Deformed - Replace
19	Body	Body (Mehr kosten möglich) - Damage by hail - Smooth repair work

Wear and tear

No.	Component group	Description
1	Door - rear right side	Door edge - Scratched - No deduction



Missing parts

Missing part

Previous damages

No.	Previous damage
1	Front, Side right, Provided by user / customer

Detected repainting

No.	Location
	None detectable

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/55 R17 95H	Pirelli	Winter tyres	4mm - 4mm	Not o.k.	
2	205/55 R17 95H	Pirelli	Winter tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/60 R16 96W	Continental	Summer tyres	3mm - 3mm	Not o.k.	
2	205/60 R16 96W	Continental	Summer tyres	6mm - 6mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n .i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 5 Feb 2025
Protocol number: 38278101
Delivery date: 5 Feb 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	218i Gran Tourer	Mileage (Read)	84,124 km
Vehicle Identification number	WBA6V710305T03597	First registration	1 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was verified during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 5 Feb 2025
Protocol number: **38278101**
 Delivery date: 5 Feb 2025



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

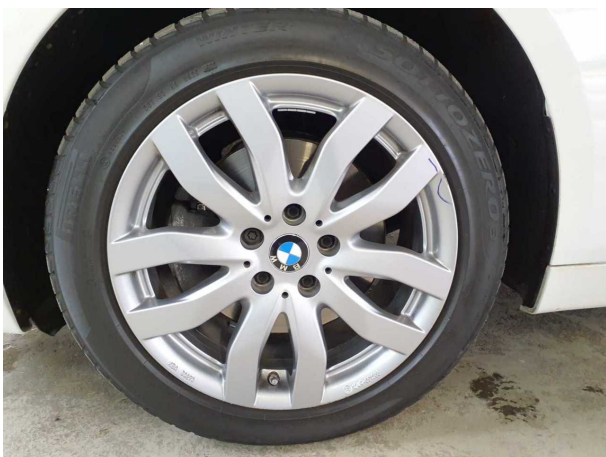


Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

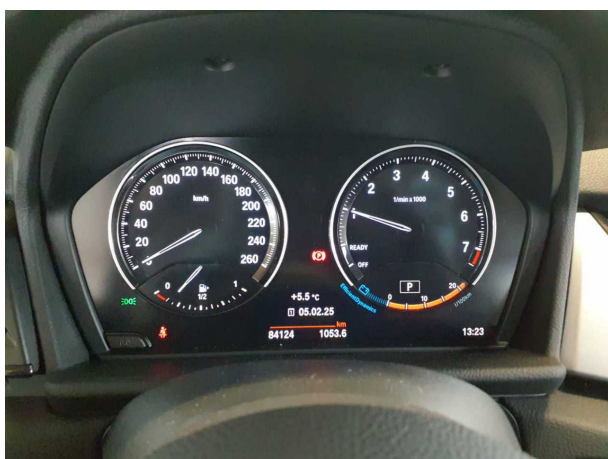


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 5 Feb 2025
Protocol number: 38278101
Delivery date: 5 Feb 2025



Auto Plus



Figure 25: Misc.

Pictures of damage



Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction




Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction




Damage #2: Wheel / tyres: Alloy rim - front left side - Scratched - No deduction



Damage #2: Wheel / tyres: Alloy rim - front left side - Scratched - No deduction

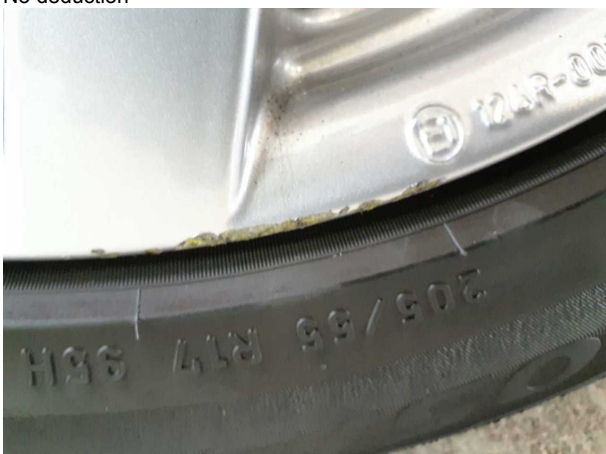


Damage #2: Wheel / tyres: Alloy rim - front left side - Scratched - No deduction

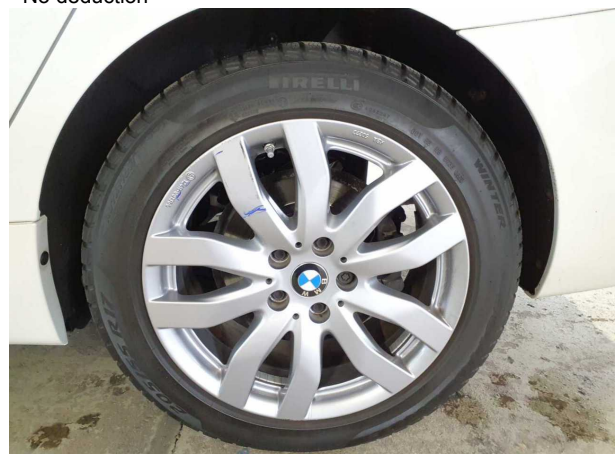

Damage #3: Wheel / tyres: Alloy rim - rear left side - Scratched - No deduction




Damage #3: Wheel / tyres: Alloy rim - rear left side - Scratched - ... deduction

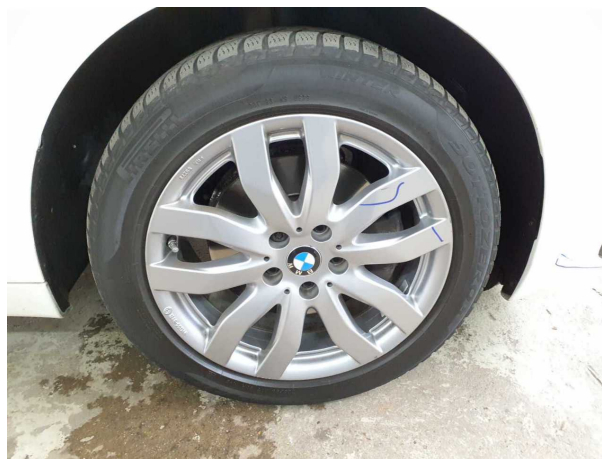

Damage #4: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction




Damage #4: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction

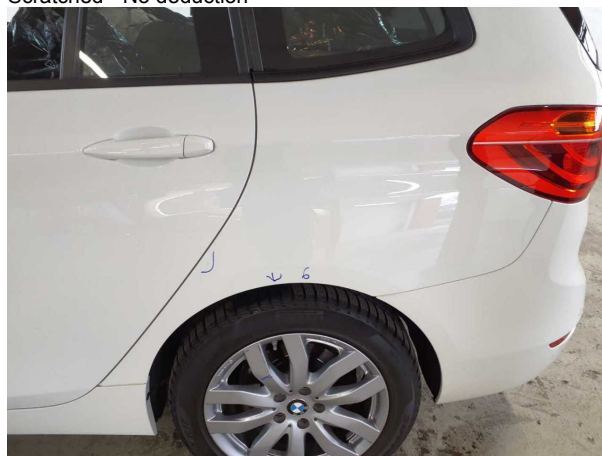

Damage #5: Side panel - rear left side: Side panel - Paint defect - Cover / polish



Damage #5: Side panel - rear left side: Side panel - Paint defect - Cover / polish

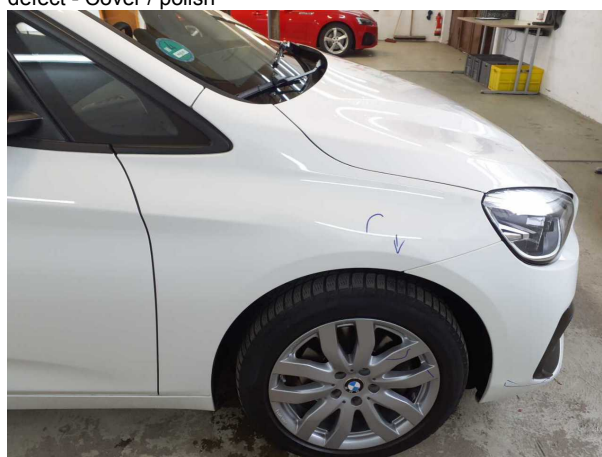


Damage #6: Mudguard - right side: Mudguard - right side - Paint defect - Cover / polish



Damage #6: Mudguard - right side: Mudguard - right side - Paint defect - Cover / polish



Damage #7: Trim / covers: Door trim - rear right side - Damaged - Loss in value

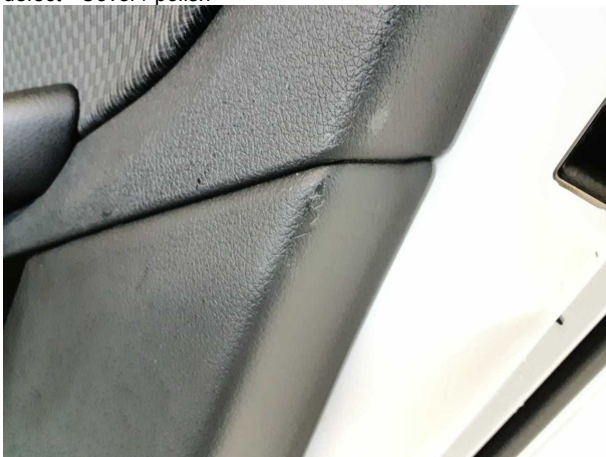

Damage #7: Trim / covers: Door trim - rear right side - Damaged - Loss in value



Damage #7: Trim / covers: Door trim - rear right side - Damaged - Loss in value



Damage #9: Door - rear left side: Door seal - Damaged - Replace



Damage #10: Boot lid / rear door: Boot lid - Dent(s) - Smooth repair work



Damage #10: Boot lid / rear door: Boot lid - Dent(s) - Smooth repair work



Damage #11: Side panel - rear right side: Sill - Dent(s) - Smooth repair work



Damage #11: Side panel - rear right side: Sill - Dent(s) - Smooth repair work



Damage #12: Door - rear right side: Door - Dent(s) - Smooth repair work



Damage #12: Door - rear right side: Door - Dent(s) - Smooth repair work



Damage #13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #13: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #14: Roof: Roof rail - right side - Dent(s) - Smooth repair work



Damage #14: Roof: Roof rail - right side - Dent(s) - Smooth repair work



Damage #15: 2nd wheel set: 2 tyres (Vorne) - Worn - Replace



Damage #15: 2nd wheel set: 2 tyres (Vorne) - Worn - Replace



Damage #16: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #16: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #16: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #17: Vehicle glazing: Windscreen - Stone chips - Replace

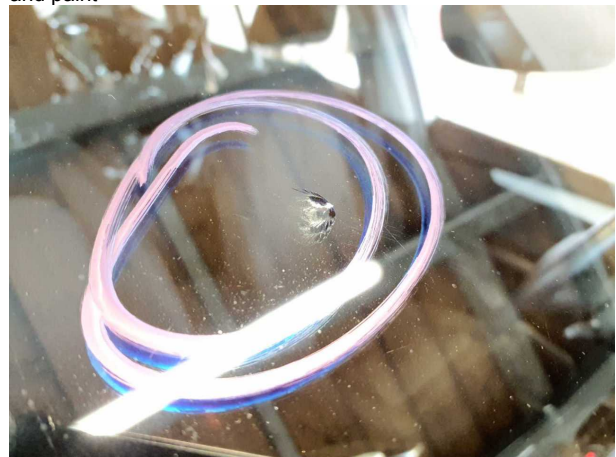

Damage #17: Vehicle glazing: Windscreen - Stone chips - Replace



Damage #18: Front bumper: Front bumper - Deformed - Replace

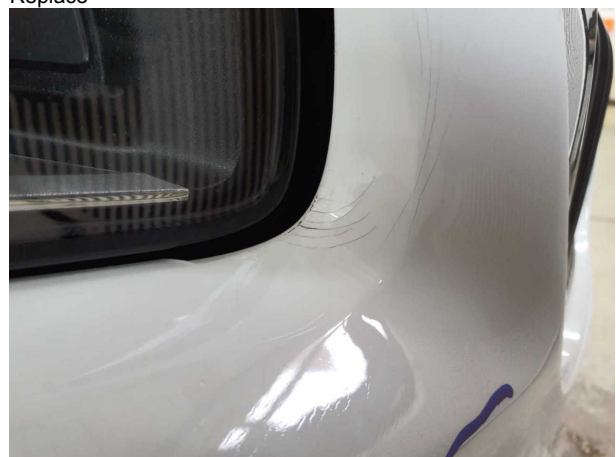

Damage #18: Front bumper: Front bumper - Deformed - Replace



Damage #18: Front bumper: Front bumper - Deformed - Replace




Damage #18: Front bumper: Front bumper - Deformed - Replace



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail - Smooth repair work



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail - Smooth repair work

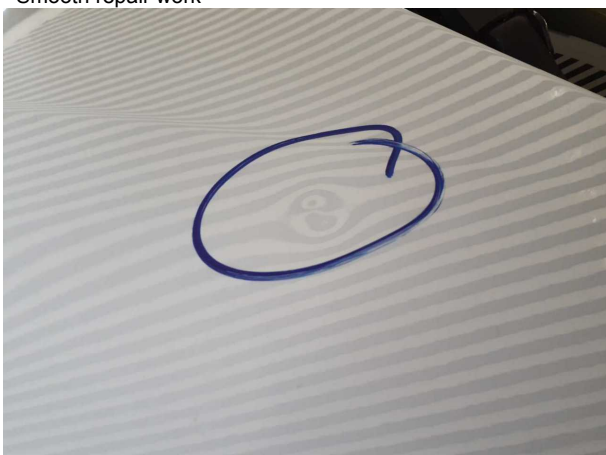

Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail - Smooth repair work



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail - Smooth repair work



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail
- Smooth repair work




Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail
- Smooth repair work



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail
- Smooth repair work



Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail
- Smooth repair work

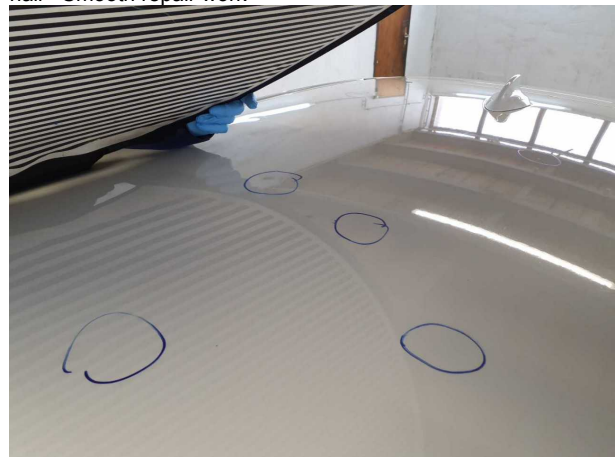

Damage #19: Body: Body (Mehr kosten möglich) - Damage by hail
- Smooth repair work