



WBA11AJ000CG78249

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	71,617 km
Manufacturer	BMW	Next maintenance in	20,000 km
Type / Model	530d	Main inspection (Report on hand)	03/2026
Vehicle Identification number	WBA11AJ000CG78249	Power / Engine displacement	210 kW / 2,993 ccm
First registration	11 Mar 2021	Upholstery/Colour	/
Last maintenance	07/2024, 58,612 km	Paintwork	
Fuel type	Hybrid Diesel / E	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Rear bumper	Spoiler - Scratch(es) - Loss in value
3	Steering system	Steering wheel - Scratch(es) - Loss in value
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Vehicle glazing	Windscreen - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Body	Body (Steinschläge) - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R17 97H	Pirelli	Winter tyres	6mm - 6mm	o.k.	
2	225/55 R17 97H	Pirelli	Winter tyres	4mm - 4mm	o.k.	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 20 Mar 2025
Protocol number: 38932711
Delivery date: 20 Mar 2025



Auto Plus

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R17 101Y	Pirelli	Summer tyres	5mm - 5mm	o.k.	
2	225/55 R17 101Y	Pirelli	Summer tyres	5mm - 5mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 20 Mar 2025
Protocol number: 38932711
Delivery date: 20 Mar 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	530d	Mileage (Read)	71,617 km
Vehicle Identification number	WBA11AJ000CG78249	First registration	11 Mar 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was established during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 20 Mar 2025
Protocol number: 38932711
Delivery date: 20 Mar 2025



Figure 7: Interior



Figure 8: Interior

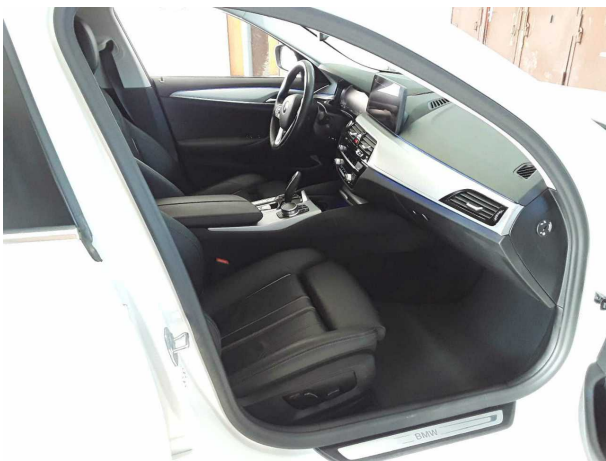


Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.

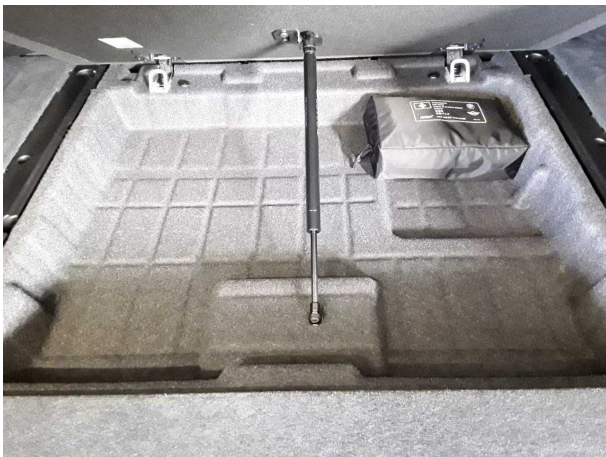


Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 20 Mar 2025
Protocol number: 38932711
Delivery date: 20 Mar 2025



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

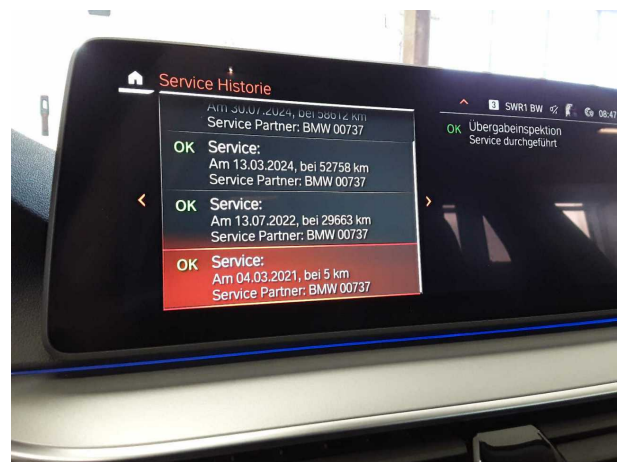


Figure 22: Misc.



Figure 23: Misc.



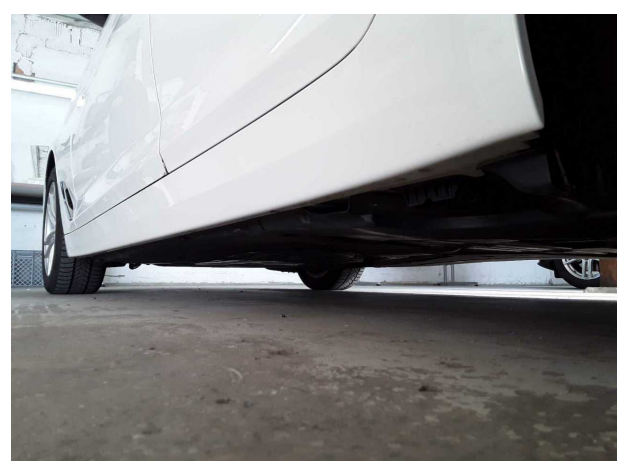


Figure 24: Misc.

Pictures of damage

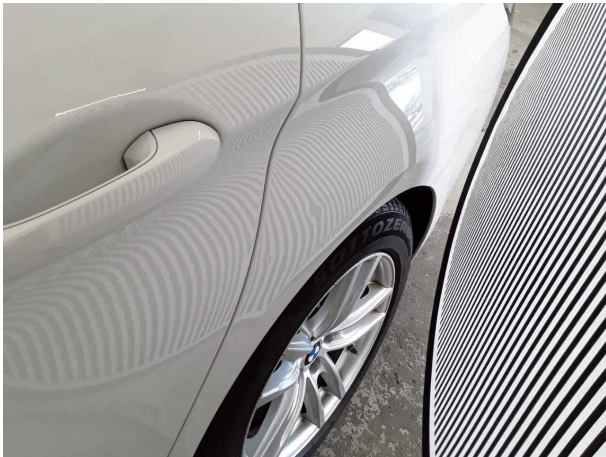


Damage #1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

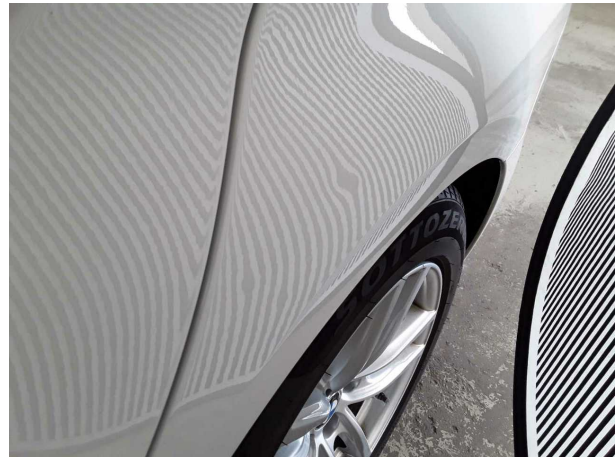


Damage #1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage #2: Rear bumper: Spoiler - Scratch(es) - Loss in value

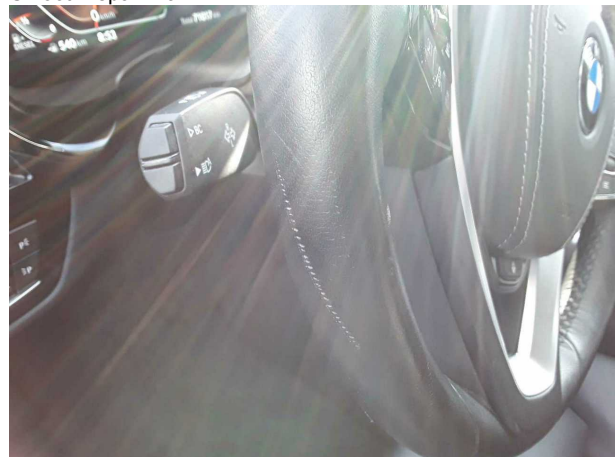

Damage #3: Steering system: Steering wheel - Scratch(es) - Loss in value

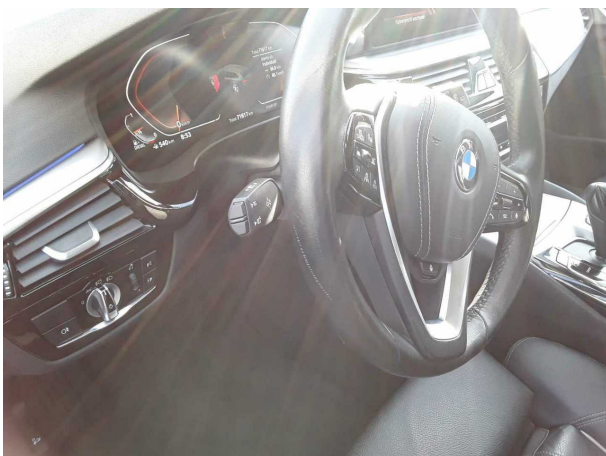

Damage #3: Steering system: Steering wheel - Scratch(es) - Loss in value

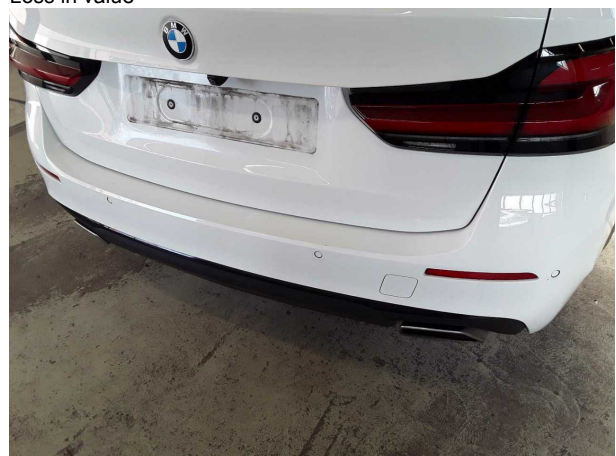

Damage #4: Rear bumper: Rear bumper - Scratch(es) - Smart repair

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 20 Mar 2025
Protocol number: 38932711
Delivery date: 20 Mar 2025



Auto Plus



Damage #4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage #5: Vehicle glazing: Windscreen - Scratch(es) - Replace



Damage #5: Vehicle glazing: Windscreen - Scratch(es) - Replace