



WBA31AJ040CG48163

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	96,015 km
Manufacturer	BMW	Next maintenance in	20,000 km
Type / Model	530d xDrive	Main inspection (Report on hand)	01/2026
Vehicle Identification number	WBA31AJ040CG48163	Power / Engine displacement	210 kW / 2,993 ccm
First registration	4 Feb 2021	Upholstery/Colour	Alcantara / cloth / Black
Last maintenance	08/2024, 85,574 km	Paintwork	Grey
Fuel type	Hybrid Diesel / E	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratched - Cover / polish
2	Sill - left side	Sill - Scratched - Smart repair
3	Trim / covers	Boot lid - interior trim - Scratched - Replace
4	Wheel / tyres	Alloy rim - rear left side - Damaged - Replace
5	Wheel / tyres	Alloy rim - front right side - Damaged - Replace
6	2nd wheel set	3 alloy rims - Scratched - Loss in value
7	Rear bumper	Rear bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen (Ohne Rissbildung) - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100V	Pirelli	Winter tyres	6mm - 6mm	o.k.	o.k.
2	245/45 R18 100V	Pirelli	Winter tyres	7mm - 7mm	o.k.	o.k.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autohaus Graf Hardenberg
GmbH
Rheinstr 108
76185 Karlsruhe

Inspection date: 21 Feb 2025
Protocol number: 38537792



Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/40 R19 98Y	Pirelli	Summer tyres	6mm - 6mm	o.k.	o.k.
2	275/35 R19 100Y	Pirelli	Summer tyres	5mm - 5mm	o.k.	o.k.

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					01/2027

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Standard equipment

Description
Active Guard
Airbag: driver and front passenger, passenger airbag can be deactivated
Airbag: Head airbag for 1st and 2nd row of seats
Airbag: Side airbag for driver and front passenger
alarm system
Anti-lock braking system (ABS) including brake assist and dynamic brake lights
armrests front and rear
attention assistant
Automatic climate control with 2-zone control and extended features
BMW ID
Brake light, third
center armrest in the rear
Central locking including radio remote control
child safety locks in the rear doors
Connected Drive Services
Cruise control with braking function
cup holders, 2 each at the front and rear
Diesel particulate filter
Dynamic Stability Control (DSC) including Dynamic Traction Control (DTC)
Electric windows front and rear
electronic immobilizer
Exterior mirrors electrically adjustable and heated
favorite buttons
headrests (5)
heat/sun protection glazing all around
heated windshield washer nozzles
Intelligent emergency call
interior mirror, automatically dimming
Interior trim oxide silver dark matt with accent strip pearl chrome
Keyless engine start
Lashing eyes in the luggage compartment
LED headlights
Luggage compartment cover
luggage compartment divider net
Navigation system: BMW Live Cockpit Professional
On-board computer
Outside temperature display
Package: Connected Package Professional
Paintwork: Solid paintwork



Description
Park Distance Control (PDC), front and rear
parking brake, electromechanical
Phone: WLAN hotspot
Preparation Driver Assistance I
Radio accessories: DAB tuner
rain sensor with automatic driving light control
rear axle air suspension with level control
Rear window can be opened separately, heated
Rear window wiper
recuperation system
Roof rails black
seat belts (3-point automatic)
Seats: Electric seat adjustment for driver and front passenger
Seats: ISOFIX child seat attachment
Servotronic
Socket (12 V)
start/stop button
Steering wheel: Sports leather steering wheel with multifunction
storage options
Tachometer
tailgate operation, automatic
Telephone: Hands-free system with USB interface
teleservices
through-loading system
Transmission: 8-speed Steptronic transmission
Upholstery: Sensatec perforated
Velour floor mats
warning triangle and first aid kit
Wheel accessories: tire pressure indicator
Wheel accessories: wheel bolt lock
Wheels: Light alloy V-spoke 618
xDrive all-wheel drive



Extra equipment

Description
Adaptive LED headlights
Automatic climate control with 4-zone control with auxiliary ventilation
Auxiliary heating
BMW Display Key
Chassis: Sports suspension M
Driving Assistant
Glazing: Solar protection glazing
Head-Up Display
M High Gloss Shadow Line
M High-gloss Shadow Line with extended scope
M interior trim strips Aluminium Rhombicle Smoke Grey with accent strip Pearl Chrome
M roof rails high-gloss Shadow Line
M Sport brake
Package: Extended exterior mirror package
Package: M Aerodynamics Package
Package: M Sport Package
Parking Assistant
Seats: Seat heating for driver and front passenger
Seats: Sports seats for driver and front passenger
Steering wheel: heated steering wheel
Telephone: Telephony with Wireless Charging
Transmission: Steptronic Sport transmission with shift paddles on the steering wheel
Wheel accessories: tire repair kit
Wheels: M light alloy Y-spoke 845 M Jetblack with mixed tires

Comments

Fahrzeug war bei der Begutachtung verschmutzt, nass und zugeparkt, Kostenausweitung möglich.

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten.

Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autohaus Graf Hardenberg
GmbH
Rheinstr 108
76185 Karlsruhe

Inspection date: 21 Feb 2025
Protocol number: 38537792



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	530d xDrive	Mileage (Read)	96,015 km
Vehicle Identification number	WBA31AJ040CG48163	First registration	4 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was established during the inspection by the undersigned.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Interior



Figure 11: Interior



Figure 12: Interior



Figure 13: Interior



Figure 14: Interior



Figure 15: Interior



Figure 16: VIN

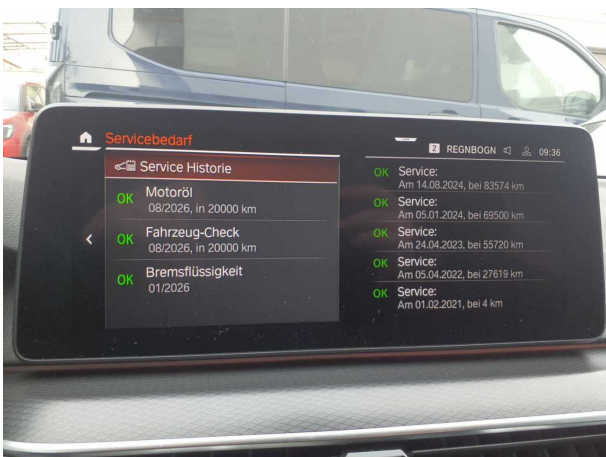


Figure 17: Documents

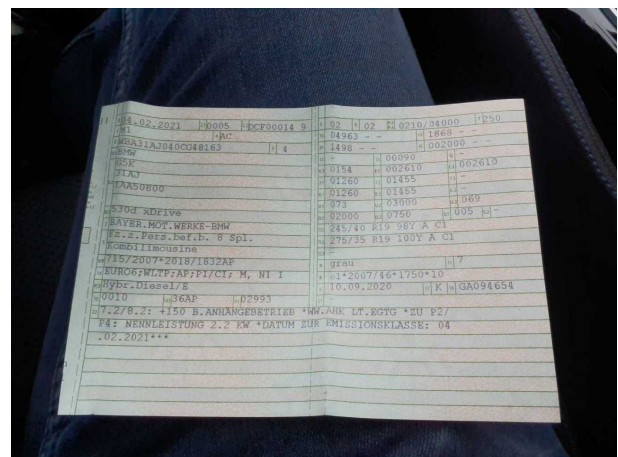


Figure 18: Documents

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autohaus Graf Hardenberg
GmbH
Rheinstr 108
76185 Karlsruhe

Inspection date: 21 Feb 2025
Protocol number: 38537792



Figure 19: Documents



Figure 20: Mounted tyres



Figure 21: Mounted tyres



Figure 22: Mounted tyres



Figure 23: Mounted tyres

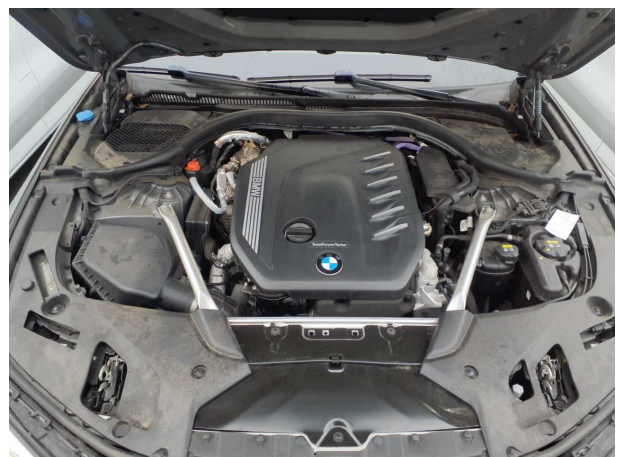


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

Pictures of damage



Damage #1: Front bumper: Front bumper - Scratched - Cover / polish



Damage #1: Front bumper: Front bumper - Scratched - Cover / polish




Damage #2: Sill - left side: Sill - Scratched - Smart repair



Damage #2: Sill - left side: Sill - Scratched - Smart repair



Damage #3: Trim / covers: Boot lid - interior trim - Scratched - Replace

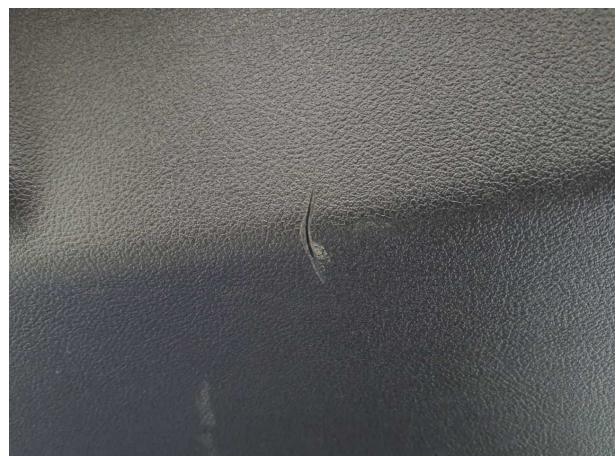


Damage #3: Trim / covers: Boot lid - interior trim - Scratched - Replace



Damage #4: Wheel / tyres: Alloy rim - rear left side - Damaged - Replace




Damage #4: Wheel / tyres: Alloy rim - rear left side - Damage... Replace

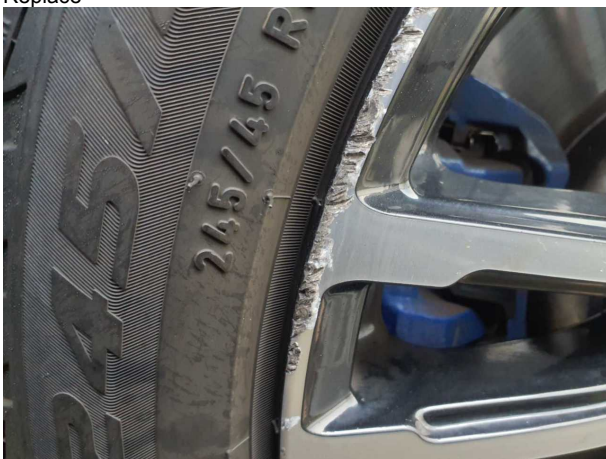

Damage #4: Wheel / tyres: Alloy rim - rear left side - Damaged - Replace



Damage #4: Wheel / tyres: Alloy rim - rear left side - Damage... Replace

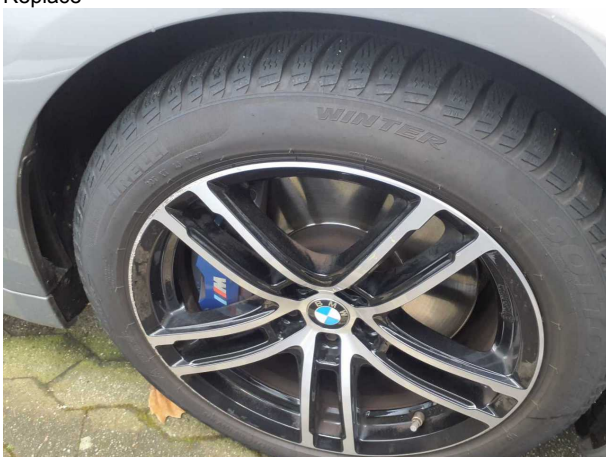

Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #5: Wheel / tyres: Alloy rim - front right side - Damaged - Replace



Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value




Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #6: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #7: Rear bumper: Rear bumper - Scratched - Paint

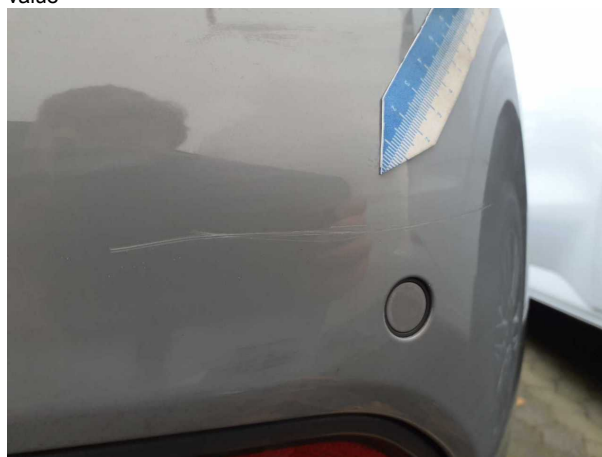

Damage #7: Rear bumper: Rear bumper - Scratched - Paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autohaus Graf Hardenberg
GmbH
Rheinstr 108
76185 Karlsruhe

Inspection date: 21 Feb 2025
Protocol number: 38537792



Damage #7: Rear bumper: Rear bumper - Scratched - Paint



Damage #7: Rear bumper: Rear bumper - Scratched - Paint