



WBA31CG060CH99024

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	35,791 km
Manufacturer	BMW	Next maintenance in	26,000 km
Type / Model	530e xDrive	Main inspection (Report on hand)	11/2026
Vehicle Identification number	WBA31CG060CH99024	Power / Engine displacement	135 kW / 1,998 ccm
First registration	4 Nov 2021	Upholstery/Colour	/
Last maintenance	11/2024, 31,953 km	Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - Loss in value
2	Boot lid / rear door	Boot lid - Scratched - Smart repair
3	Front bumper	Front bumper - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen (Steinschläge) - No deduction
2	Interior	Interior - Abrasion - No deduction
3	Body	Body (Steinschläge) - Scratch(es) - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100V	Pirelli	Winter tyres	6mm - 6mm	o.k.	
2	245/45 R18 100V	Pirelli	Winter tyres	5mm - 5mm	o.k.	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP Deutschland SE & Co.
KG
Hasso-Plattner-Ring 7
69190 Walldorf

Inspection date: 26 Mar 2025
Protocol number: 39031815
Delivery date: 26 Mar 2025



Auto Plus

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100Y	Continental	Summer tyres	5mm - 5mm	o.k.	
2	245/45 R18 100Y	Continental	Summer tyres	5mm - 5mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung regennass, weitere Beschädigungen können nicht ausgeschlossen werden.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP Deutschland SE & Co.
KG
Hasso-Plattner-Ring 7
69190 Walldorf

Inspection date: 26 Mar 2025
Protocol number: 39031815
Delivery date: 26 Mar 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	530e xDrive	Mileage (Read)	35,791 km
Vehicle Identification number	WBA31CG060CH99024	First registration	4 Nov 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was established during the inspection by the undersigned.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior

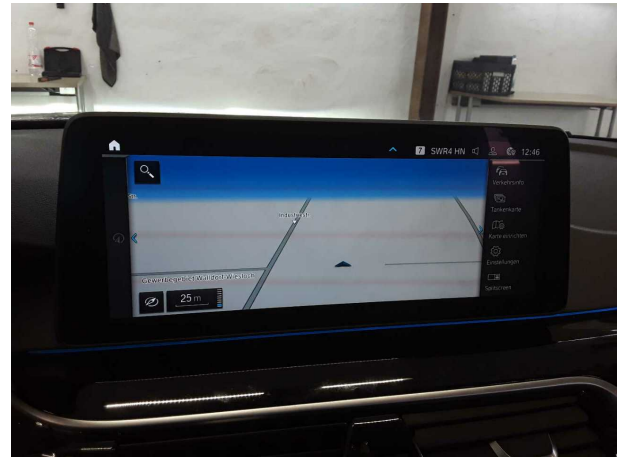


Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP Deutschland SE & Co.
KG
Hasso-Plattner-Ring 7
69190 Walldorf

Inspection date: 26 Mar 2025
Protocol number: 39031815
Delivery date: 26 Mar 2025



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

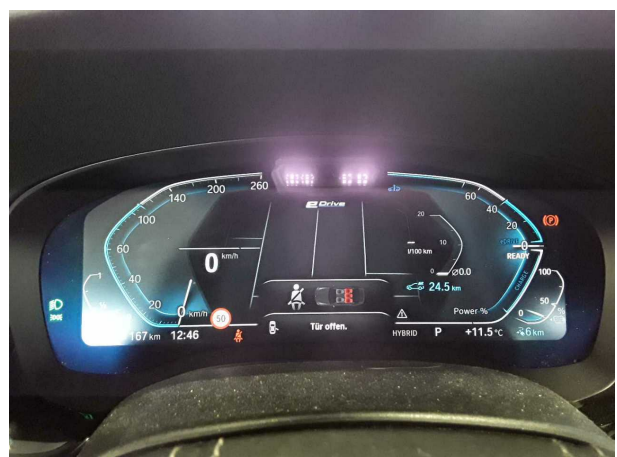


Figure 18: Misc.

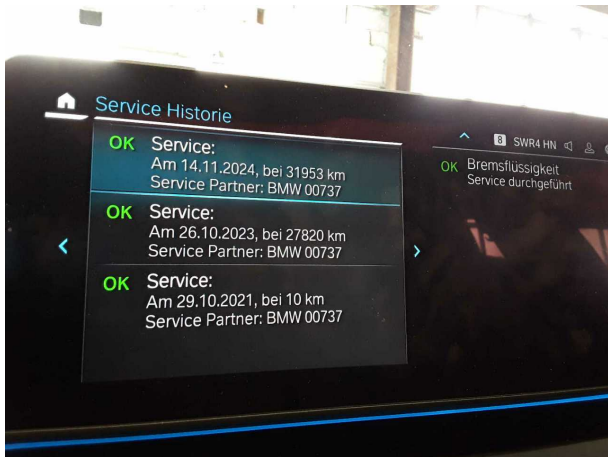


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP Deutschland SE & Co.
KG
Hasso-Plattner-Ring 7
69190 Walldorf

Inspection date: 26 Mar 2025
Protocol number: 39031815
Delivery date: 26 Mar 2025

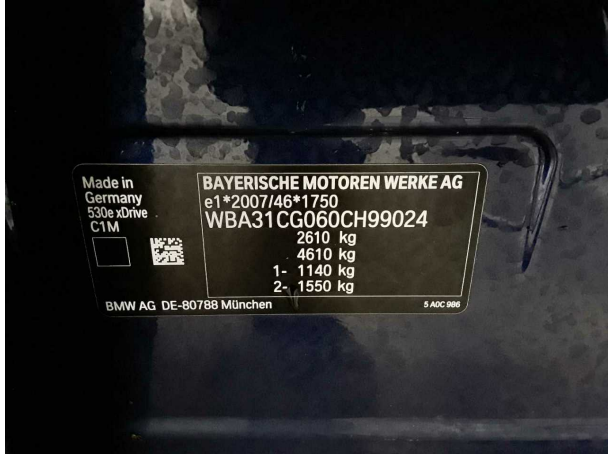


Figure 25: Misc.



Figure 26: Misc.


Pictures of damage



Damage #1: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #1: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

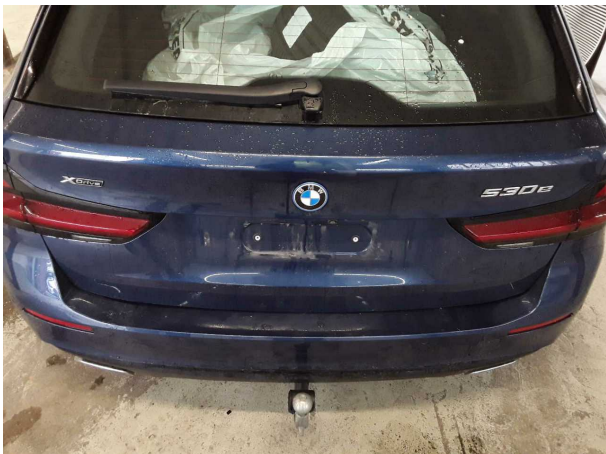

Damage #2: Boot lid / rear door: Boot lid - Scratched - Smart repair



Damage #2: Boot lid / rear door: Boot lid - Scratched - Smart repair



Damage #3: Front bumper: Front bumper - Scratched - Repair and paint



Damage #3: Front bumper: Front bumper - Scratched - Repair and paint

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP Deutschland SE & Co.
KG
Hasso-Plattner-Ring 7
69190 Walldorf

Inspection date: 26 Mar 2025
Protocol number: 39031815
Delivery date: 26 Mar 2025



Auto Plus



Damage #3: Front bumper: Front bumper - Scratched - Repair and paint



Damage #3: Front bumper: Front bumper - Scratched - Repair and paint