



WBA6K51060FL21700

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	150,502 km
Manufacturer	BMW	Next maintenance in	7,000 km
Type / Model	330i	Main inspection (Report on hand)	04/2026
Vehicle Identification number	WBA6K51060FL21700	Power / Engine displacement	190 kW / 1,998 ccm
First registration	12 Apr 2021	Upholstery/Colour	/
Last maintenance	04/2024, 116,344 km	Paintwork	
Fuel type	Petrol	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - right - Worn - No deduction
2	Indicator - front	Mirror - left side - Scratched - Replace
3	Side panel - rear right side	Sill - Scratched - Smart repair
4	Wing mirror - left side	Wing mirror - Damaged - Replace
5	Rear bumper	Rear bumper - Scratched - Paint
6	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
7	Front bumper	Front bumper - Scratched - Repair and paint
8	Door - front right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Interior	Interior - Abrasion - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Front, Provided by user / customer

Detected repainting

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 Apr 2025

Protocol number: 39204073

Delivery date: 7 Apr 2025



Auto Plus

No.	Location
1	Bumper front, Professionally carried out

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98H	Dunlop	Winter tyres	5mm - 5mm	o.k.	
2	225/50 R17 98H	Dunlop	Winter tyres	4mm - 4mm	Not o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Michelin	Summer tyres	4mm - 4mm	o.k.	
2	225/50 R17 98Y	Michelin	Summer tyres	3mm - 3mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n .i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung verschmutzt, weitere Beschädigungen können nicht ausgeschlossen werden.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 Apr 2025

Protocol number: 39204073

Delivery date: 7 Apr 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	330i	Mileage (Read)	150,502 km
Vehicle Identification number	WBA6K51060FL21700	First registration	12 Apr 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

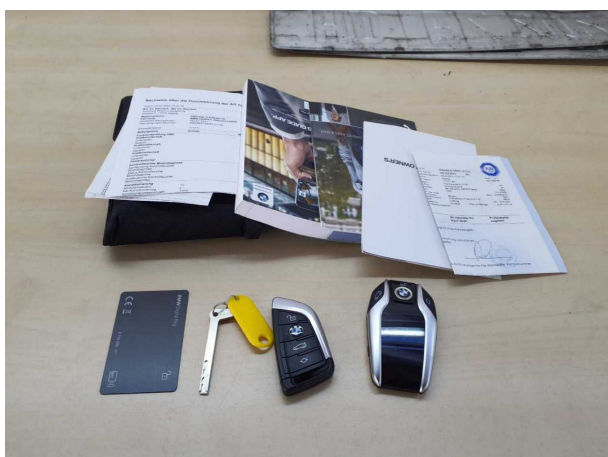


Figure 11: Misc.

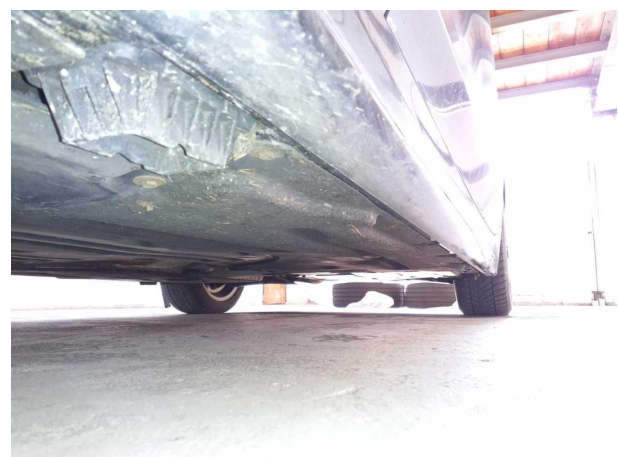


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

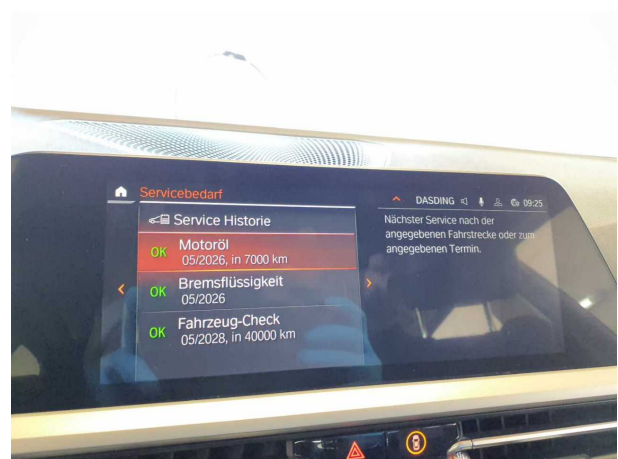


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

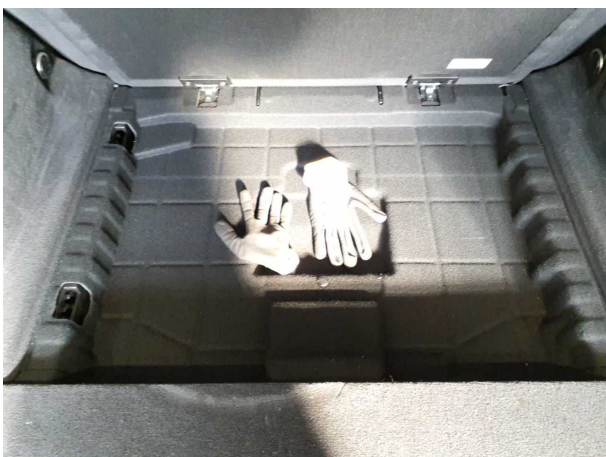


Figure 23: Misc.

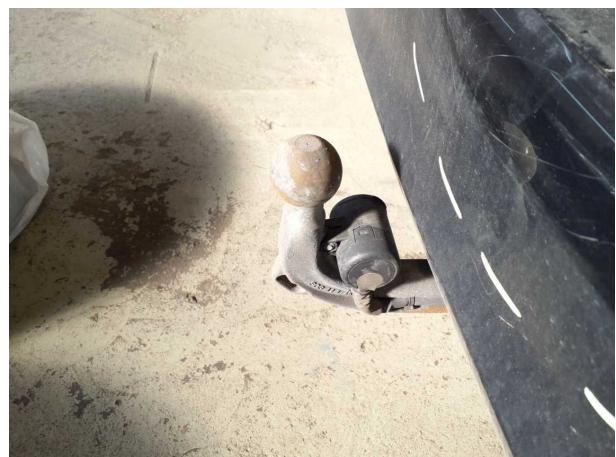


Figure 24: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 Apr 2025
Protocol number: 39204073
Delivery date: 7 Apr 2025



Auto Plus



Figure 25: Misc.


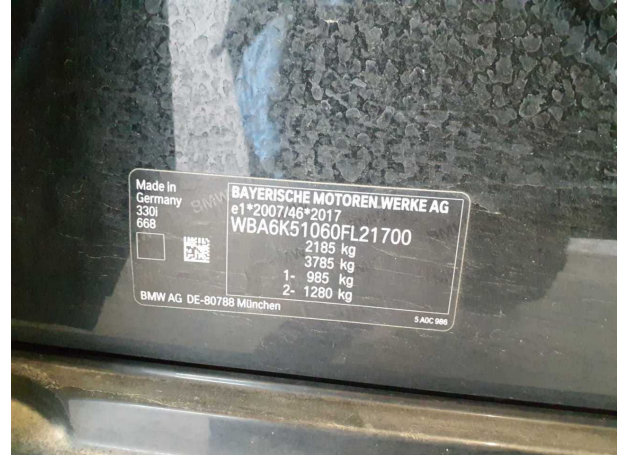


Figure 26: Misc.

Pictures of damage



Damage #1: Wheel / tyres: Tyre - right - Worn - No deduction

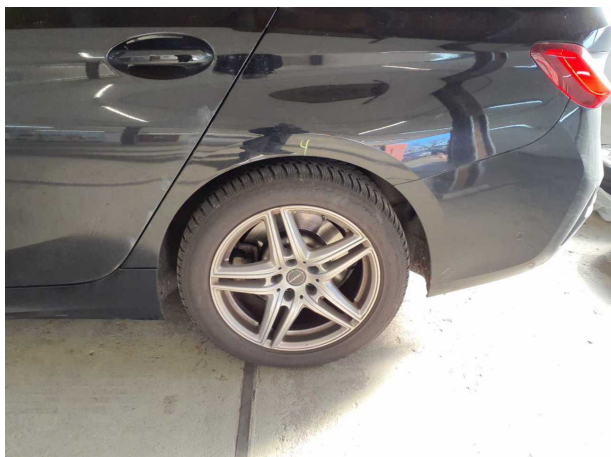


Damage #1: Wheel / tyres: Tyre - right - Worn - No deduction



Damage #2: Indicator - front: Mirror - left side - Scratched - Replace



Damage #2: Indicator - front: Mirror - left side - Scratched - Replace

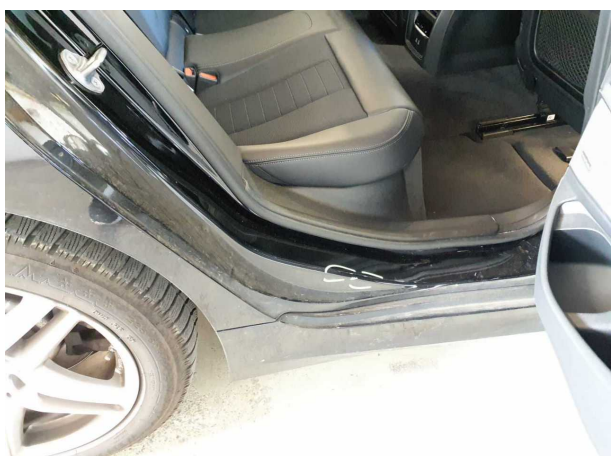

Damage #3: Side panel - rear right side: Sill - Scratched - Smart repair



Damage #3: Side panel - rear right side: Sill - Scratched - Smart repair



Damage #4: Wing mirror - left side: Wing mirror - Damaged - Replace



Damage #4: Wing mirror - left side: Wing mirror - Damaged - Replace



Damage #5: Rear bumper: Rear bumper - Scratched - Paint




Damage #5: Rear bumper: Rear bumper - Scratched - Paint



Damage #5: Rear bumper: Rear bumper - Scratched - Paint




Damage #6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

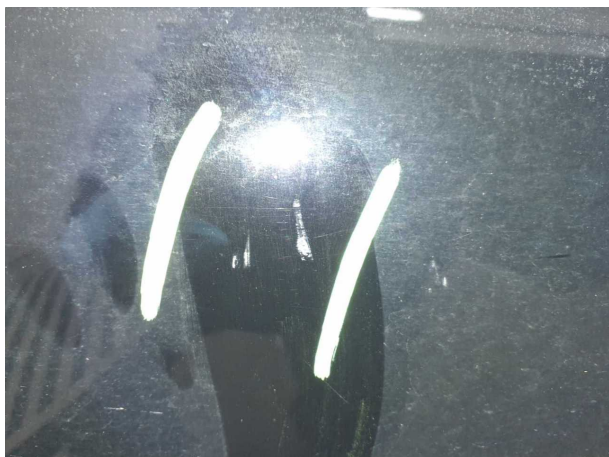

Damage #6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage #6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

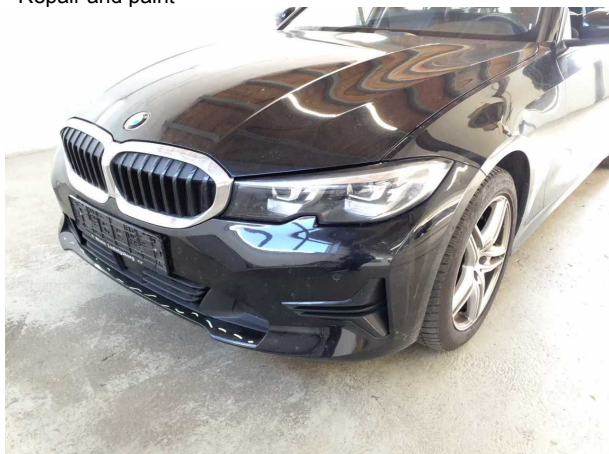

Damage #7: Front bumper: Front bumper - Scratched - Repair and paint



Damage #7: Front bumper: Front bumper - Scratched - Repair and paint

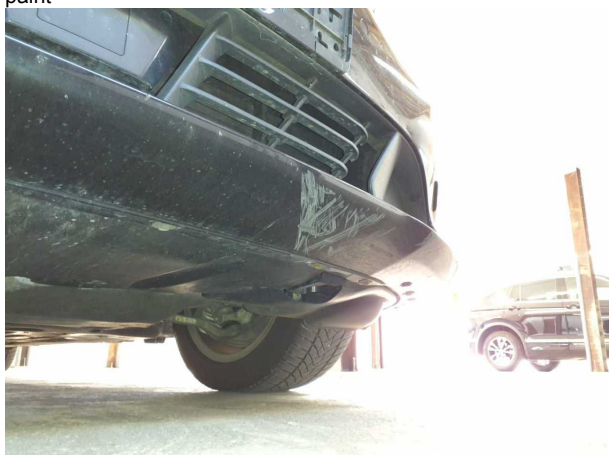


Damage #7: Front bumper: Front bumper - Scratched - Repair and paint



Damage #8: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - front right side: Door - Dent / paintcoat damage
- Repair and paint

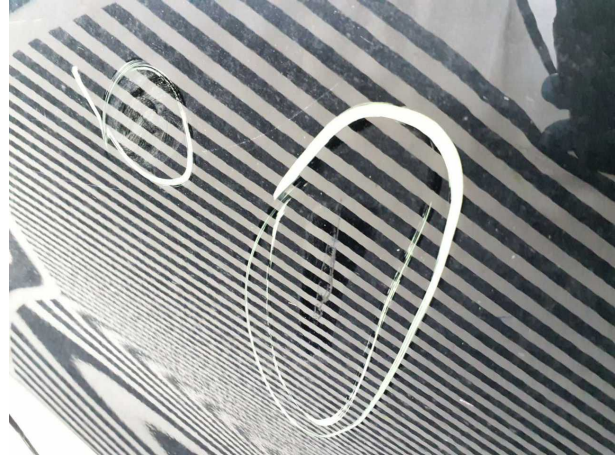

Damage #8: Door - front right side: Door - Dent / paintcoat
damage - Repair and paint



Damage #8: Door - front right side: Door - Dent / paintcoat damage
- Repair and paint