



WAUZZZF48PA052103

Vehicle details

Operator		Inspection condition	conditional: light/ moisture/dirt
License number		Mileage (Read)	62,047 km
Manufacturer	Audi	Next maintenance in	-600 km
Type / Model	A4 35 TDI S tronic Avant Kombi5-türig 1968 ccm 163 PS / 120 KW Diesel 7-Gang Automatik	Main inspection	
Vehicle Identification number	WAUZZZF48PA052103	Power / Engine displacement	/ 1,968 ccm
First registration	22 Mar 2023	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Diesel	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - Loss in value
2	Door - rear right side	Door - Scratched - Smart repair
3	Rear bumper	Protection strip - centre - Scratched - Replace
4	Rear bumper	Spoiler - Deformed - Replace
5	Multimedia system	Navigation system - Non-operational - Set / adjust
6	Misc.	Inspection / maintenance - Due - Perform
7	Rear bumper	Rear bumper (Leichte Verformung, schadenserweiterung möglich) - Scratched - Repair and paint
8	Side panel - rear right side	Side panel - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/60 R16 96H	Goodyear	Winter tyres	6mm - 6mm	o.k.	o.k.
2	205/60 R16 96H	Goodyear	Winter tyres	7mm - 7mm	o.k.	o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 94H	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.
2	225/50 R17 94H	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment

Description
Automatic air conditioning
Navigation unit with map view
Radio DAB

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung verschmutzt, weitere Beschädigungen können nicht ausgeschlossen werden.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autokontor Bayern GmbH
Windecker Straße 2
61137 Schöneck

Inspection date: 23 Apr 2025
Protocol number: 39454847



Auto Plus

Vehicle details

Manufacturer	Audi	Inspection condition	conditional: light/moisture/dirt
Type / Model	A4 35 TDI S tronic Avant Kombi5-türig 1968 ccm 163 PS / 120 KW Diesel 7-Gang Automatik	Mileage (Read)	62,047 km
Vehicle Identification number	WAUZZZF48PA052103	First registration	22 Mar 2023

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear

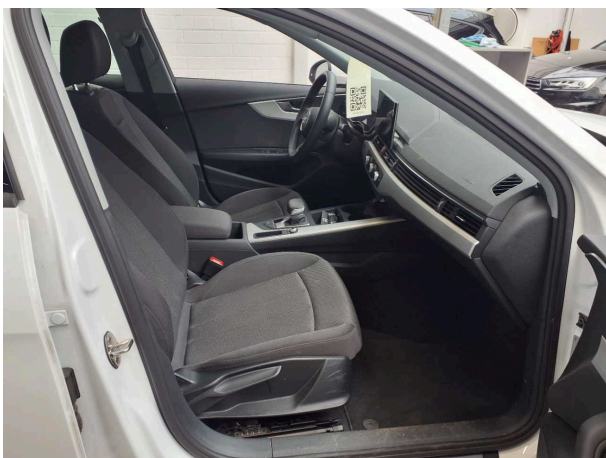


Figure 5: Interior

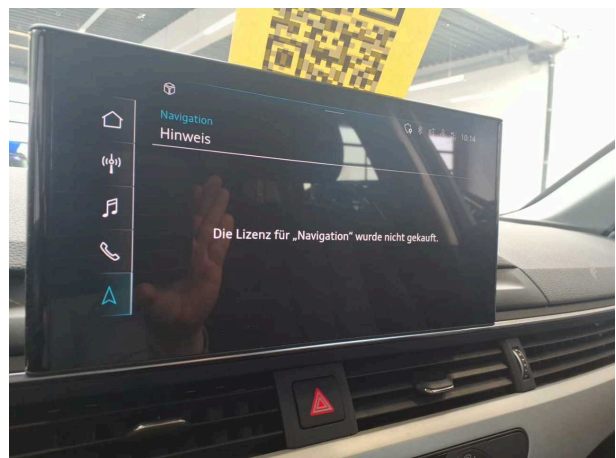


Figure 6: Interior



Figure 7: Interior



Figure 8: Interior

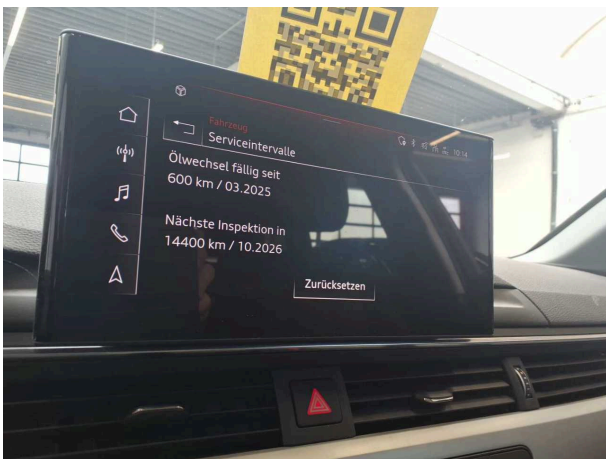


Figure 9: Misc.



Figure 10: Misc.

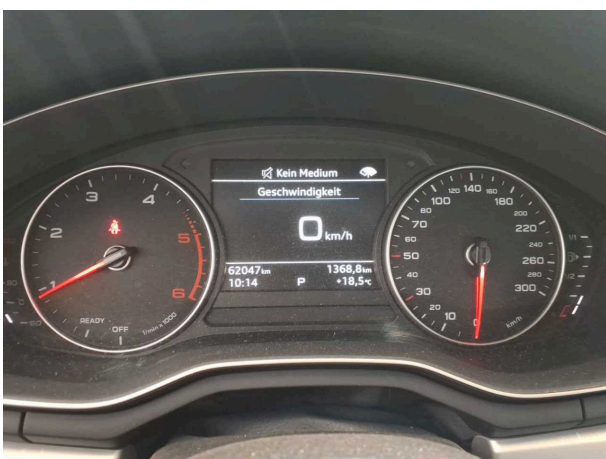


Figure 11: Misc.



Figure 12: Misc.

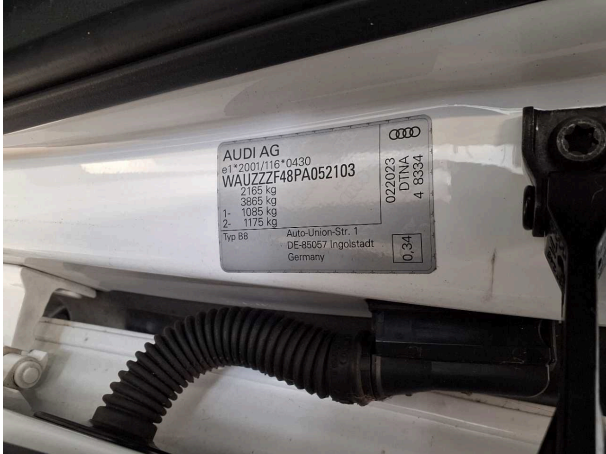


Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

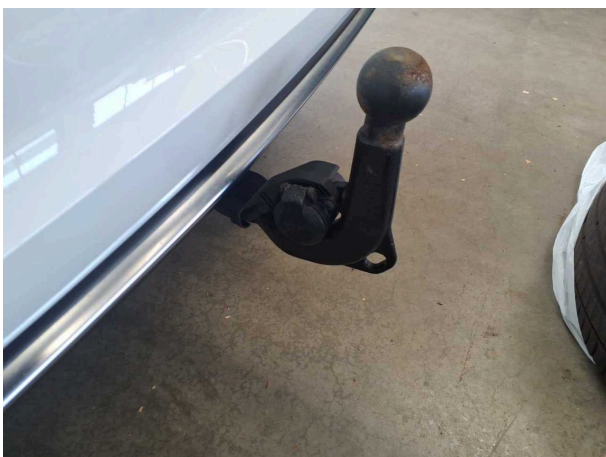


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

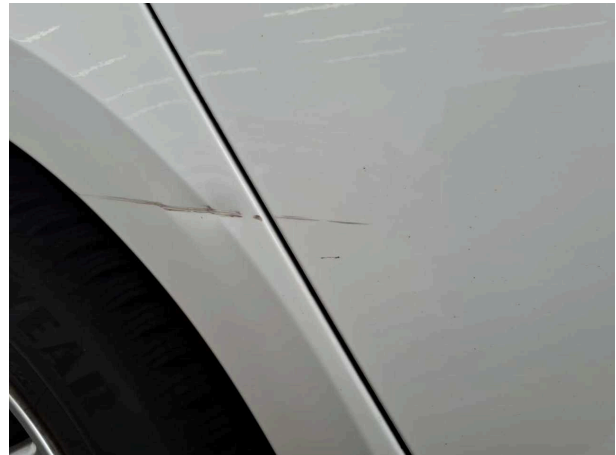


Figure 22: Misc.

Pictures of damage



Damage #1: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage #2: Door - rear right side: Door - Scratched - Smart repair




Damage #3: Rear bumper: Protection strip - centre - Scratched - Replace



Damage #4: Rear bumper: Spoiler - Deformed - Replace



Damage #4: Rear bumper: Spoiler - Deformed - Replace

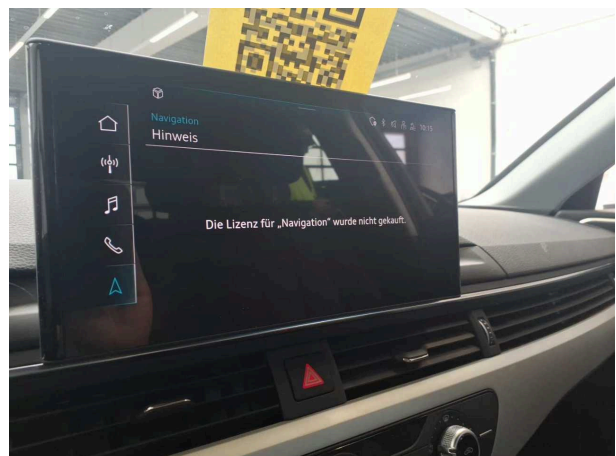


Damage #5: Multimedia system: Navigation system - Non-operational - Set / adjust

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autokontor Bayern GmbH
Windecker Straße 2
61137 Schöneck

Inspection date: 23 Apr 2025
Protocol number: 39454847

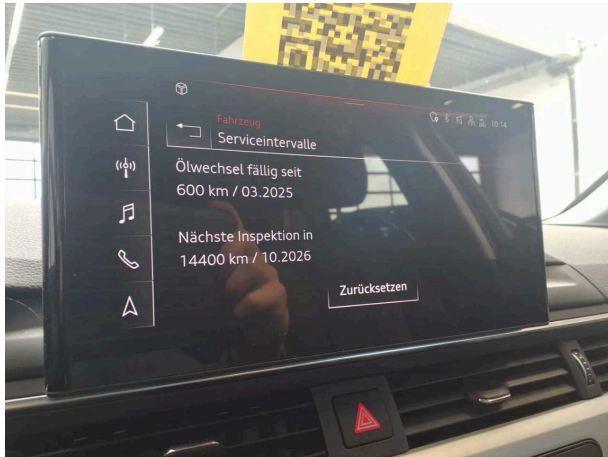


Damage #6: Misc.: Inspection / maintenance - Due - Perform



Damage #7: Rear bumper: Rear bumper (Leichte Verformung, schadenserweiterung möglich) - Scratched - Repair and paint



Damage #7: Rear bumper: Rear bumper (Leichte Verformung, schadenserweiterung möglich) - Scratched - Repair and paint

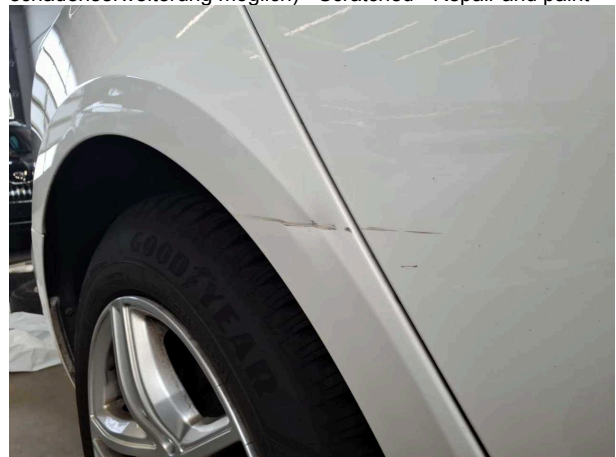

Damage #8: Side panel - rear right side: Side panel - Scratch... - Repair and paint