



WAUZZZF49MA055328

Vehicle details

Operator		Inspection condition	conditional: sufficient
License number		Mileage (Read)	103,301 km
Manufacturer	Audi	Next maintenance in	19 Tag(e)
Type / Model	A4 Limousine	Main inspection (Report not on hand)	09/2026
Vehicle Identification number	WAUZZZF49MA055328	Power / Engine displacement	150 kW / 1,984 ccm
First registration	9 Apr 2021	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Hybrid Petrol / E	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front - Worn - No deduction
2	Documents	Main inspection certificate (Fehlt) - Replace
3	Steering system	Steering wheel - Abrasion - Loss in value
4	Trim / covers	Brightware / decorative strip (türverkleidung VL) - Scratched - Replace
5	Trim / covers	Door trim - rear right side - Deformed - Loss in value
6	2nd wheel set	1 alloy rim - Scratched - Loss in value
7	Misc.	Inspection / maintenance - Due - Replace
8	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
9	Door - front right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 8 Apr 2025
Protocol number: 39226416
Delivery date: 8 Apr 2025



Auto Plus

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98V	Michelin	Winter tyres	4mm - 4mm	Not o.k.	
2	225/50 R17 98V	Michelin	Winter tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Pirelli	Summer tyres	5mm - 5mm	o.k.	
2	225/50 R17 98Y	Pirelli	Summer tyres	7mm - 7mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 8 Apr 2025
Protocol number: 39226416
Delivery date: 8 Apr 2025



Auto Plus

Vehicle details

Manufacturer	Audi	Inspection condition	conditional: sufficient
Type / Model	A4 Limousine	Mileage (Read)	103,301 km
Vehicle Identification number	WAUZZZF49MA055328	First registration	9 Apr 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were only partially sufficient for assessing the vehicle. At the time of the inspection, it could not be ensured that the condition was sufficient for an adequate assessment. The expert therefore recommends a further inspection to reduce the risk of prognosis.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

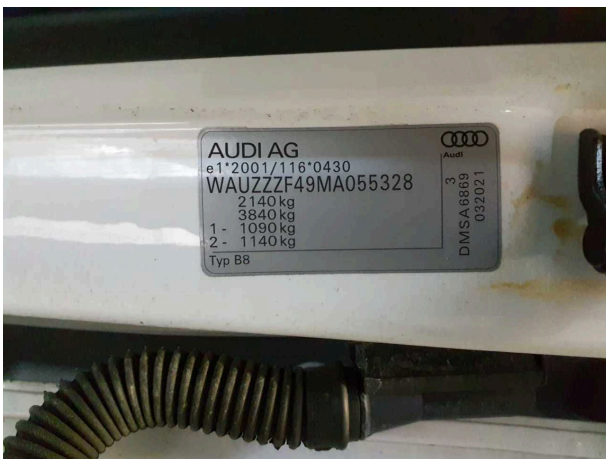


Figure 21: Misc.

AUDI AG
e1*2001/116*0430
WAUZZZF49MA055328
2140 kg
3840 kg
1 - 1090 kg
2 - 1140 kg
Typ B8

Audi
3
DMSA 8869
032021

Pictures of damage




Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction



Damage #1: Wheel / tyres: Tyre - front - Worn - No deduction



Damage #3: Steering system: Steering wheel - Abrasion - Loss in value

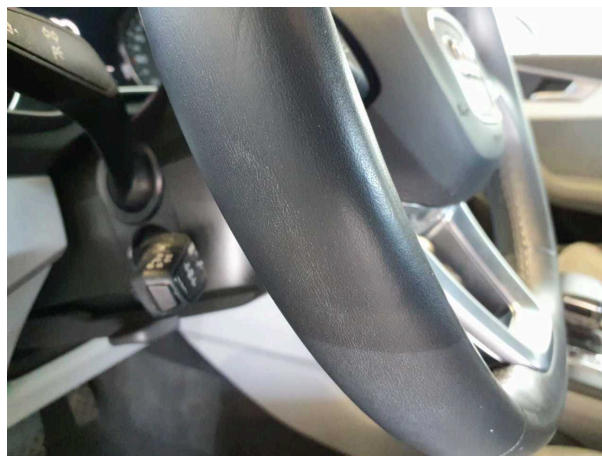

Damage #3: Steering system: Steering wheel - Abrasion - Loss in value



Damage #4: Trim / covers: Brightware / decorative strip (türverkleidung VL) - Scratched - Replace




Damage #4: Trim / covers: Brightware / decorative strip (türverkleidung VL) - Scratched - Replace




Damage #5: Trim / covers: Door trim - rear right side - Deformed - Loss in value




Damage #5: Trim / covers: Door trim - rear right side - Deformed - Loss in value

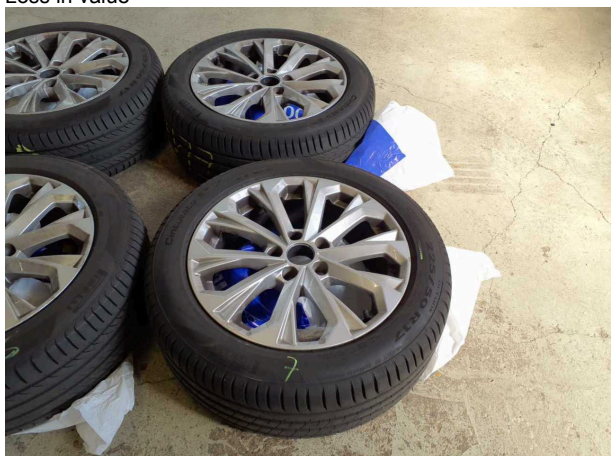

Damage #6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

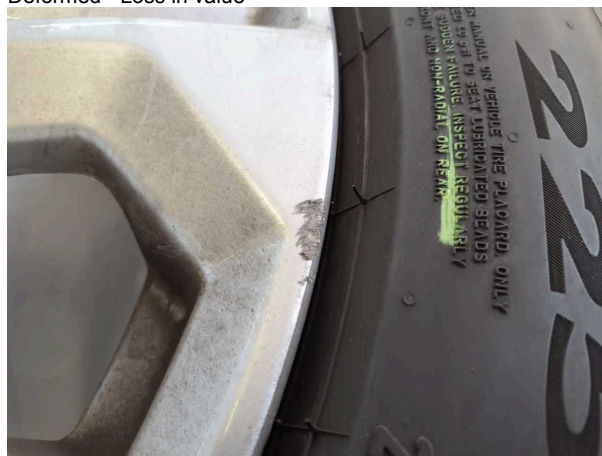

Damage #6: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

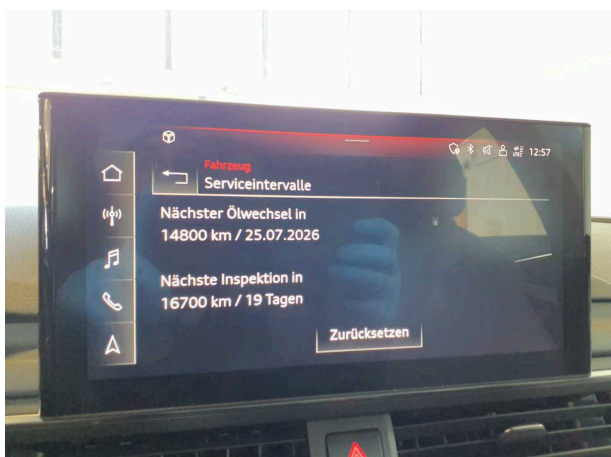

Damage #7: Misc.: Inspection / maintenance - Due - Replace



Damage #8: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage #8: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage #9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage #9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

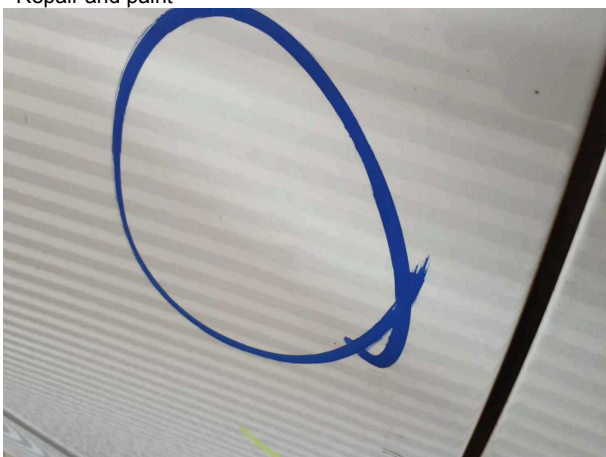

Damage #9: Door - front right side: Door - Dent / paintcoat damage - Repair and paint