



**WBA31AJ070CM53073**

## Vehicle details

|                               |                    |                                 |                                  |
|-------------------------------|--------------------|---------------------------------|----------------------------------|
| Operator                      |                    | Inspection condition            | conditional: light/moisture/dirt |
| License number                |                    | Mileage (Read)                  | 24,863 km                        |
| Manufacturer                  | BMW                | Next maintenance in             | 8 Monat(e)                       |
| Type / Model                  | 530d xDrive        | Main inspection (Read from ZBI) | 01/2026                          |
| Vehicle Identification number | WBA31AJ070CM53073  | Power / Engine displacement     | 210 kW / 2,993 ccm               |
| First registration            | 3 Jan 2023         | Upholstery/Colour               | /                                |
| Last maintenance              | 03/2025, 23,971 km | Paintwork                       |                                  |
| Fuel type                     | Hybrid Diesel / E  | Gearbox                         | Automatic                        |

## Zustandsbericht

### Value reducing factors

| No. | Component group             | Description                                            |
|-----|-----------------------------|--------------------------------------------------------|
| 1   | Trim / covers               | Door trim - front left side - Deformed - Loss in value |
| 2   | Side panel - rear left side | Side panel - Scratched - Repair and paint              |

### Wear and tear

| No. | Component group | Description                                      |
|-----|-----------------|--------------------------------------------------|
| 1   | Body            | Body (Steinschläge) - Scratch(es) - No deduction |
| 2   | Vehicle glazing | Windscreen (Steinschläge) - No deduction         |
| 3   | Interior        | Interior - Abrasion - No deduction               |
| 4   | Body            | Body - Stone chips - No deduction                |

### Missing parts

| Missing part |
|--------------|
|--------------|

### Detected repainting

| No.             | Location |
|-----------------|----------|
| None detectable |          |

### Main tyres

| Axle | Tyre size       | Manufacturer | Type of tyre | Tread depth | Roadworthy | Permissibility |
|------|-----------------|--------------|--------------|-------------|------------|----------------|
| 1    | 245/45 R18 100V | Pirelli      | Winter tyres | 7mm - 7mm   | o.k.       |                |
| 2    | 245/45 R18 100V | Pirelli      | Winter tyres | 6mm - 6mm   | o.k.       |                |

**TÜV SÜD Auto Plus GmbH**  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

**Inspection location**  
SAP SE  
Dietmar-Hopp-Allee 16  
69190 Walldorf

Inspection date: 22 Apr 2025  
**Protocol number:** 39394628  
Delivery date: 22 Apr 2025



Auto Plus

## Additional tyres

| Axle | Tyre size       | Manufacturer | Type of tyre | Tread depth | Roadworthy | Permissibility |
|------|-----------------|--------------|--------------|-------------|------------|----------------|
| 1    | 245/40 R19 98Y  | Goodyear     | Summer tyres | 6mm - 6mm   | o.k.       |                |
| 2    | 275/35 R19 100Y | Goodyear     | Summer tyres | 5mm - 5mm   | o.k.       |                |

The wear and tear condition and possible damages to the tyres are considered in the value.

## Comments

Keine Gewähr auf Vollständigkeit und  
Richtigkeit der angezeigten Ausstattung.  
Techn. Änderungen vorbehalten  
Das Fahrzeug weist dem Alter, der Laufleistung und dem  
Einsatzzweck entsprechende Gebrauchsspuren auf.  
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung regennass, weitere Beschädigungen können nicht ausgeschlossen werden.

**TÜV SÜD Auto Plus GmbH**  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

**Inspection location**  
SAP SE  
Dietmar-Hopp-Allee 16  
69190 Walldorf

Inspection date: 22 Apr 2025  
**Protocol number:** 39394628  
Delivery date: 22 Apr 2025



Auto Plus

## Vehicle details

|                                      |                   |                             |                                  |
|--------------------------------------|-------------------|-----------------------------|----------------------------------|
| <b>Manufacturer</b>                  | BMW               | <b>Inspection condition</b> | conditional: light/moisture/dirt |
| <b>Type / Model</b>                  | 530d xDrive       | <b>Mileage (Read)</b>       | 24,863 km                        |
| <b>Vehicle Identification number</b> | WBA31AJ070CM53073 | <b>First registration</b>   | 3 Jan 2023                       |

### Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

### Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

### General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

## Overview pictures



**Figure 1:** Diagonal front



**Figure 2:** Diagonal front




**Figure 3:** Diagonal rear



**Figure 4:** Diagonal rear



**Figure 5:** Interior

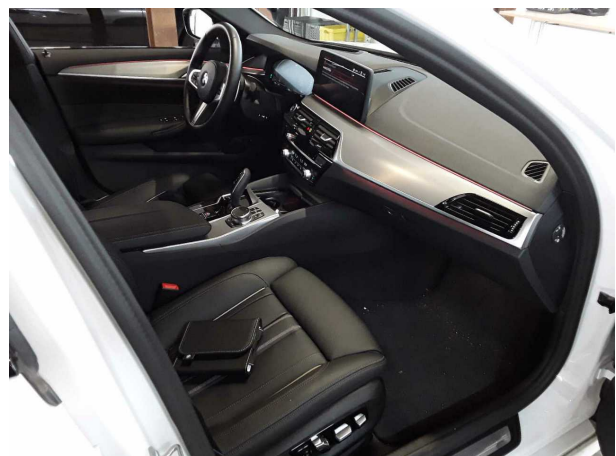

**Figure 6:** Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.

**TÜV SÜD Auto Plus GmbH**  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

**Inspection location**  
SAP SE  
Dietmar-Hopp-Allee 16  
69190 Walldorf

Inspection date: 22 Apr 2025  
**Protocol number: 39394628**  
Delivery date: 22 Apr 2025



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

TÜV SÜD Auto Plus GmbH  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

Inspection location  
SAP SE  
Dietmar-Hopp-Allee 16  
69190 Walldorf

Inspection date: 22 Apr 2025  
Protocol number: 39394628  
Delivery date: 22 Apr 2025



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

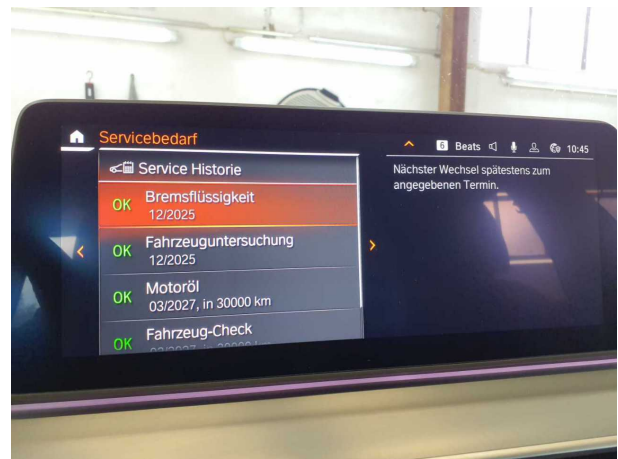


Figure 22: Misc.

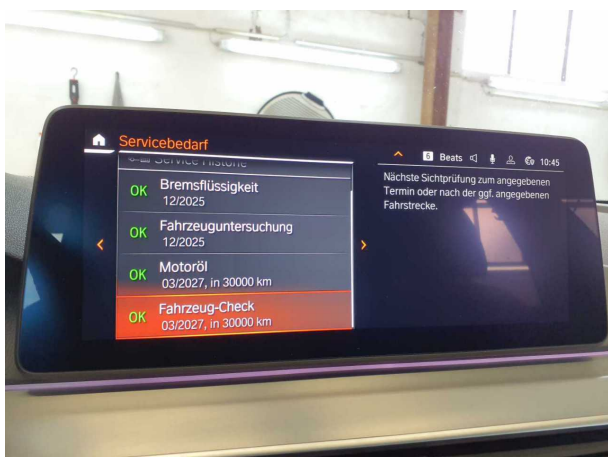


Figure 23: Misc.

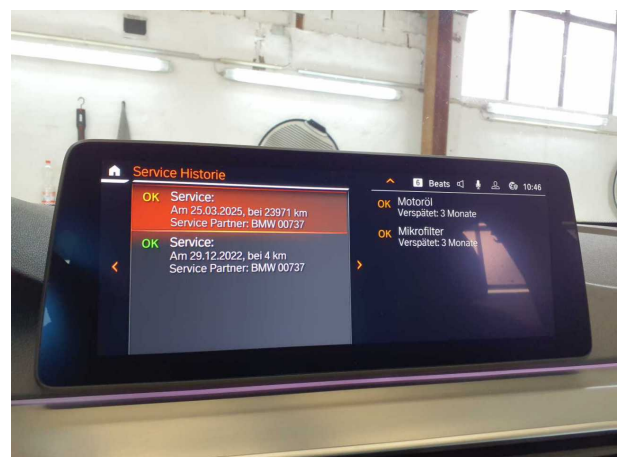


Figure 24: Misc.

## Pictures of damage



**Damage #1:** Trim / covers: Door trim - front left side - Deformed - Loss in value



**Damage #1:** Trim / covers: Door trim - front left side - Deform... - Loss in value



**Damage #2:** Side panel - rear left side: Side panel - Scratched - Repair and paint



**Damage #2:** Side panel - rear left side: Side panel - Scratched... Repair and paint