



WBA7K310907J21462

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	33,776 km
Manufacturer	BMW	Next maintenance in	0 Monat(e)
Type / Model	118i	Main inspection (Report on hand)	05/2026
Vehicle Identification number	WBA7K310907J21462	Power / Engine displacement	100 kW / 1,499 ccm
First registration	27 Apr 2021	Upholstery/Colour	/
Last maintenance	05/2024, 26,058 km	Paintwork	
Fuel type	Petrol	Gearbox	Manual

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Side panel - rear left side	Sill - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
4	Door - front left side	Door - dent(s) - Smooth repair work
5	Misc.	Inspection / maintenance - Due - Perform
6	Rear bumper	Rear bumper - Deformed - Repair and paint
7	Door - rear left side	Door - Scratch(es) - Paint
8	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Interior	Interior - Abrasion - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Front, Provided by user / customer

Detected repainting

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 23 Apr 2025

Protocol number: 39470285

Delivery date: 23 Apr 2025



Auto Plus

No.	Location
1	Bumper front, Professionally carried out

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R17 94Y	Bridgestone	Summer tyres	6mm - 6mm	o.k.	
2	225/45 R17 94Y	Bridgestone	Summer tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/55 R16 91T	Pirelli	Winter tyres	7mm - 7mm	o.k.	
2	205/55 R16 91T	Pirelli	Winter tyres	8mm - 8mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n.i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH
69190 Walldorf

Inspection date: 23 Apr 2025
Protocol number: 39470285
Delivery date: 23 Apr 2025



Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	118i	Mileage (Read)	33,776 km
Vehicle Identification number	WBA7K310907J21462	First registration	27 Apr 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior

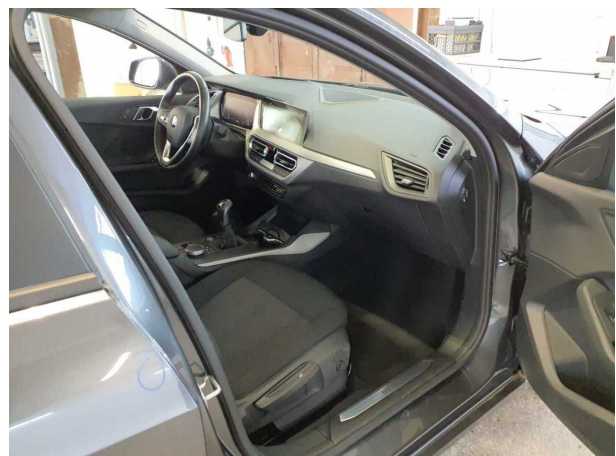


Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

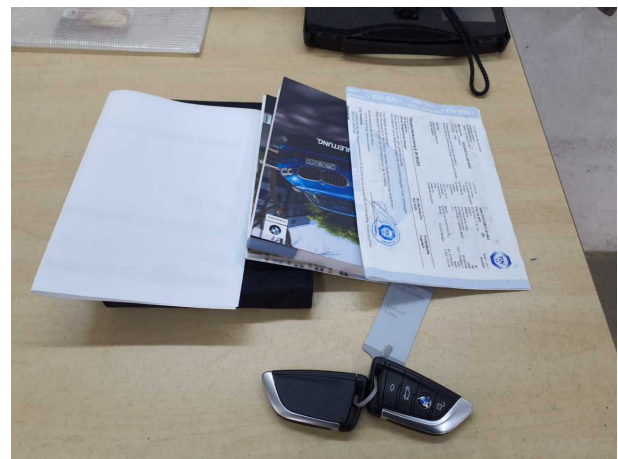


Figure 10: Misc.

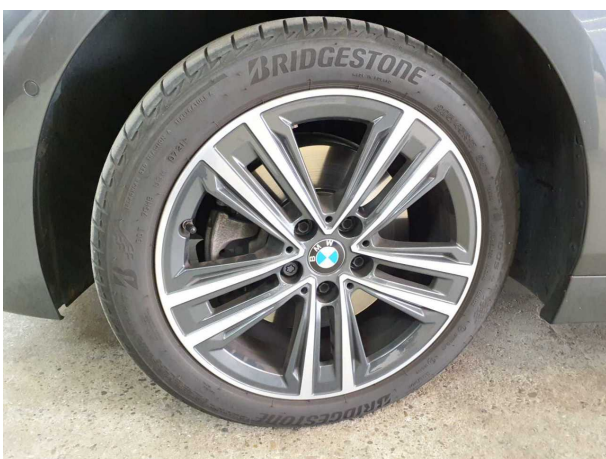


Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.

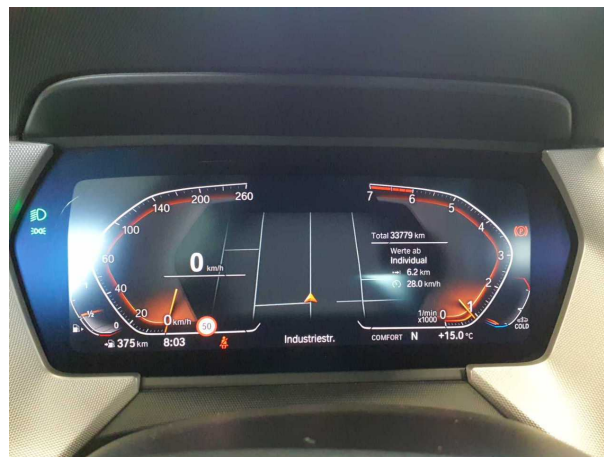


Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

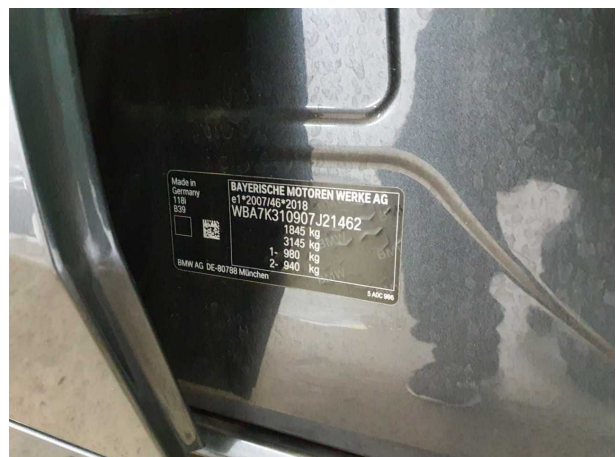


Figure 24: Misc.


Pictures of damage



Damage #1: 2nd wheel set: 1 alloy rim - Scratched - No deduction




Damage #1: 2nd wheel set: 1 alloy rim - Scratched - No deduction

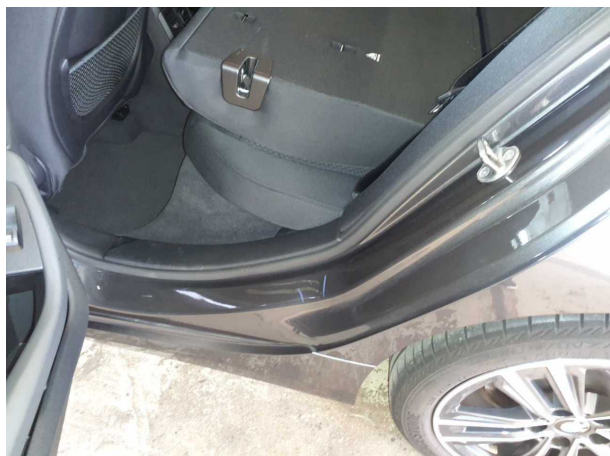

Damage #2: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage #2: Side panel - rear left side: Sill - Scratch(es) - Smart repair

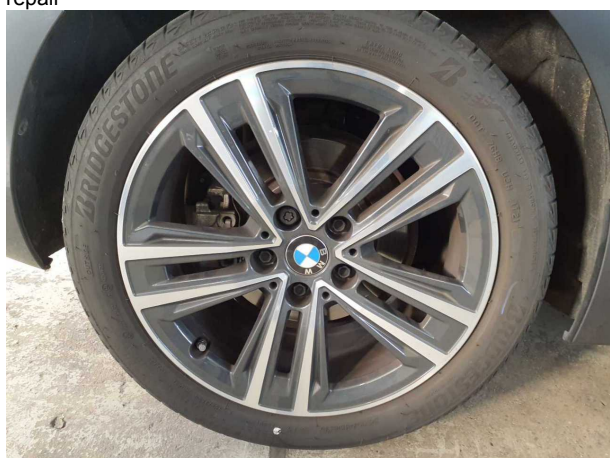


Damage #3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage #3: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage #4: Door - front left side: Door - dent(s) - Smooth repair work

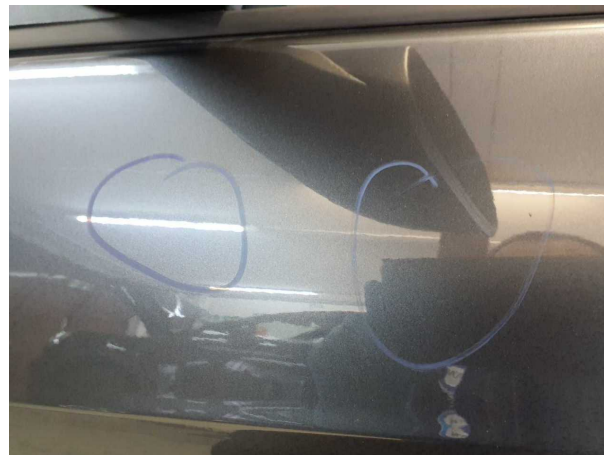

Damage #4: Door - front left side: Door - dent(s) - Smooth repair work

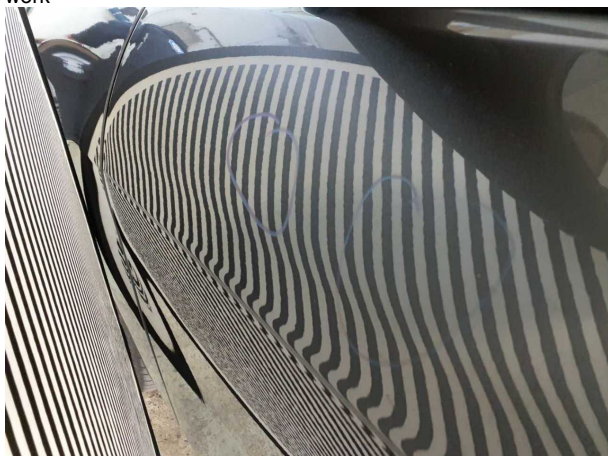

Damage #4: Door - front left side: Door - dent(s) - Smooth repair work

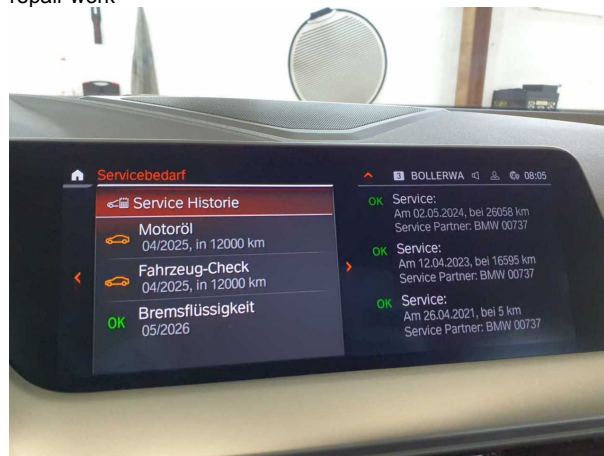

Damage #5: Misc.: Inspection / maintenance - Due - Perform



Damage #6: Rear bumper: Rear bumper - Deformed - Repair and paint



Damage #6: Rear bumper: Rear bumper - Deformed - Repair and paint




Damage #6: Rear bumper: Rear bumper - Deformed - Repair and paint




Damage #6: Rear bumper: Rear bumper - Deformed - Repair and paint




Damage #7: Door - rear left side: Door - Scratch(es) - Paint

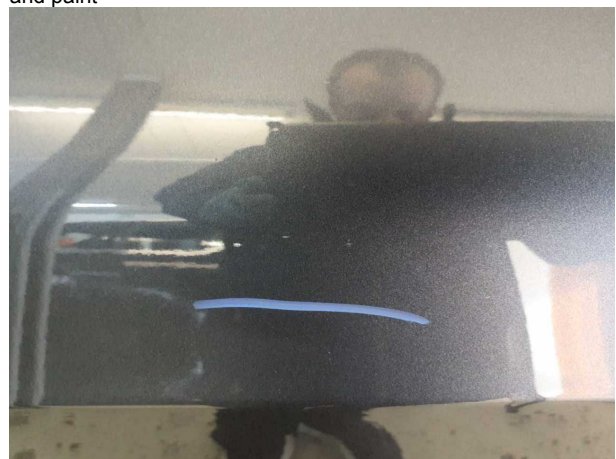

Damage #7: Door - rear left side: Door - Scratch(es) - Paint

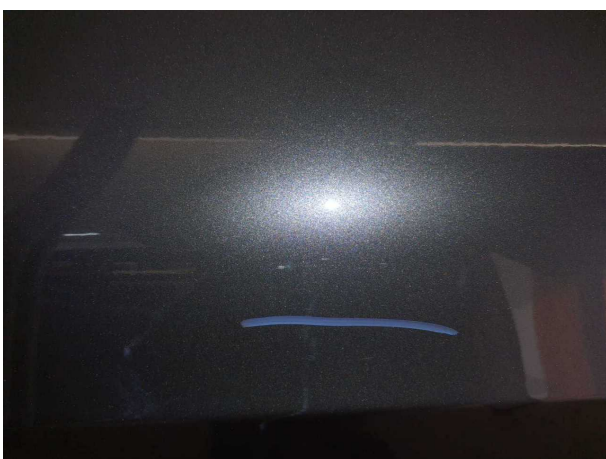

Damage #7: Door - rear left side: Door - Scratch(es) - Paint

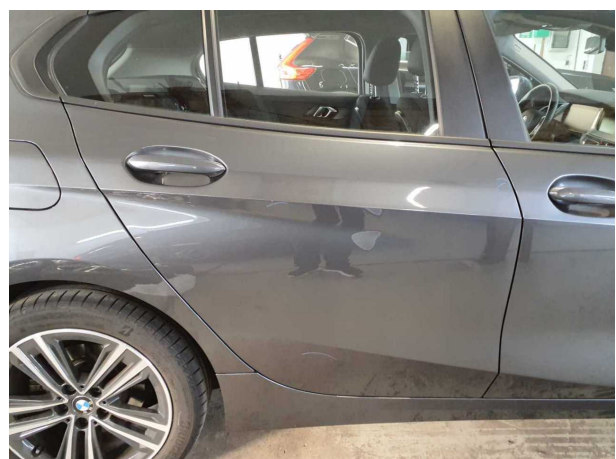

Damage #8: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage
- Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage
- Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage
- Repair and paint