



WAUZZZFY4L2128617

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	101,166 km
Manufacturer	Audi	Next maintenance in	293 Tag(e)
Type / Model	Q5 50 TFSI e	Main inspection (Report on hand)	03/2026
Vehicle Identification number	WAUZZZFY4L2128617	Power / Engine displacement	185 kW / 1,984 ccm
First registration	5 Feb 2021	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratched - Smart repair
2	Trim / covers	Brightware / decorative strip - Scratched - Replace
3	Door - rear left side	Door handle - outside - Scratched - Smart repair
4	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
5	Sill - right side	Trim - Scratched - Smart repair
6	Mudguard - right side	Wheel arch - Scratched - Replace
7	Rear bumper	Rear bumper - Scratched - Paint
8	Vehicle glazing	Windscreen - Stone chips - Replace
9	Front bumper	Front bumper (Verformt) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Rear, Provided by user / customer

Detected repainting

No.	Location
	None detectable

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 29 Apr 2025

Protocol number: 39505707

Delivery date: 29 Apr 2025



Auto Plus

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/65 R17 108H	Michelin	Winter tyres	5mm - 5mm	o.k.	
2	235/65 R17 108H	Michelin	Winter tyres	5mm - 5mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/60 R18 103V	Michelin	Summer tyres	4mm - 4mm	o.k.	
2	235/60 R18 107W	Pirelli	Summer tyres	5mm - 5mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 29 Apr 2025

Protocol number: 39505707

Delivery date: 29 Apr 2025



Auto Plus

Vehicle details

Manufacturer	Audi	Inspection condition	Sufficient
Type / Model	Q5 50 TFSI e	Mileage (Read)	101,166 km
Vehicle Identification number	WAUZZZFY4L2128617	First registration	5 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

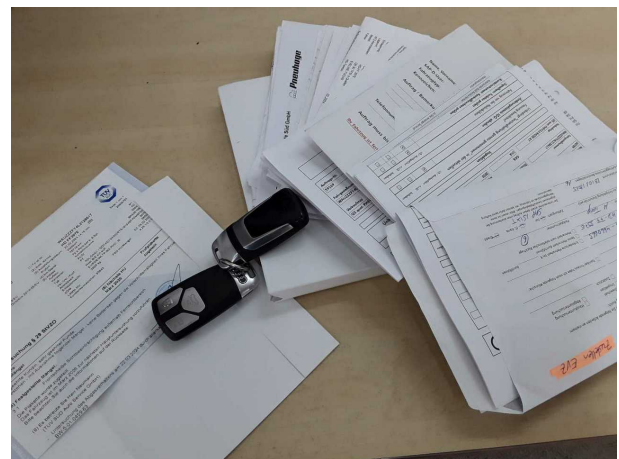


Figure 10: Misc.



Figure 11: Misc.

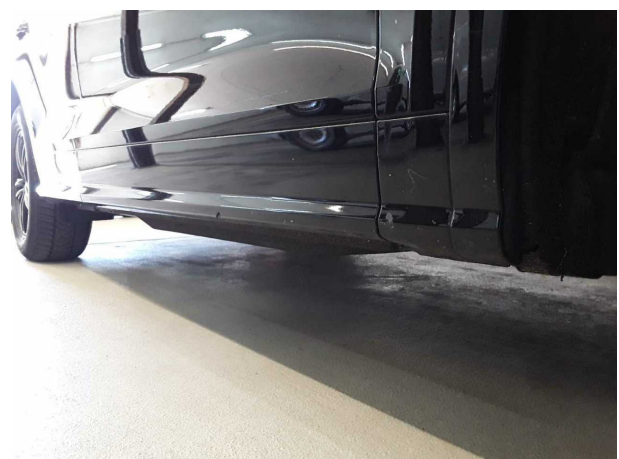


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

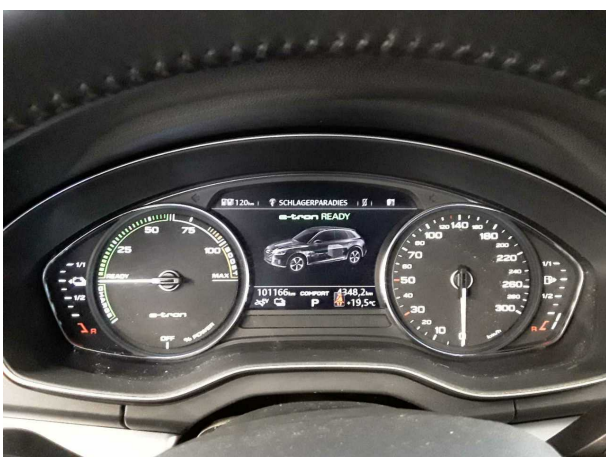


Figure 17: Misc.

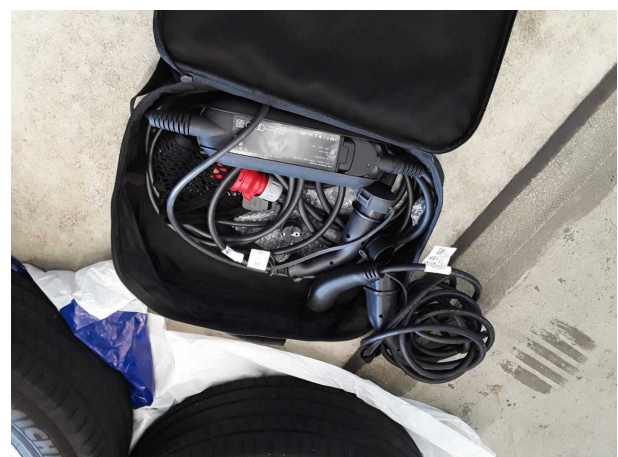


Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 29 Apr 2025
Protocol number: 39505707
Delivery date: 29 Apr 2025



Auto Plus



Figure 19: Misc.



Figure 20: Misc.

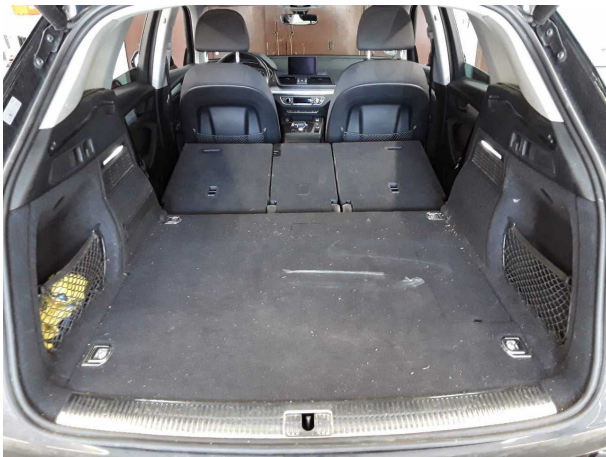


Figure 21: Misc.

Pictures of damage



Damage #1: Wing mirror - right side: Cap - Scratched - Smart repair



Damage #1: Wing mirror - right side: Cap - Scratched - Smart repair



Damage #2: Trim / covers: Brightware / decorative strip - Scratched - Replace



Damage #2: Trim / covers: Brightware / decorative strip - Scratched - Replace



Damage #3: Door - rear left side: Door handle - outside - Scratched - Smart repair



Damage #3: Door - rear left side: Door handle - outside - Scratched - Smart repair




Damage #4: Mudguard - right side: Mudguard - right side - dent(s)...
Smooth repair work



Damage #4: Mudguard - right side: Mudguard - right side -
dent(s) - Smooth repair work




Damage #5: Sill - right side: Trim - Scratched - Smart repair

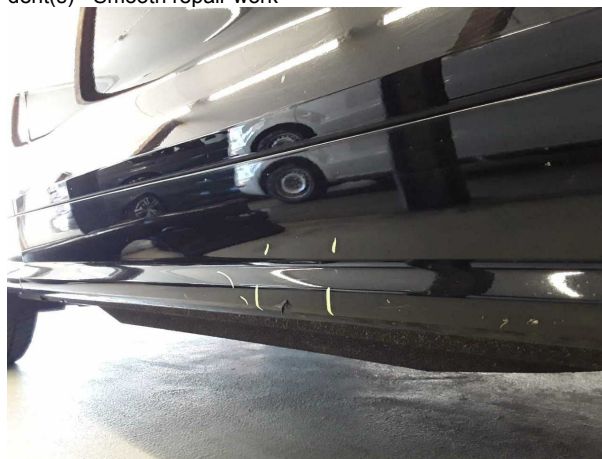


Damage #5: Sill - right side: Trim - Scratched - Smart repair



Damage #6: Mudguard - right side: Wheel arch - Scratched -
Replace

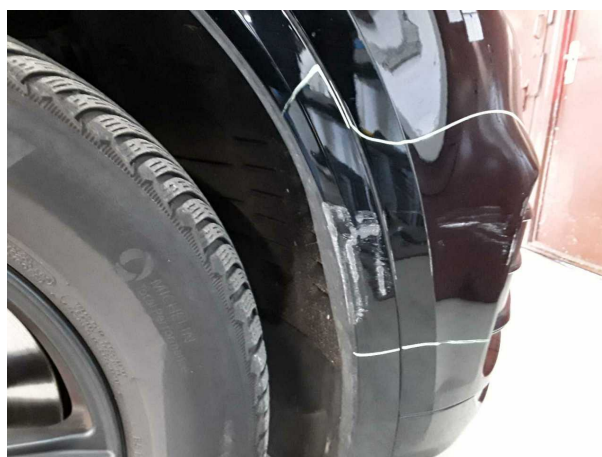

Damage #6: Mudguard - right side: Wheel arch - Scratched -
Replace

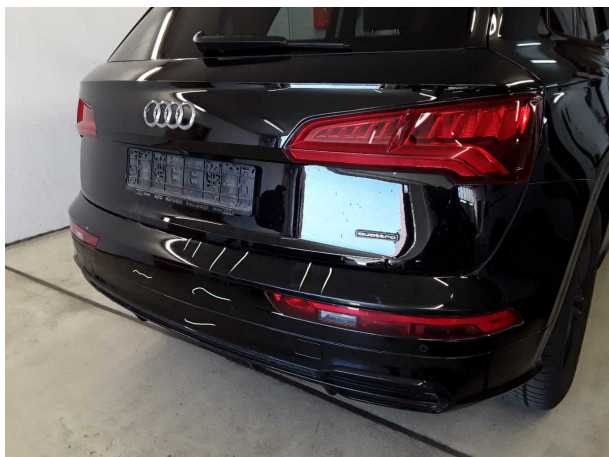

Damage #7: Rear bumper: Rear bumper - Scratched - Paint



Damage #7: Rear bumper: Rear bumper - Scratched - Paint



Damage #7: Rear bumper: Rear bumper - Scratched - Paint



Damage #7: Rear bumper: Rear bumper - Scratched - Paint



Damage #8: Vehicle glazing: Windscreen - Stone chips - Replace



Damage #8: Vehicle glazing: Windscreen - Stone chips - Replace



Damage #9: Front bumper: Front bumper (Verformt) - Scratched - Replace



Damage #9: Front bumper: Front bumper (Verformt) - Scratched - Replace



Damage #9: Front bumper: Front bumper (Verformt) - Scratched - Replace