



WAUZZZFZ4NP035322

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	97,712 km
Manufacturer	Audi	Next maintenance in	11 Monat(e)
Type / Model	Q4 40 e-tron	Main inspection (Report on hand)	03/2025
Vehicle Identification number	WAUZZZFZ4NP035322	Power / Engine displacement	70 kW
First registration	22 Mar 2022	Upholstery/Colour	/
Last maintenance		Paintwork	
Fuel type	Electric	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Documents	Service book (Wartungsnachweise fehlen) - No deduction
2	Rear bumper	Rear bumper - Scratched - Cover / polish
3	Misc.	Main inspection - Due - Replace
4	Mudguard - right side	Wheel well extension - Scratched - Smart repair
5	Front axle	Axles / undercarriage - Malposition - Set / adjust
6	Front bumper	Front bumper - Scratched - Smart repair
7	Wheel / tyres	Tyre - front - Expired - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Abrasion - No deduction
2	Body	Body (Steinschläge) - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/55 R19 101T	Bridgestone	Summer tyres	5mm - 5mm	Not o.k.	
2	255/50 R19 103T	Bridgestone	Summer tyres	4mm - 4mm	o.k.	

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 6 May 2025
Protocol number: 39585691
Delivery date: 6 May 2025



Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/55 R19 105V	Bridgestone	Winter tyres	5mm - 5mm	o.k.	
2	255/50 R19 107V	Bridgestone	Winter tyres	4mm - 4mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 6 May 2025
Protocol number: 39585691
Delivery date: 6 May 2025



Vehicle details

Manufacturer	Audi	Inspection condition	Sufficient
Type / Model	Q4 40 e-tron	Mileage (Read)	97,712 km
Vehicle Identification number	WAUZZZFZ4NP035322	First registration	22 Mar 2022

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient for the assessment of the vehicle.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 6 May 2025
Protocol number: 39585691
Delivery date: 6 May 2025



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

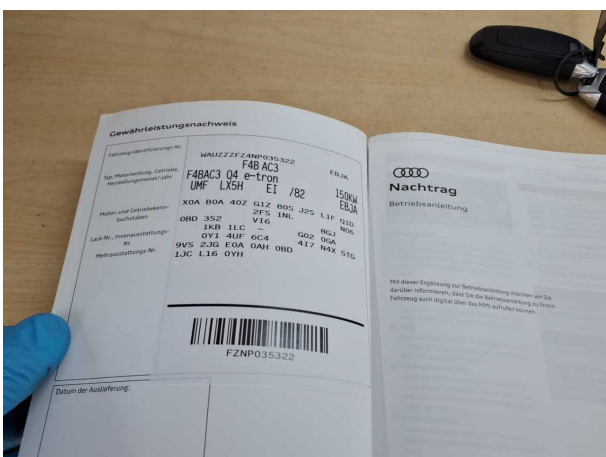


Figure 11: Misc.

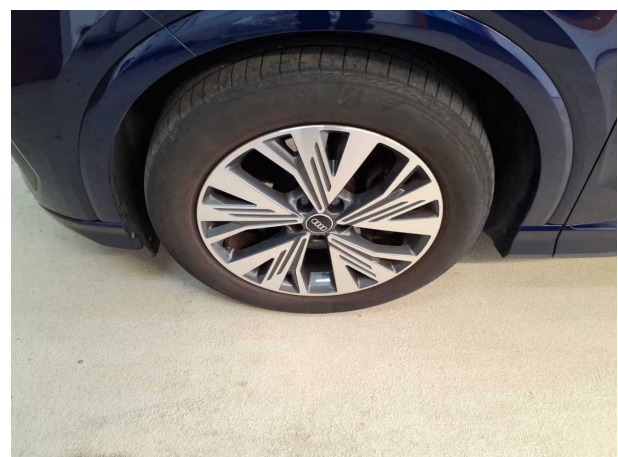


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

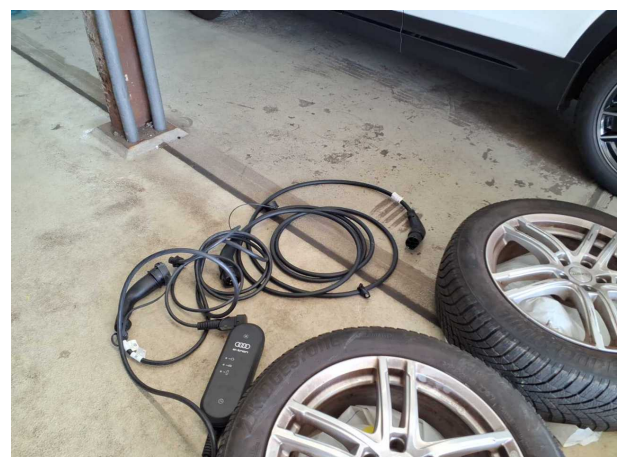


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

Pictures of damage



Damage #2: Rear bumper: Rear bumper - Scratched - Cover / polish




Damage #2: Rear bumper: Rear bumper - Scratched - Cover / polish




Damage #6: Front bumper: Front bumper - Scratched - Smart repair



Damage #2: Rear bumper: Rear bumper - Scratched - Cover / polish

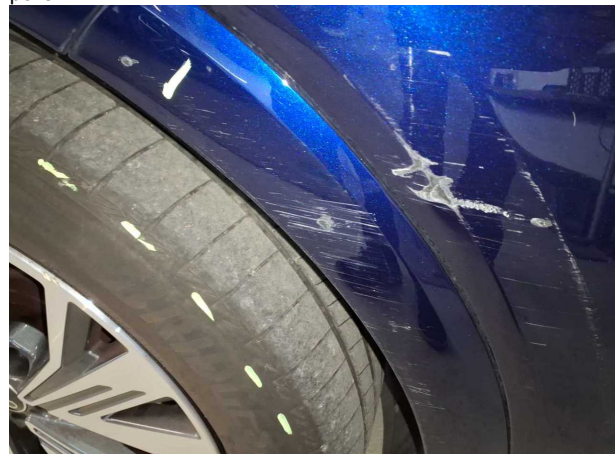

Damage #4: Mudguard - right side: Wheel well extension - Scratched - Smart repair

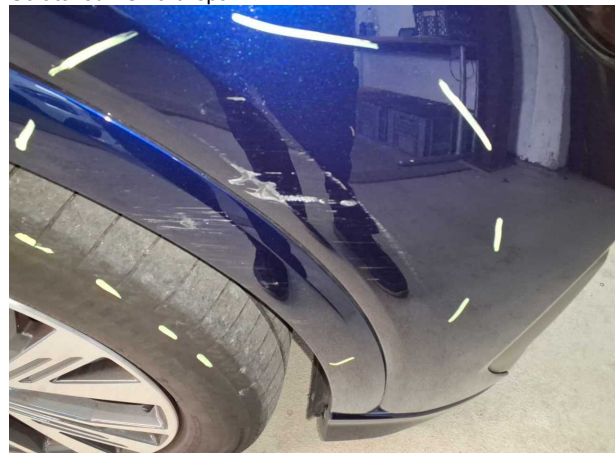

Damage #6: Front bumper: Front bumper - Scratched - Smart repair

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 6 May 2025
Protocol number: 39585691
Delivery date: 6 May 2025



Damage #7: Wheel / tyres: Tyre - front - Expired - Replace