



WBA7K510207J34923

Vehicle details

Operator		Inspection condition	conditional: light/ moisture/dirt
License number		Mileage (Read)	50,225 km
Manufacturer	BMW	Next maintenance in	2 Tag(e)
Type / Model	1er-Reihe 120i Advantage Steptronic Schräghecklimousine 5-türig 1998 ccm 178 PS / 131 KW bleifrei 7-Gang Automatik		
Vehicle Identification number	WBA7K510207J34923	Power / Engine displacement	/ 1,998 ccm
First registration	1 Jun 2021	Upholstery/Colour	Cloth / Black-Dark grey
Last maintenance		Paintwork	Black
Fuel type	Petrol	Gearbox	

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Wing mirror - left side	Cap - Abrasion - Replace
3	2nd wheel set	1 alloy rim - Scratched - Loss in value
4	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
6	Misc.	Inspection / maintenance (Bevorstehend) - Due - Perform
7	2nd wheel set	3 tyres - Damaged - Replace
8	Rear bumper	Rear bumper - Scratched - Repair and paint
9	Side panel - rear right side	Side panel - Scratched - Repair and paint
10	2nd wheel set	1 alloy rim - Scratched - Replace
11	Side panel - rear left side	Side panel - Damaged - Replace

Wear and tear

No.	Component group	Description
The vehicle shows traces of wear and tear corresponding to its age and purpose		

Missing parts

Missing part



Previous damages

No.	Previous damage
1	Side - left, Provided by user / customer, from 17 Jan 2023

Detected repainting

No.	Location
1	Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R17 91H	Pirelli	Winter tyres	7mm - 7mm	o.k.	o.k.
2	225/45 R17 91H	Pirelli	Winter tyres	8mm - 8mm	o.k.	o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R17 94Y	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.
2	225/45 R17 94Y	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment

Description
Automatic air conditioning
Navigation unit with map view
Radio DAB

Comments

Für die Richtig- und Vollständigkeit der Basisdaten - wird keine Gewähr übernommen!

Ausstattungsliste nicht verfügbar.

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten.

Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n. i. O.



Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/ moisture/dirt
Type / Model	1er-Reihe 120i Advantage Steptronic Schräghecklimousine5-türig 1998 ccm 178 PS / 131 KW bleifrei 7-Gang Automatik	Mileage (Read)	50,225 km
Vehicle Identification number	WBA7K510207J34923	First registration	1 Jun 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear

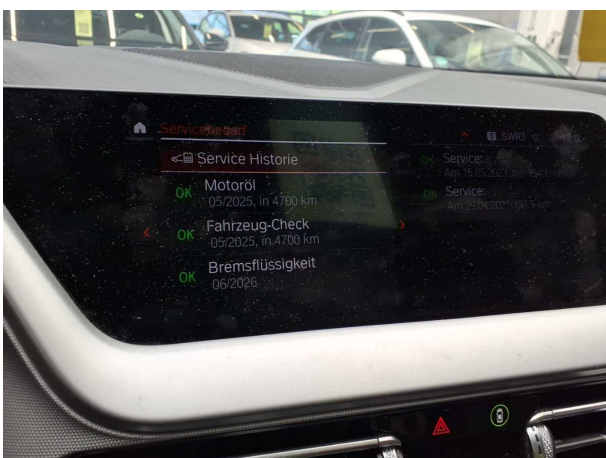


Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Interior

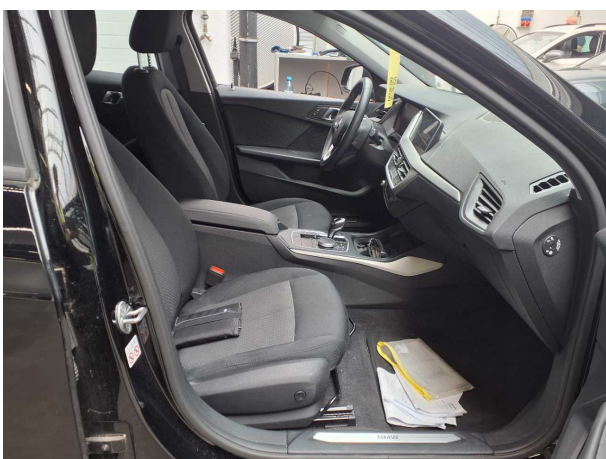


Figure 11: Interior



Figure 12: Interior

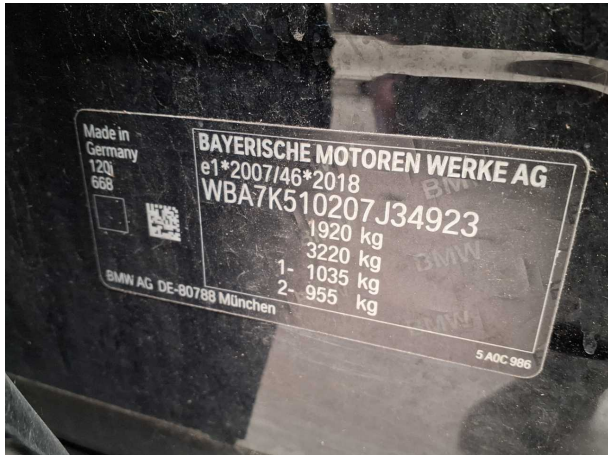


Figure 13: VIN

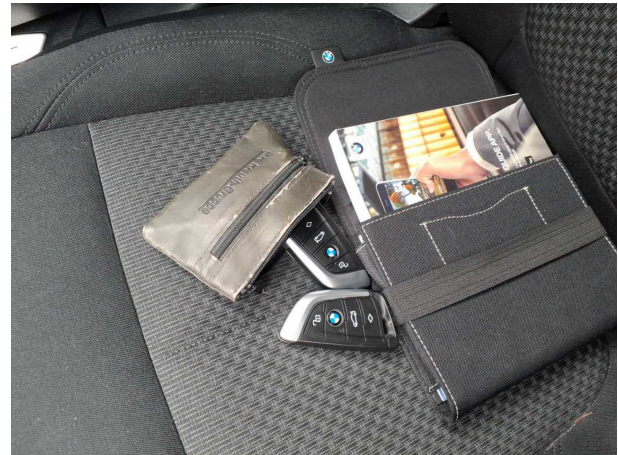


Figure 14: Documents



Figure 15: Mounted tyres

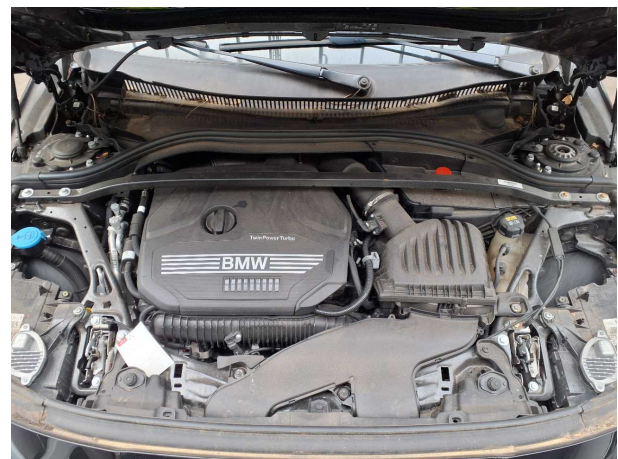


Figure 16: Misc.



Figure 17: Misc.

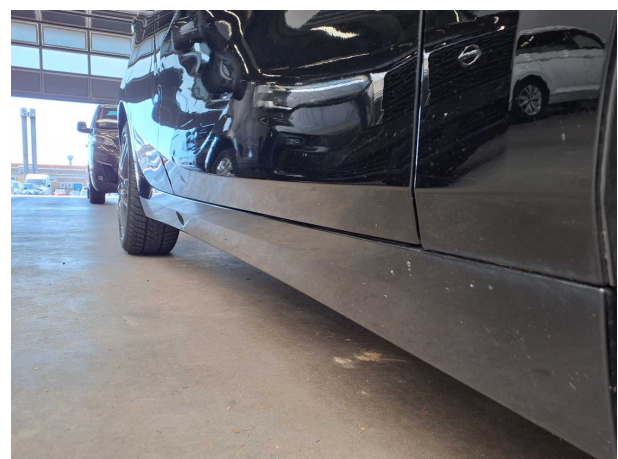


Figure 18: Misc.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen


Inspection location
Autokontor Bayern GmbH
Windecker Straße 2
61137 Schöneck

Inspection date: 29 Apr 2025
Protocol number: 39603608



Figure 19: Misc.


Pictures of damage

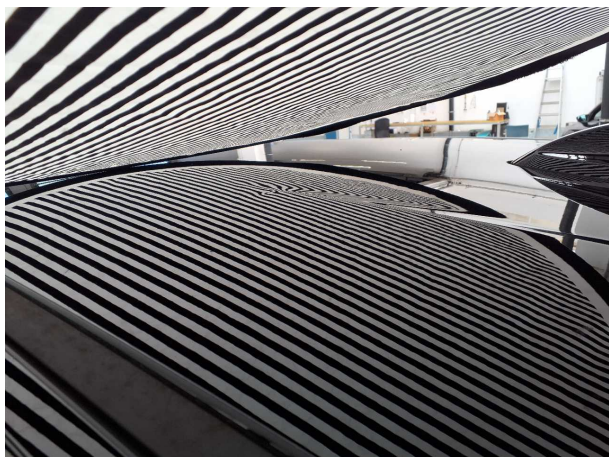


Damage #1: Roof: Roof - dent(s) - Smooth repair work




Damage #2: Wing mirror - left side: Cap - Abrasion - Replace

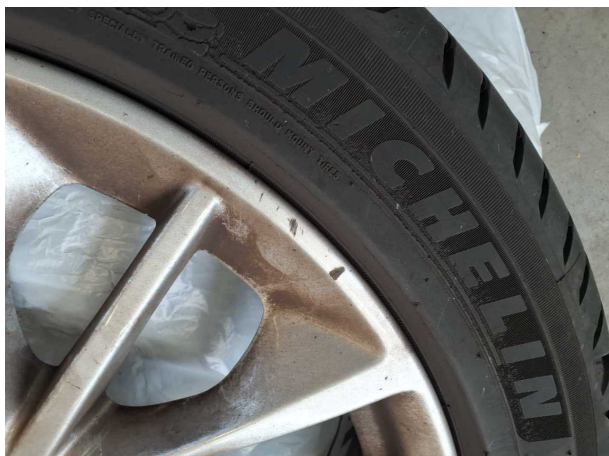

Damage #3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

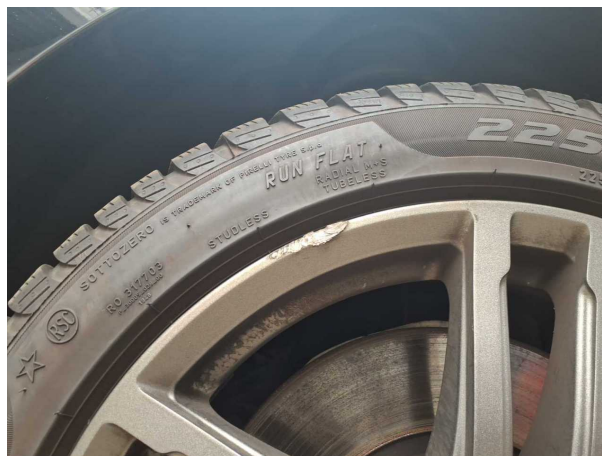

Damage #4: Wheel / tyres: Alloy rim - front left side - Scratched - Replace

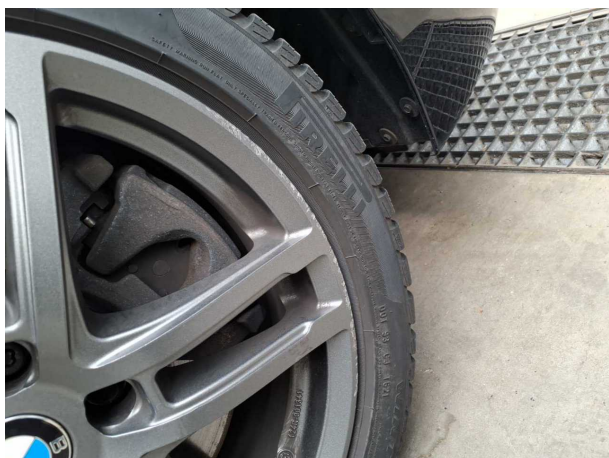

Damage #5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage #6: Misc.: Inspection / maintenance (Bevorstehend) - Due - Perform




Damage #7: 2nd wheel set: 3 tyres - Damaged - Replace




Damage #7: 2nd wheel set: 3 tyres - Damaged - Replace




Damage #7: 2nd wheel set: 3 tyres - Damaged - Replace

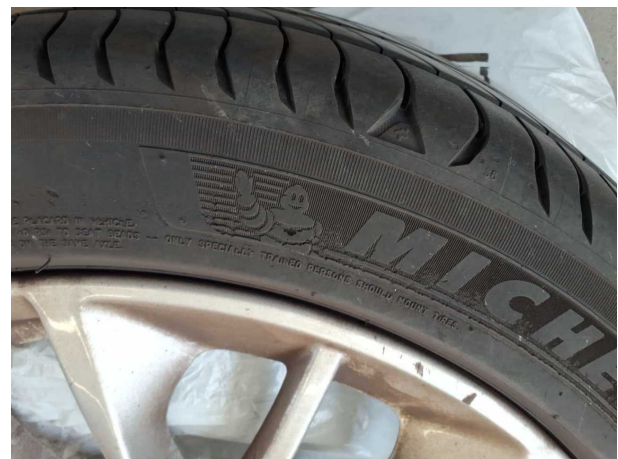

Damage #7: 2nd wheel set: 3 tyres - Damaged - Replace

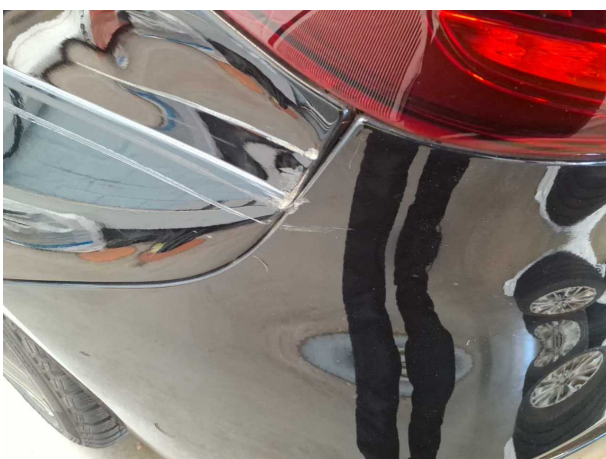

Damage #8: Rear bumper: Rear bumper - Scratched - Repair and paint

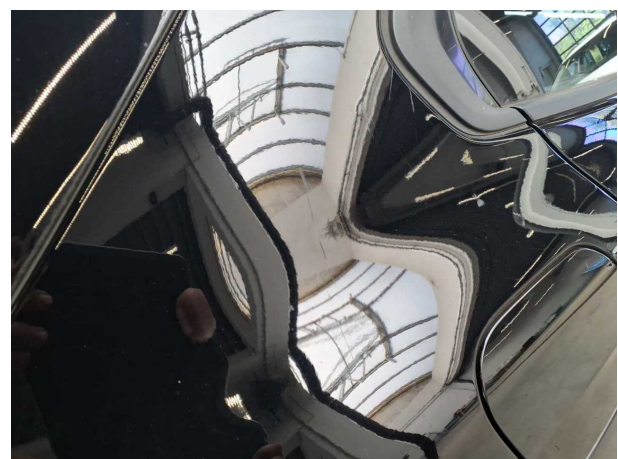

Damage #9: Side panel - rear right side: Side panel - Scratch... - Repair and paint



Damage #9: Side panel - rear right side: Side panel - Scratched - Repair and paint




Damage #10: 2nd wheel set: 1 alloy rim - Scratched - Replace



Damage #11: Side panel - rear left side: Side panel - Damaged - Replace



Damage #11: Side panel - rear left side: Side panel - Damaged - Replace

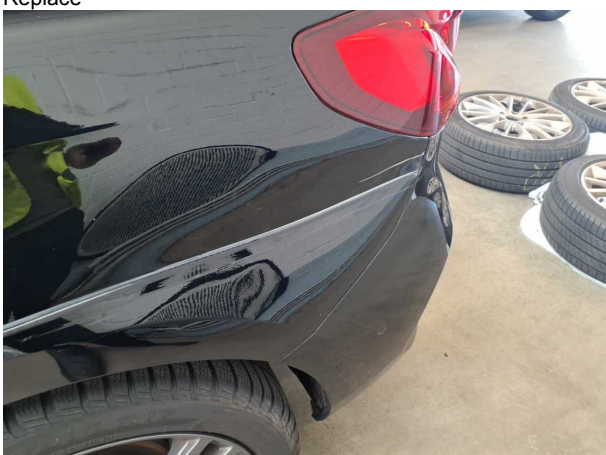

Damage #11: Side panel - rear left side: Side panel - Damaged - Replace

Pictures of repainting



Repainting 1: Door - rear left side, Door - front left side