



WBA6N31040FL23442

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	55,318 km
Manufacturer	BMW	Next maintenance in	8,000 km
Type / Model	330e	Main inspection (Report on hand)	04/2026
Vehicle Identification number	WBA6N31040FL23442	Power / Engine displacement	135 kW / 1,998 ccm
First registration	15 Apr 2021	Upholstery/Colour	/
Last maintenance	03/2024, 41,858 km	Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Documents	Log book (Fehlt) - No deduction
2	Trim / covers	Door trim - rear left side - Damaged - Loss in value
3	2nd wheel set	1 alloy rim - Scratched - Loss in value
4	Boot lid / rear door	Boot lid - Scratched - Smart repair
5	Front bumper	Front bumper - Scratched - Smart repair

Wear and tear

No.	Component group	Description
1	Interior	Interior - Abrasion - No deduction
2	Body	Body (Steinschläge) - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98H	Pirelli	Winter tyres	4mm - 4mm	o.k.	
2	225/50 R17 98H	Pirelli	Winter tyres	6mm - 6mm	o.k.	

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 24 Apr 2025

Protocol number: 39429513

Delivery date: 24 Apr 2025



Auto Plus

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/50 R17 98Y	Hankook	Summer tyres	6mm - 6mm	o.k.	
2	225/50 R17 98Y	Hankook	Summer tyres	5mm - 5mm	o.k.	

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					07/2026

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

Fahrzeug war zum Zeitpunkt der Besichtigung regennass, weitere Beschädigungen können nicht ausgeschlossen werden

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 24 Apr 2025

Protocol number: 39429513

Delivery date: 24 Apr 2025



Auto Plus

Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	330e	Mileage (Read)	55,318 km
Vehicle Identification number	WBA6N31040FL23442	First registration	15 Apr 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and the bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. At the time of the inspection, the condition could not be ensured for an adequate assessment. The expert therefore recommends a further inspection to reduce the prognosis risk.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear

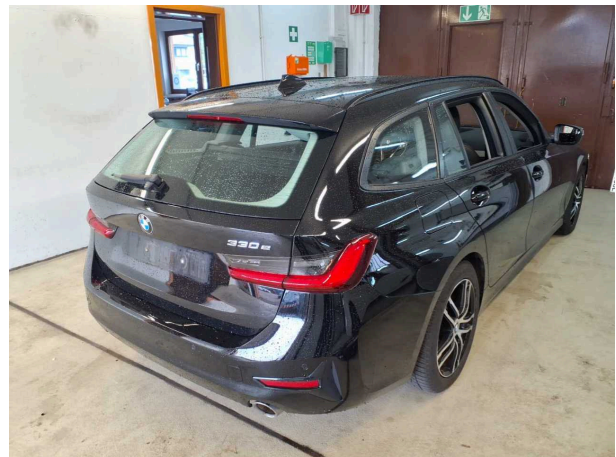


Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior

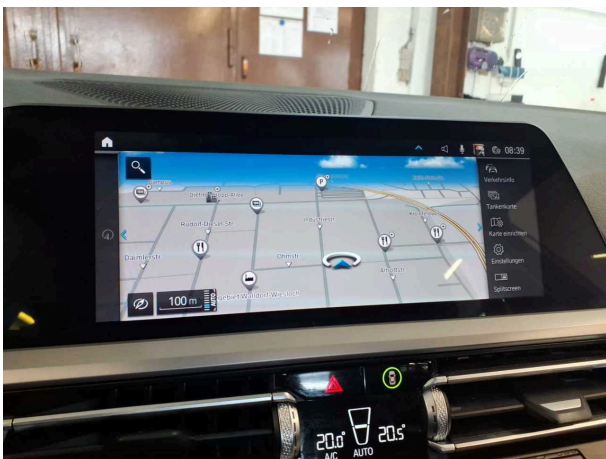


Figure 9: Interior

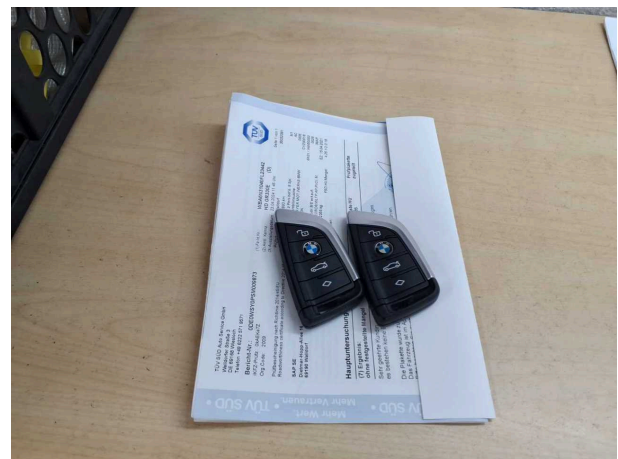


Figure 10: Misc.

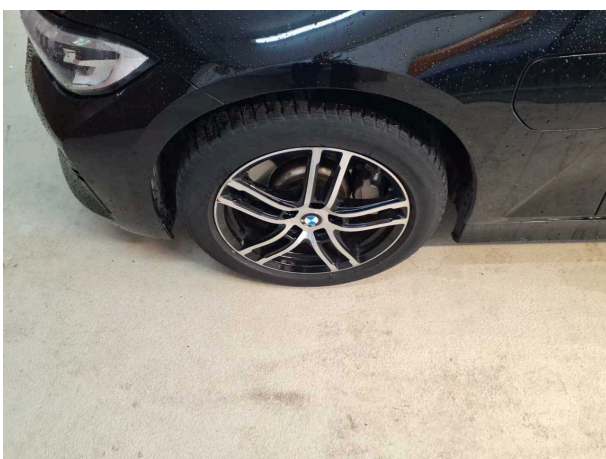


Figure 11: Misc.

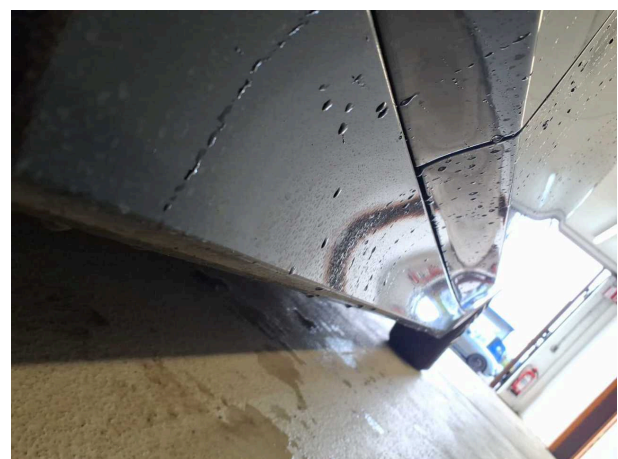


Figure 12: Misc.

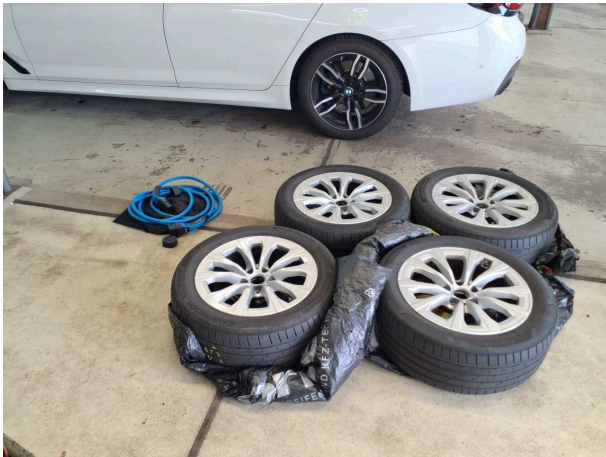


Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.

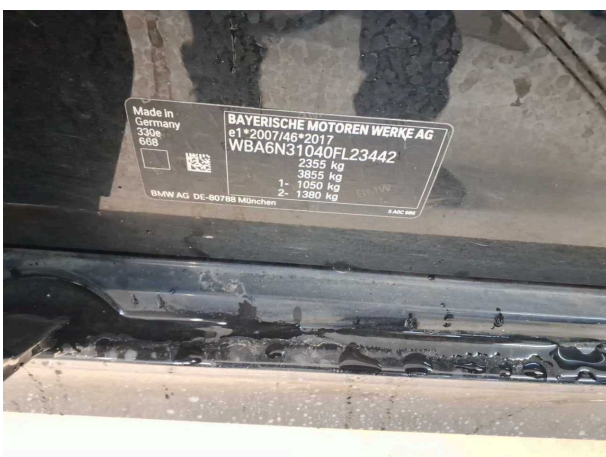


Figure 17: Misc.

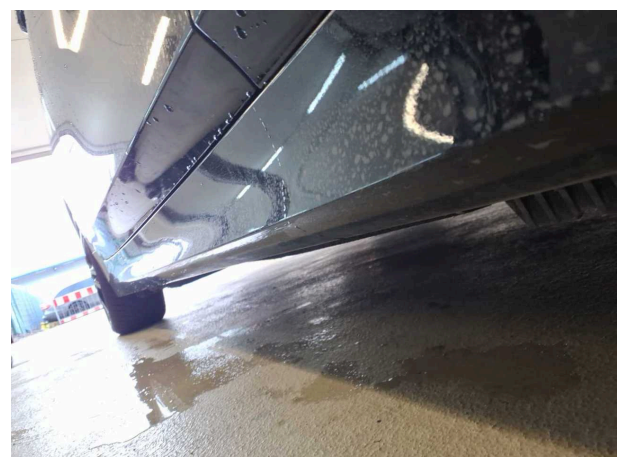


Figure 18: Misc.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 24 Apr 2025
Protocol number: 39429513
Delivery date: 24 Apr 2025



Auto Plus



Figure 19: Misc.

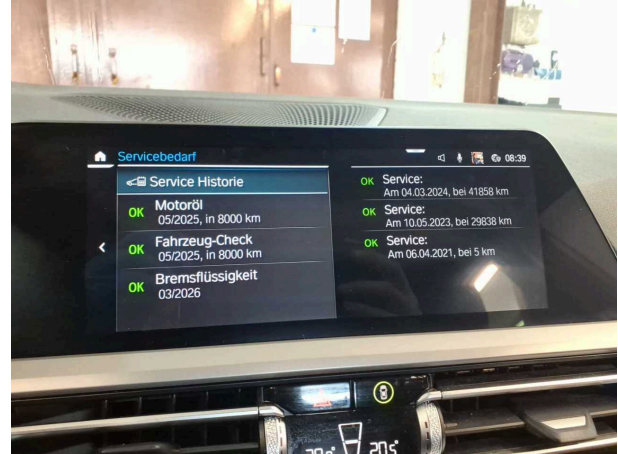


Figure 20: Misc.

Pictures of damage




Damage #2: Trim / covers: Door trim - rear left side - Damaged - Loss in value



Damage #2: Trim / covers: Door trim - rear left side - Damaged - Loss in value




Damage #3: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

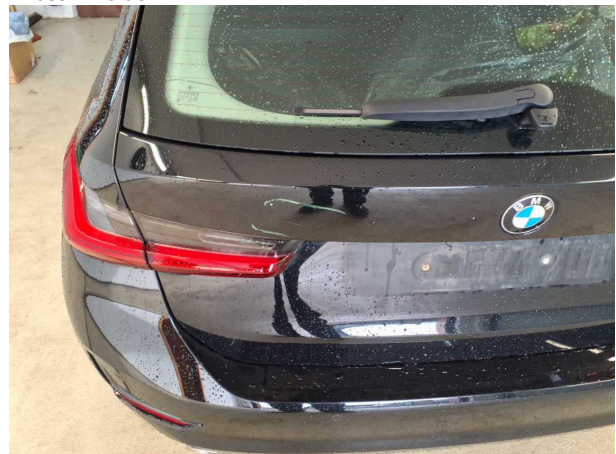

Damage #4: Boot lid / rear door: Boot lid - Scratched - Smart repair



Damage #4: Boot lid / rear door: Boot lid - Scratched - Smart repair

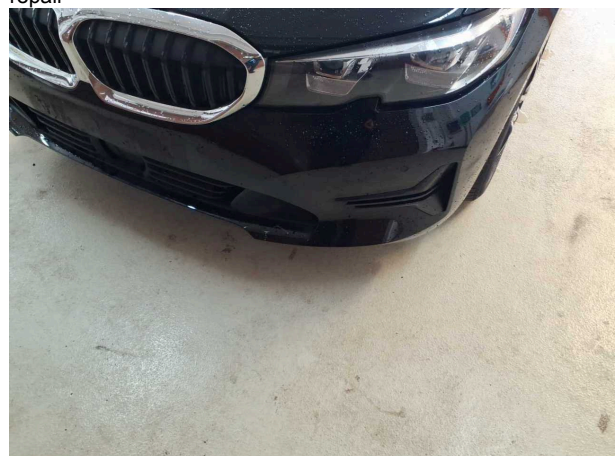

Damage #5: Front bumper: Front bumper - Scratched - Smart repair

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf


Inspection date: 24 Apr 2025
Protocol number: 39429513
Delivery date: 24 Apr 2025



Auto Plus



Damage #5: Front bumper: Front bumper - Scratched - Smart repair

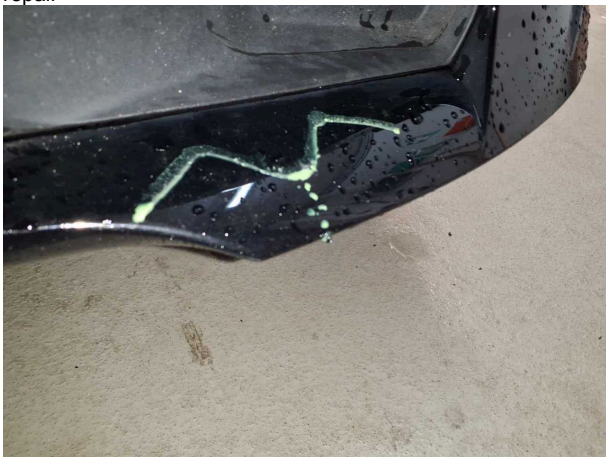

Damage #5: Front bumper: Front bumper - Scratched - Smart repair



Damage #5: Front bumper: Front bumper - Scratched - Smart repair