



WAUZZZFY2N2022749

Vehicle details

Operator		Inspection condition	conditional: light/ moisture/dirt
License number		Mileage (Read)	68,758 km
Manufacturer	Audi	Next maintenance in	19,300 km
Type / Model	Q5 50 TFSI e S tronic quattro advanced Sports Utility Vehicle5-türig 1984 ccm 299 PS / 220 KW Elektrisch 7- Gang Automatik		
Vehicle Identification number	WAUZZZFY2N2022749	Power / Engine displacement	/ 1,984 ccm
First registration	14 Dec 2022	Upholstery/Colour	Cloth / Black
Last maintenance		Paintwork	Black
Fuel type	Hybrid Petrol / E	Gearbox	

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
2	Door - rear right side	Door edge - Scratched - Smart repair
3	Mudguard - left side	Wheel well extension - Scratched - Replace
4	Door - rear right side	Door handle - outside - Scratched - Repair and paint
5	Front bumper	Front bumper - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
The vehicle shows traces of wear and tear corresponding to its age and purpose		

Missing parts

Missing part

Previous damages

No.	Previous damage
1	Rear, Provided by user / customer, from 7 Feb 2023

Detected repainting

No.	Location
1	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/60 R18 107H	Dunlop	Winter tyres	4mm - 4mm	Not o.k.	o.k.
2	235/60 R18 107H	Dunlop	Winter tyres	5mm - 5mm	Not o.k.	o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/55 R19 101W	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.
2	235/55 R19 101W	Michelin	Summer tyres	5mm - 5mm	o.k.	o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment

Description
Automatic air conditioning
Navigation unit with map view
Radio DAB

Comments

Für die Richtig- und Vollständigkeit der Basisdaten - wird keine Gewähr übernommen!

Ausstattungsliste nicht verfügbar.

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten.
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n. i. O.



Vehicle details

Manufacturer	Audi	Inspection condition	conditional: light/ moisture/dirt
Type / Model	Q5 50 TFSI e S tronic quattro advanced Sports Utility Vehicle5-türig 1984 ccm 299 PS / 220 KW Elektrisch 7-Gang Automatik	Mileage (Read)	68,758 km
Vehicle Identification number	WAUZZZFY2N2022749	First registration	14 Dec 2022

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear

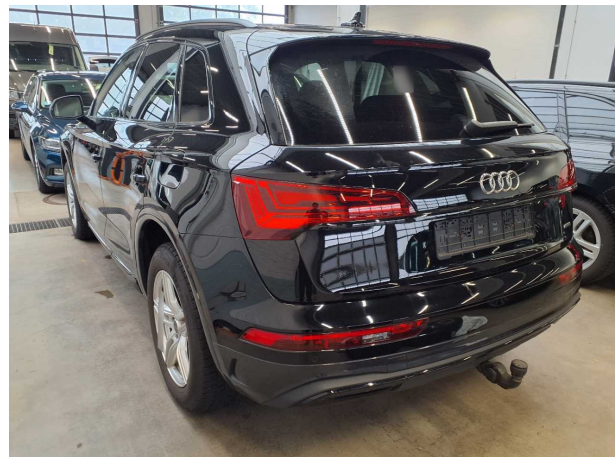


Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

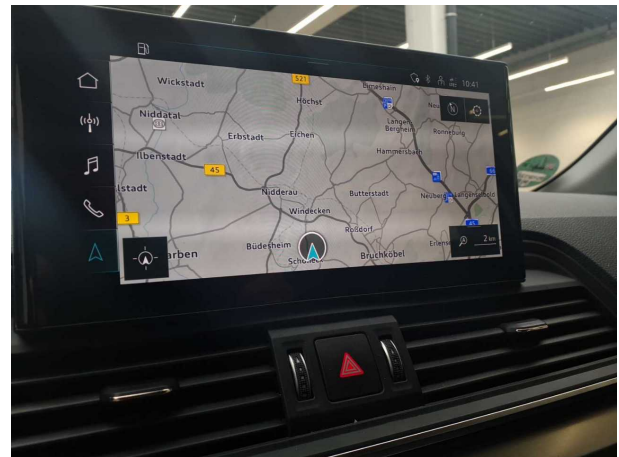


Figure 10: Interior

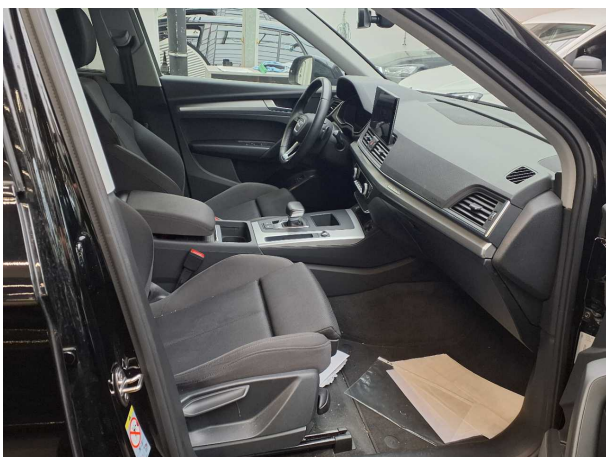


Figure 11: Interior



Figure 12: Interior

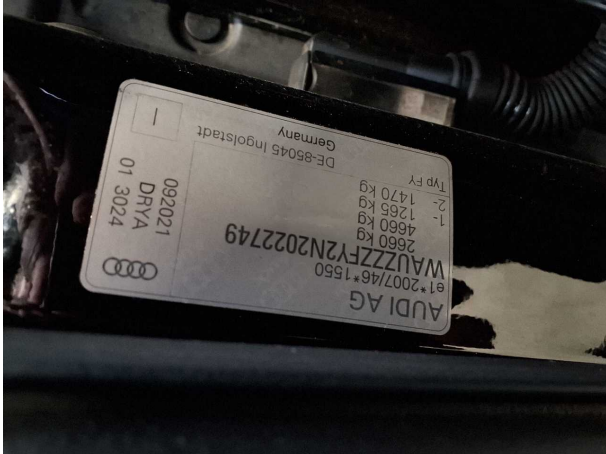


Figure 13: VIN



Figure 14: Accessories



Figure 15: Accessories



Figure 16: Accessories

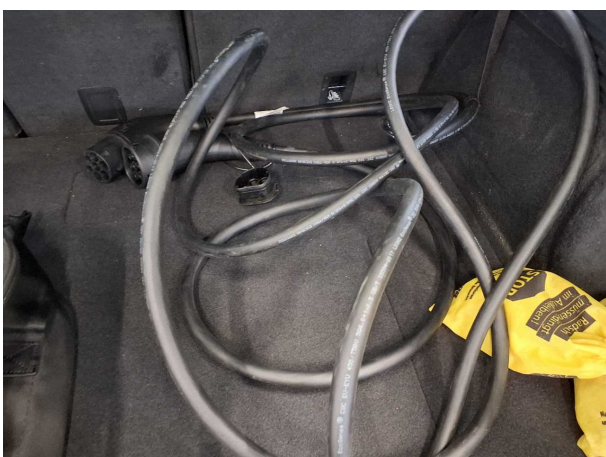


Figure 17: Accessories

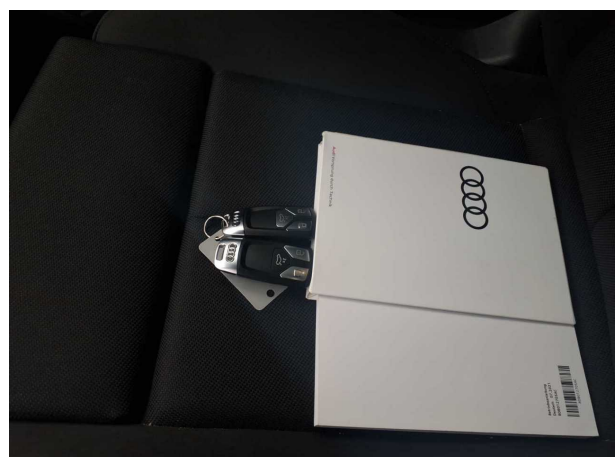


Figure 18: Documents



Figure 19: Mounted tyres



Figure 20: Misc.

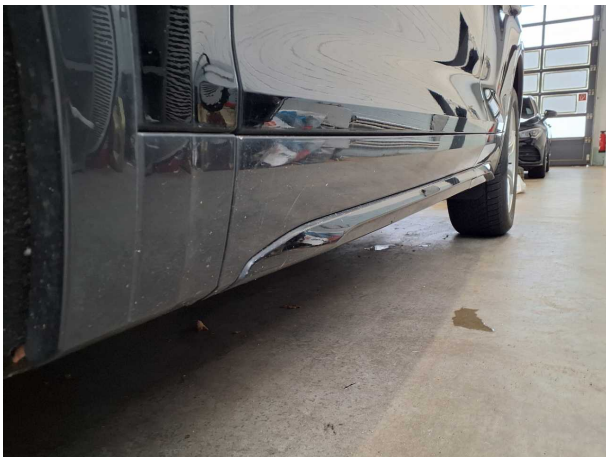


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

Pictures of damage



Damage #1: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage #3: Mudguard - left side: Wheel well extension - Scratch... - Replace



Damage #5: Front bumper: Front bumper - Scratched - Repair and paint



Damage #2: Door - rear right side: Door edge - Scratched - Smart repair



Damage #4: Door - rear right side: Door handle - outside - Scratched - Repair and paint

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Autokontor Bayern GmbH
Windecker Straße 2
61137 Schöneck

Inspection date: 25 Apr 2025
Protocol number: 39611933



Pictures of repainting



Repainting 1: Door - rear right side