



WAUZZZF8L2029234

Vehicle details

Operator		Inspection condition	conditional: light/ moisture/dirt
License number		Mileage (Read)	178,482 km
Manufacturer	Audi	Next maintenance in	-45,800 km
Type / Model	Q5 50 TFSI e S tronic quattro Sports Utility Vehicle5-türig 1984 ccm 299 PS / 220 KW Elektrisch 7-Gang Manuell	Main inspection	
Vehicle Identification number	WAUZZZF8L2029234	Power / Engine displacement	/ 1,984 ccm
First registration	12 Dec 2019	Upholstery/Colour	Leather / Beige
Last maintenance		Paintwork	Blue
Fuel type	Hybrid Petrol / E	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Interior trim - Deformed - Replace
2	Side panel - rear left side	Wheel well extension - Scratched - Repair and paint
3	Misc.	Main inspection - No evidence - Perform
4	Mudguard - right side	Wheel well extension - Scratched - Replace
5	Wing mirror - right side	Cap - Abrasion - Replace
6	Side panel - rear right side	Wheel well extension - Missing - Replace
7	Door - rear left side	Door - Scratched - Repair and paint
8	Misc.	Inspection / maintenance - Due - Perform
9	Side panel - rear left side	Side panel - Scratched - Repair and paint
10	Mudguard - right side	Mudguard - right side - Scratched - Replace
11	Rear bumper	Rear bumper - Scratched - Replace
12	Wheel / tyres	Alloy rim - front right side - Damaged - Replace
13	Front bumper	Front bumper - Scratched - Replace
14	Door - front right side	Door - Scratched - Replace
15	Door - rear right side	Door - Scratched - Replace
16	2nd wheel set	2nd wheel set (fehlt) - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratched - No deduction



Missing parts

Missing part

Previous damages

No.	Previous damage
1	Side right, Provided by user / customer, from 5 Jul 2022

Detected repainting

No.	Location
1	Side panel - rear right side

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	235/55 R17 104H	Goodyear	Winter tyres	5mm - 5mm	o.k.	o.k.
2	235/55 R17 104H	Goodyear	Winter tyres	6mm - 6mm	o.k.	o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment

Description
Automatic air conditioning
Navigation unit with map view
Radio DAB

Comments

Für die Richtig- und Vollständigkeit der Basisdaten - wird keine Gewähr übernommen!

Ausstattungsliste nicht verfügbar.

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten.
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, n. i. O.



Vehicle details

Manufacturer	Audi	Inspection condition	conditional: light/ moisture/dirt
Type / Model	Q5 50 TFSI e S tronic quattro Sports Utility Vehicle5-türig 1984 ccm 299 PS / 220 KW Elektrisch 7-Gang Manuell	Mileage (Read)	178,482 km
Vehicle Identification number	WAUZZZFY8L2029234	First registration	12 Dec 2019

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Interior

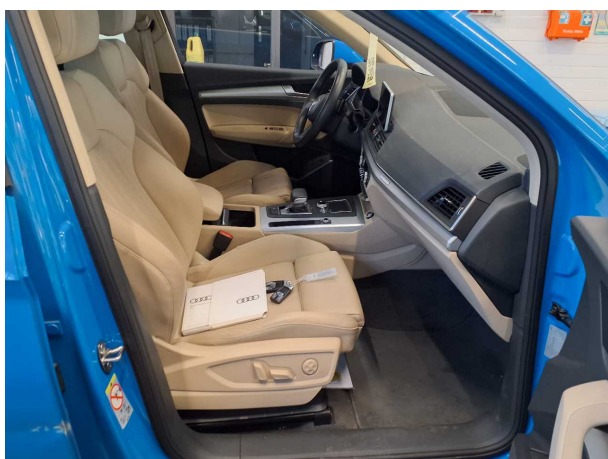


Figure 11: Interior

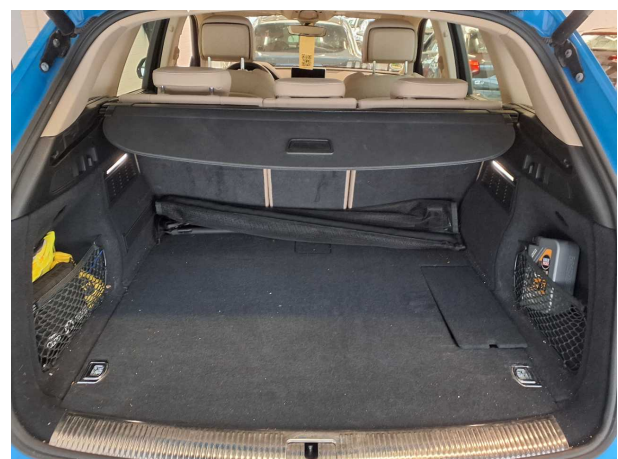


Figure 12: Interior

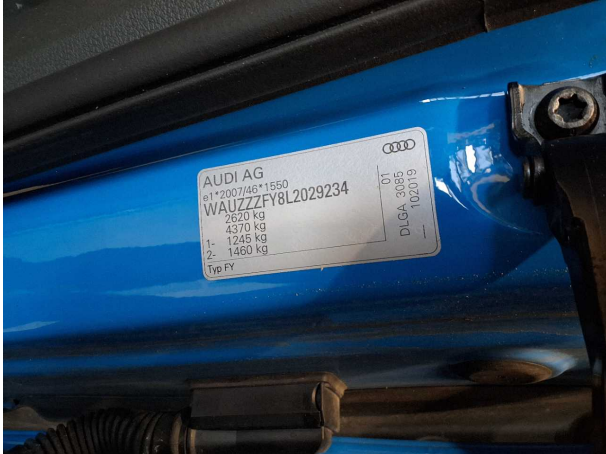


Figure 13: VIN



Figure 14: Accessories



Figure 15: Accessories



Figure 16: Accessories

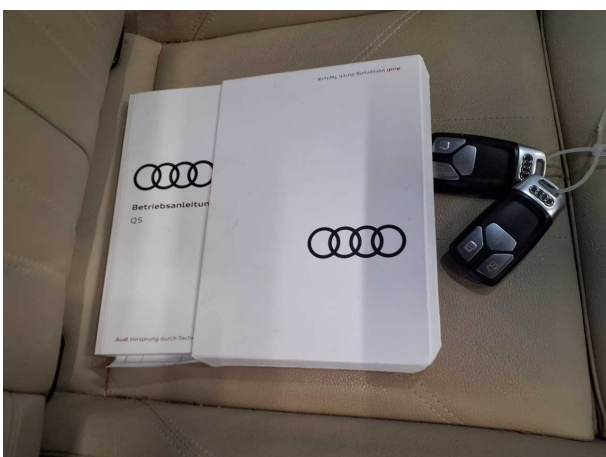


Figure 17: Documents



Figure 18: Mounted tyres



Figure 19: Misc.



Figure 20: Misc.

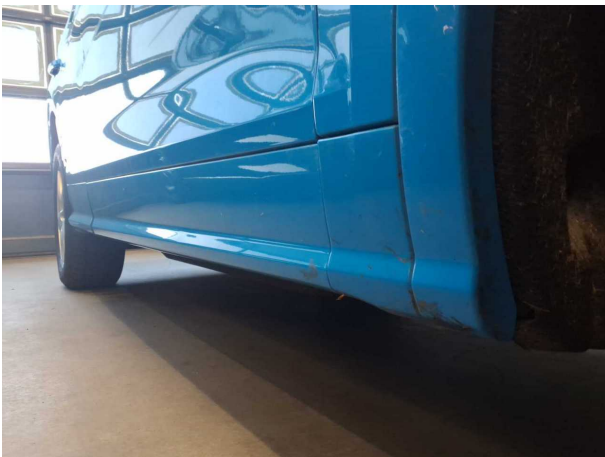


Figure 21: Misc.

Pictures of damage



Damage #1: Side panel - rear right side: Interior trim - Deformed - Replace



Damage #2: Side panel - rear left side: Wheel well extension - Scratched - Repair and paint




Damage #4: Mudguard - right side: Wheel well extension - Scratched - Replace



Damage #4: Mudguard - right side: Wheel well extension - Scratched - Replace



Damage #5: Wing mirror - right side: Cap - Abrasion - Replace

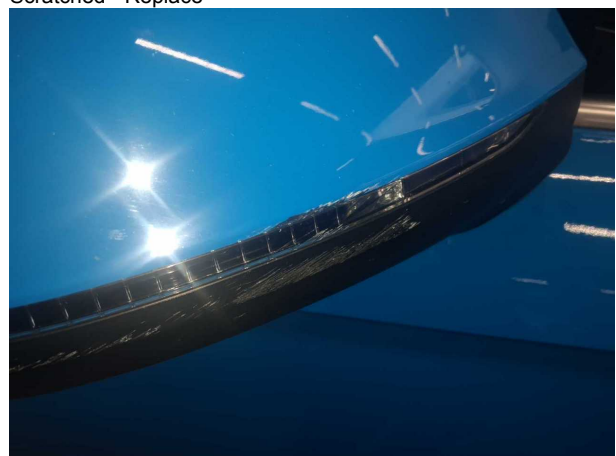

Damage #5: Wing mirror - right side: Cap - Abrasion - Replace



Damage #6: Side panel - rear right side: Wheel well extension - Missing - Replace




Damage #8: Misc.: Inspection / maintenance - Due - Perform




Damage #10: Mudguard - right side: Mudguard - right side - Scratched - Replace



Damage #7: Door - rear left side: Door - Scratched - Repair and paint

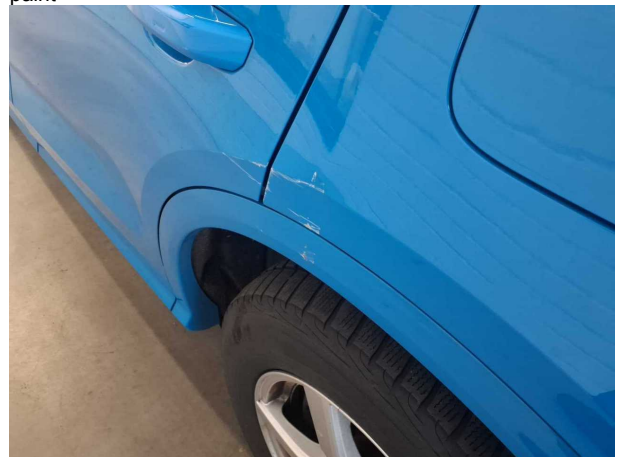

Damage #9: Side panel - rear left side: Side panel - Scratched - Repair and paint

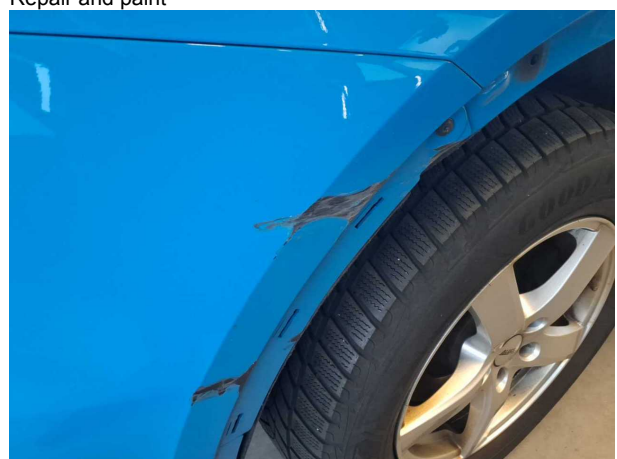

Damage #11: Rear bumper: Rear bumper - Scratched - Replace




Damage #12: Wheel / tyres: Alloy rim - front right side - Damaged - Replace




Damage #13: Front bumper: Front bumper - Scratched - Replace



Damage #14: Door - front right side: Door - Scratched - Replace

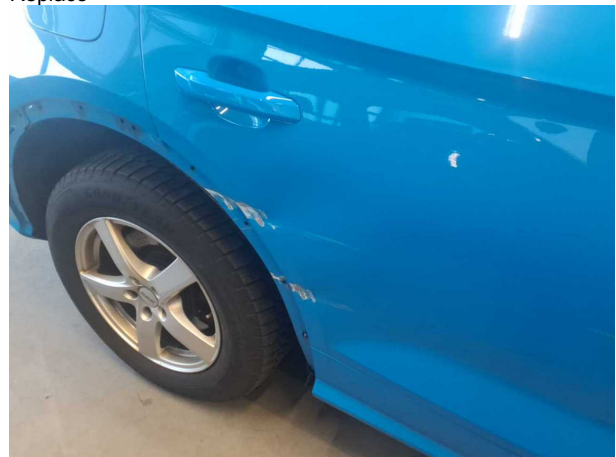

Damage #15: Door - rear right side: Door - Scratched - Replace

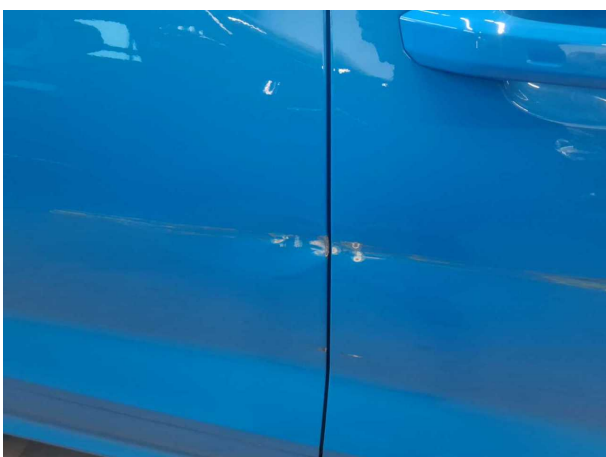

Damage #15: Door - rear right side: Door - Scratched - Replace



Pictures of repainting



Repainting 1: Side panel - rear right side