



WBA6V710105T80257

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	92,802 km
Manufacturer	BMW	Next maintenance in	700 km
Type / Model	218i Gran Tourer	Main inspection (Report on hand)	06/2026
Vehicle Identification number	WBA6V710105T80257	Power / Engine displacement	100 kW / 1,499 ccm
First registration	28 May 2021	Upholstery/Colour	/
Last maintenance	01/2025, 85,186 km	Paintwork	
Fuel type	Petrol	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratched - No deduction
2	Wheel / tyres	Alloy rim - front right side - Scratched - No deduction
3	Wheel / tyres	Alloy rim - rear right side - Scratched - No deduction
4	Door - front right side	Door - dent(s) - Smooth repair work
5	Bonnet	Bonnet - dent(s) - Smooth repair work
6	Braking system	Brake discs and pads - rear (Laut Anzeige) - Worn - Replace
7	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Front bumper	Front bumper (Steinschläge) - No deduction
3	Body	Body (Steinschläge) - Scratch(es) - No deduction
4	Interior	Interior - Abrasion - No deduction
5	Vehicle glazing	Windscreen (Steinschläge) - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 15 May 2025

Protocol number: 39752325

Delivery date: 15 May 2025



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/55 R17 95V	Bridgestone	Winter tyres	7mm - 7mm	o.k.	
2	205/55 R17 95T	Pirelli	Winter tyres	7mm - 7mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	205/60 R16 96W	Bridgestone	Summer tyres	5mm - 5mm	o.k.	
2	205/60 R16 96W	Michelin	Summer tyres	6mm - 6mm	o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 15 May 2025

Protocol number: 39752325

Delivery date: 15 May 2025



Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	218i Gran Tourer	Mileage (Read)	92,802 km
Vehicle Identification number	WBA6V710105T80257	First registration	28 May 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient for the assessment of the vehicle.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

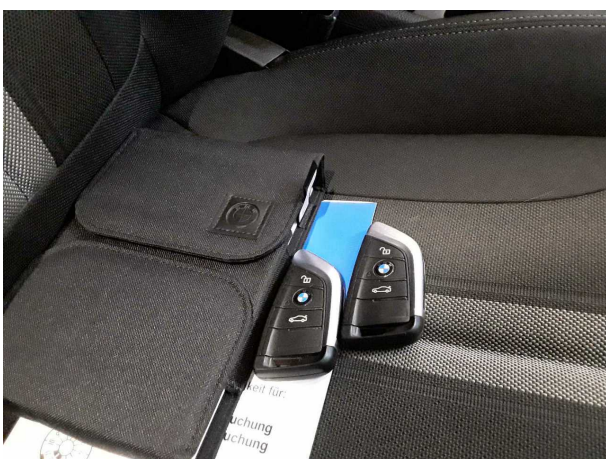


Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.

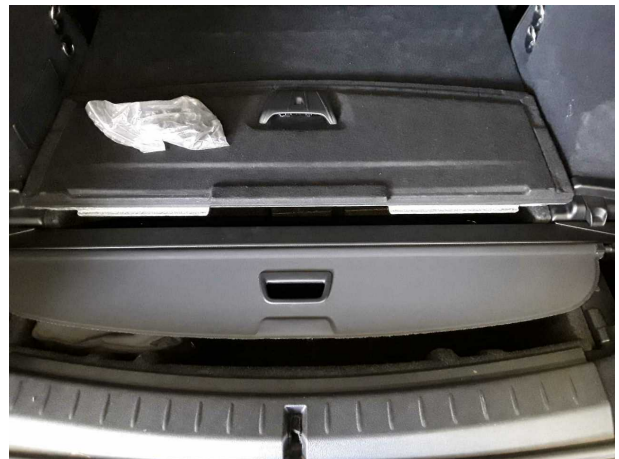


Figure 16: Misc.

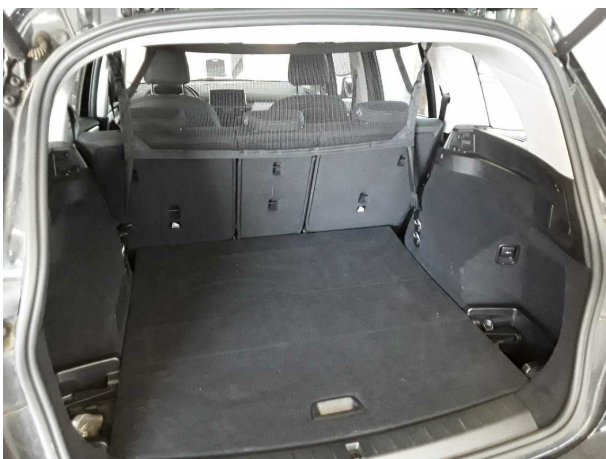


Figure 17: Misc.



Figure 18: Misc.

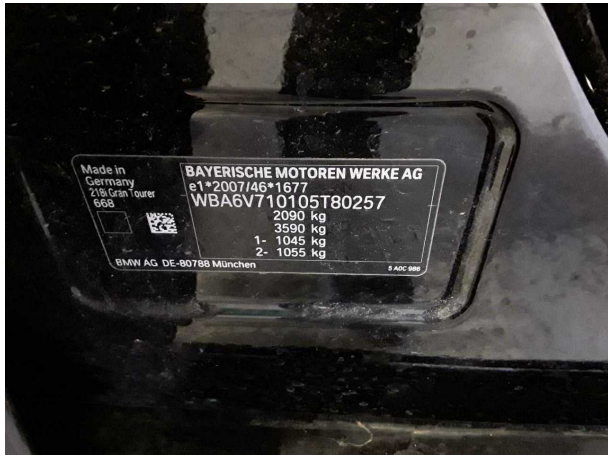


Figure 19: Misc.

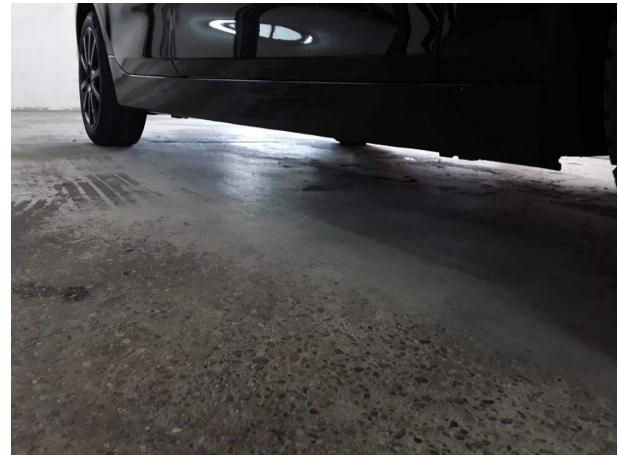


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 15 May 2025
Protocol number: 39752325
Delivery date: 15 May 2025



Figure 25: Misc.

Pictures of damage



Damage #1: Wheel / tyres: Alloy rim - front left side - Scratched - No deduction




Damage #1: Wheel / tyres: Alloy rim - front left side - Scratched - No deduction



Damage #2: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction



Damage #2: Wheel / tyres: Alloy rim - front right side - Scratched - No deduction

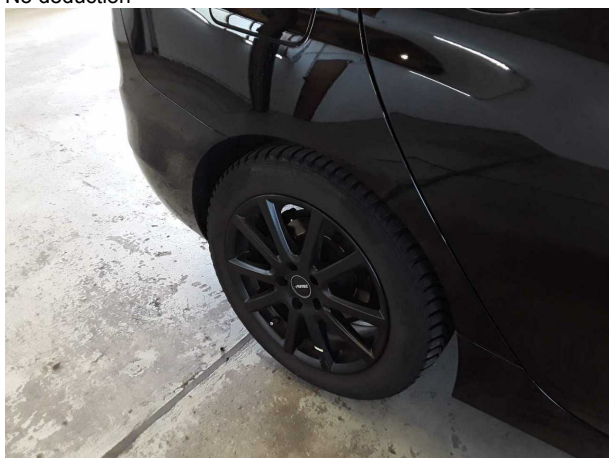

Damage #3: Wheel / tyres: Alloy rim - rear right side - Scratched - No deduction



Damage #3: Wheel / tyres: Alloy rim - rear right side - Scratched - No deduction



Damage #4: Door - front right side: Door - dent(s) - Smooth repair work




Damage #4: Door - front right side: Door - dent(s) - Smooth repair work



Damage #5: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage #5: Bonnet: Bonnet - dent(s) - Smooth repair work

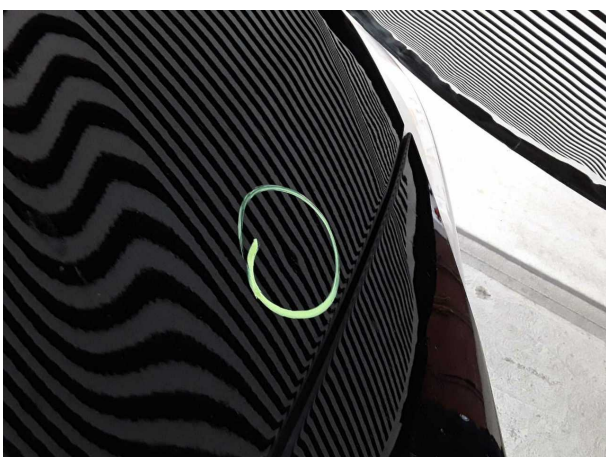

Damage #5: Bonnet: Bonnet - dent(s) - Smooth repair work




Damage #6: Braking system: Brake discs and pads - rear (Laut Anzeige) - Worn - Replace



Damage #7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage #7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

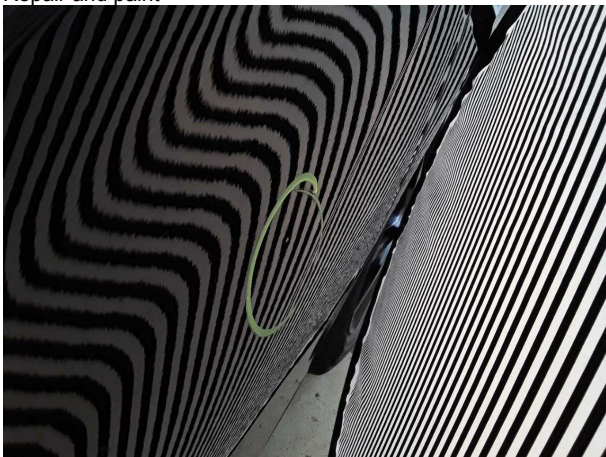

Damage #7: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint