



WBA5Y11080FL27243

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	75,452 km
Manufacturer	BMW	Next maintenance in	29,000 km
Type / Model	330d xDrive	Main inspection (Report on hand)	05/2026
Vehicle Identification number	WBA5Y11080FL27243	Power / Engine displacement	210 kW / 2,993 ccm
First registration	17 May 2021	Upholstery/Colour	/
Last maintenance	03/2025, 73,454 km	Paintwork	
Fuel type		Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 tyre - Damaged - No deduction
2	Door - front left side	Brightware - upper - Damaged - Replace
3	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
4	Interior	Interior - Soiled - Clean
5	2nd wheel set	3 alloy rims - Scratched - Loss in value
6	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
7	Rear bumper	Rear bumper - Scratched - Repair and paint
8	Braking system	Brake discs and brake pads - front - Due - Replace
9	Door - rear left side	Door - Scratch(es) - Repair and paint
10	Front bumper	Front bumper - Scratched - Repair and paint
11	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
12	Door - front left side	Door - Dent / paintcoat damage - Replace

Wear and tear

No.	Component group	Description
1	Body	Body (Steinschläge) - Scratched - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 May 2025

Protocol number: 39594657

Delivery date: 7 May 2025



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R18 95Y	Michelin	Summer tyres	5mm - 5mm	o.k.	
2	255/40 R18 99Y	Michelin	Summer tyres	5mm - 5mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R18 95V	Pirelli	Winter tyres	4mm - 4mm	o.k.	
2	225/45 R18 95V	Pirelli	Winter tyres	4mm - 4mm	Not o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 May 2025
Protocol number: 39594657
Delivery date: 7 May 2025



Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	330d xDrive	Mileage (Read)	75,452 km
Vehicle Identification number	WBA5Y11080FL27243	First registration	17 May 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior

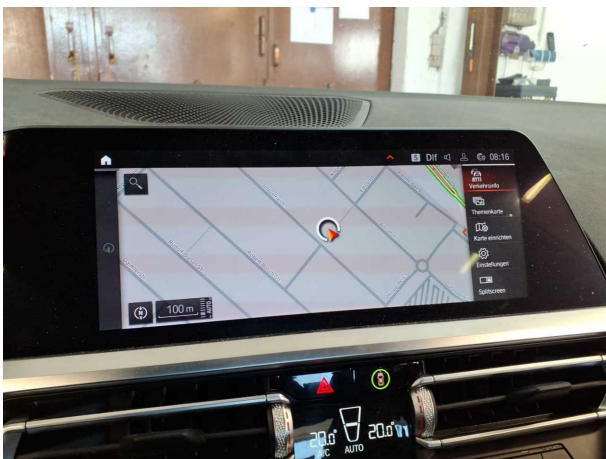


Figure 9: Interior



Figure 10: Misc.

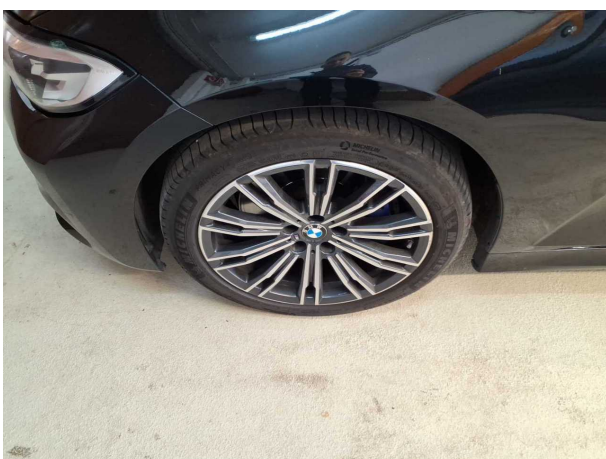


Figure 11: Misc.

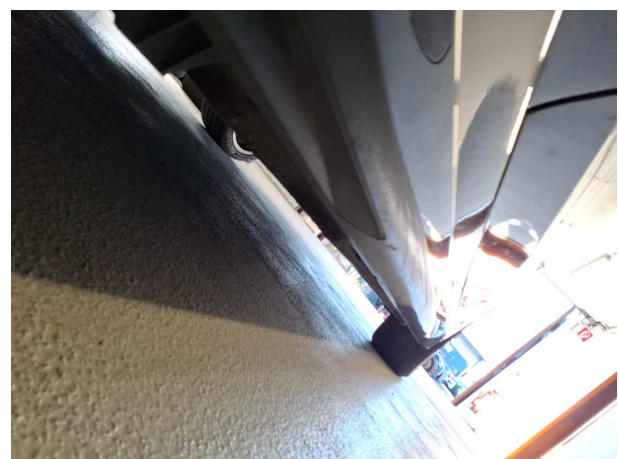


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.

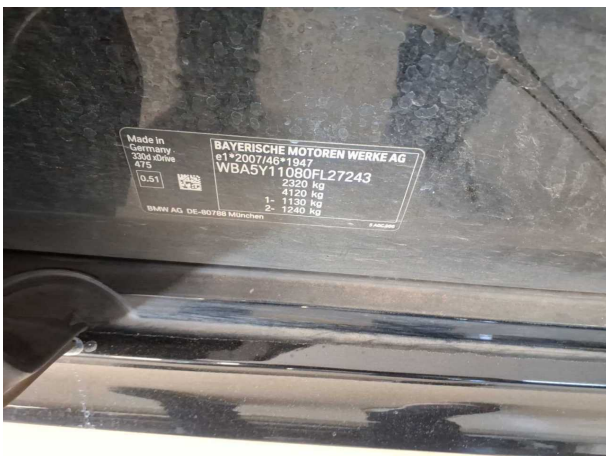


Figure 15: Misc.

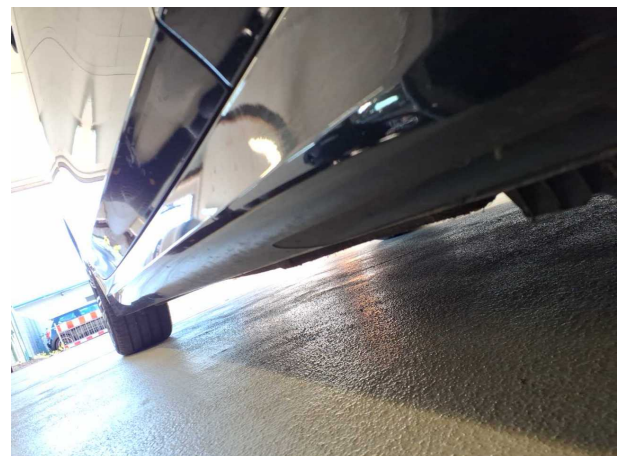


Figure 16: Misc.



Figure 17: Misc.

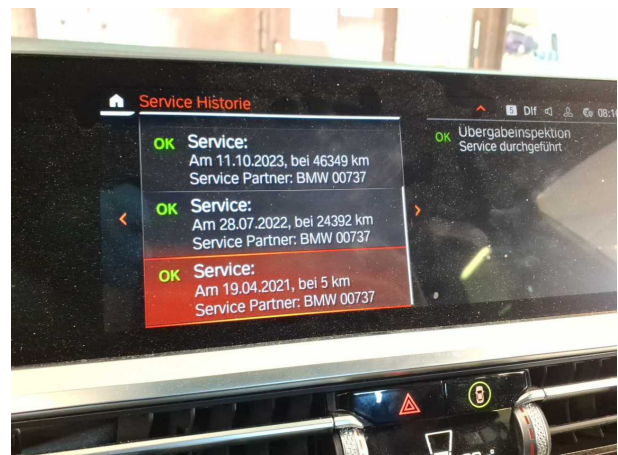


Figure 18: Misc.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 7 May 2025
Protocol number: 39594657
Delivery date: 7 May 2025

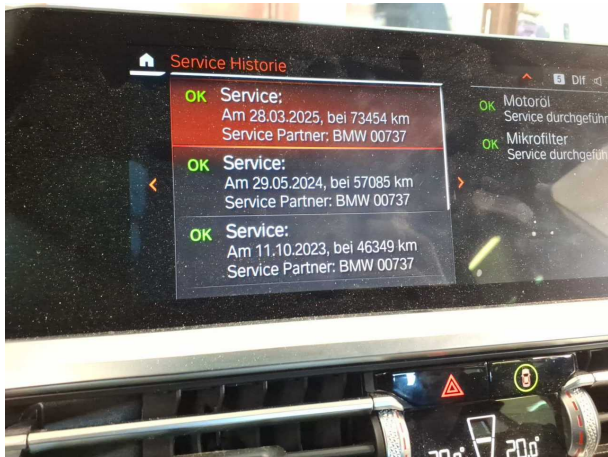


Figure 19: Misc.

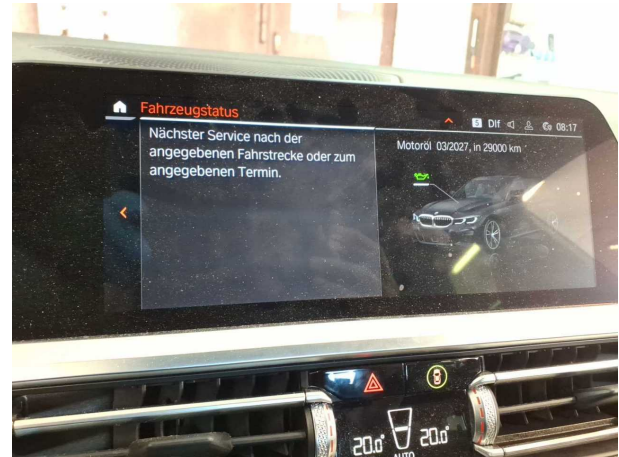


Figure 20: Misc.

Pictures of damage




Damage #1: 2nd wheel set: 1 tyre - Damaged - No deduction




Damage #2: Door - front left side: Brightware - upper - Damaged - Replace




Damage #3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

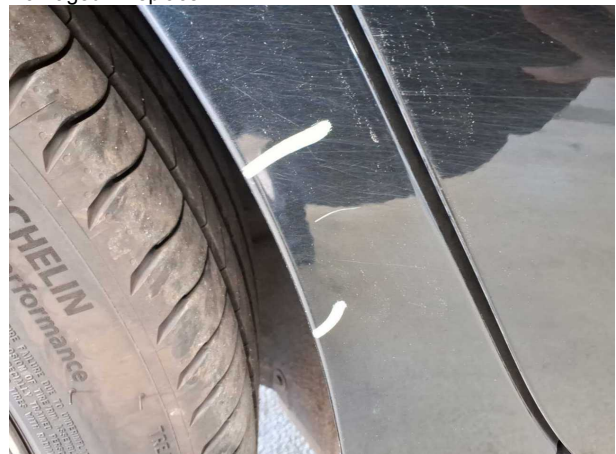

Damage #3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

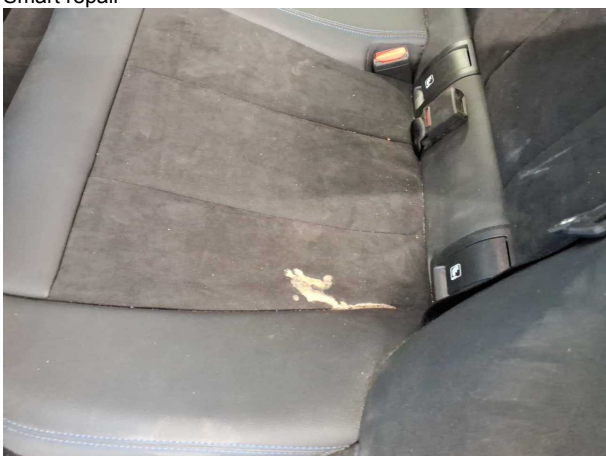


Damage #4: Interior: Interior - Soiled - Clean

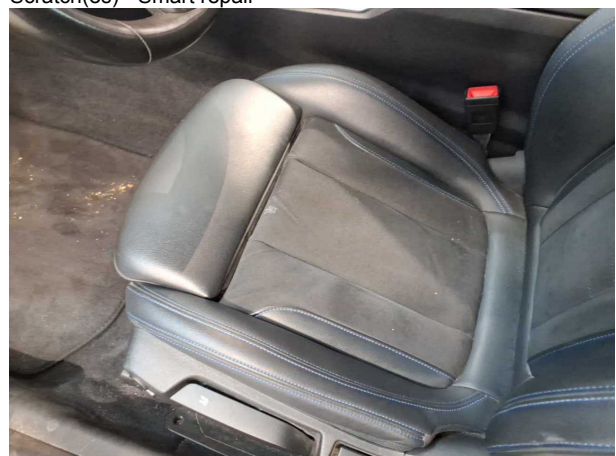

Damage #4: Interior: Interior - Soiled - Clean



Damage #5: 2nd wheel set: 3 alloy rims - Scratched - Loss in value

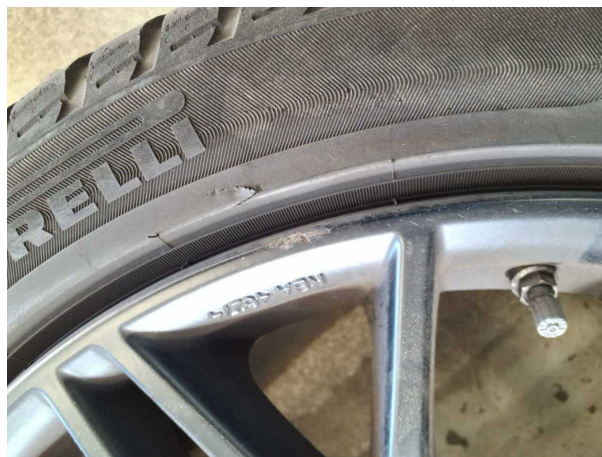

Damage #5: 2nd wheel set: 3 alloy rims - Scratched - Loss in value




Damage #5: 2nd wheel set: 3 alloy rims - Scratched - Loss in value



Damage #6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage #6: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

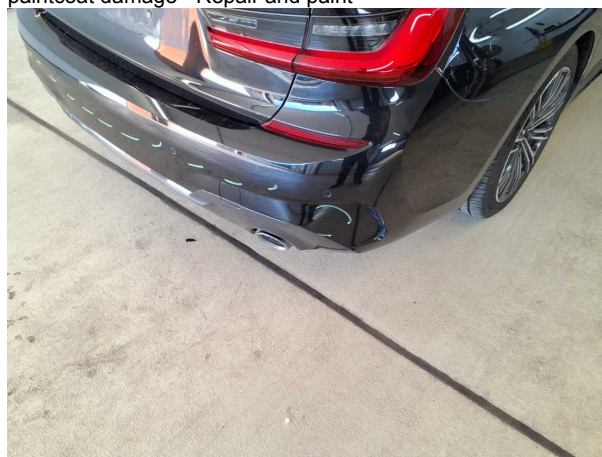

Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint

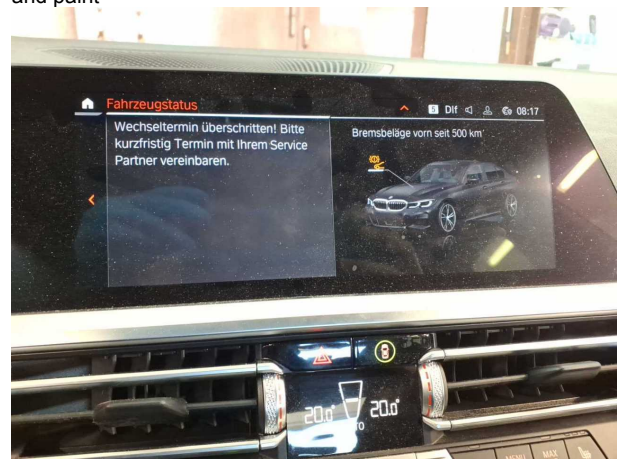

Damage #8: Braking system: Brake discs and brake pads - front - Due - Replace

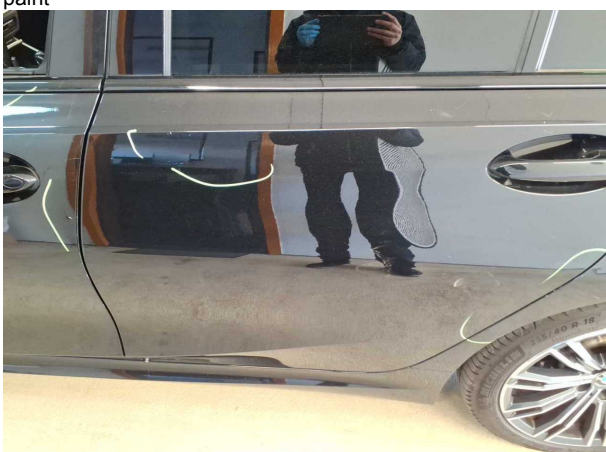


Damage #9: Door - rear left side: Door - Scratch(es) - Repair and paint




Damage #9: Door - rear left side: Door - Scratch(es) - Repair and paint




Damage #10: Front bumper: Front bumper - Scratched - Repair and paint

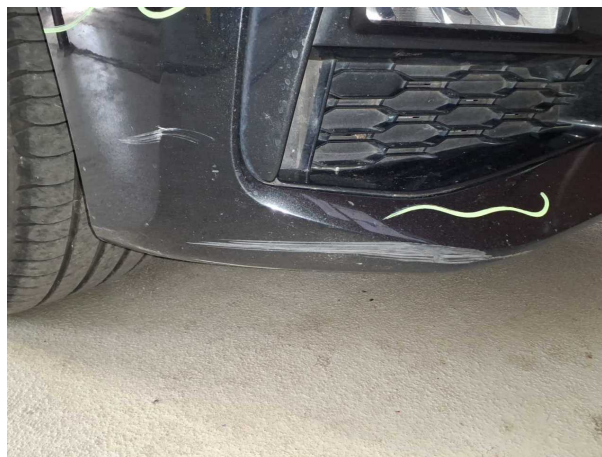


Damage #10: Front bumper: Front bumper - Scratched - Rep... and paint

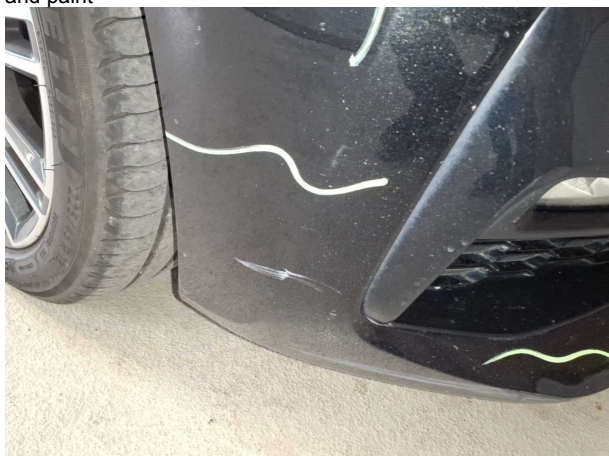

Damage #10: Front bumper: Front bumper - Scratched - Repair and paint

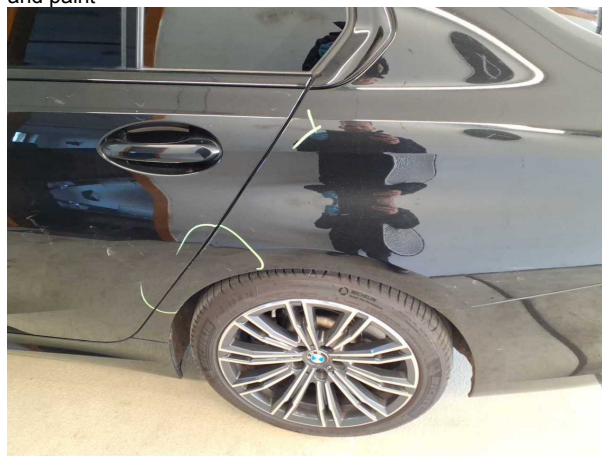

Damage #11: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

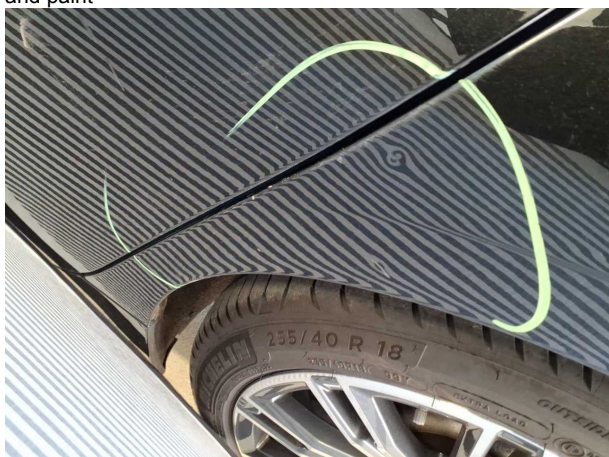

Damage #11: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #11: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #11: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage #12: Door - front left side: Door - Dent / paintcoat damage - Replace



Damage #12: Door - front left side: Door - Dent / paintcoat damage - Replace



Damage #12: Door - front left side: Door - Dent / paintcoat damage - Replace