



**WAUZZZGE9MB031127**

## Vehicle details

|                               |                   |                                 |            |
|-------------------------------|-------------------|---------------------------------|------------|
| Operator                      |                   | Inspection condition            | Sufficient |
| License number                |                   | Mileage (Read)                  | 84,539 km  |
| Manufacturer                  | Audi              | Next maintenance in             | 5,500 km   |
| Type / Model                  | e-tron 55         | Main inspection (Read from ZBI) | 04/2026    |
| Vehicle Identification number | WAUZZZGE9MB031127 | Power / Engine displacement     | 158 kW     |
| First registration            | 6 Apr 2021        | Upholstery/Colour               | /          |
| Last maintenance              |                   | Paintwork                       |            |
| Fuel type                     | Electric          | Gearbox                         | Automatic  |

## Zustandsbericht

### Value reducing factors

| No. | Component group             | Description                              |
|-----|-----------------------------|------------------------------------------|
| 1   | Rear bumper                 | Rear bumper - Scratched - Cover / polish |
| 2   | Side panel - rear left side | Sill - dent(s) - Smooth repair work      |
| 3   | Wing mirror - left side     | Cap - Scratched - Paint                  |
| 4   | Side panel - rear left side | Side panel - Scratched - Paint           |

### Wear and tear

| No. | Component group       | Description                             |
|-----|-----------------------|-----------------------------------------|
| 1   | Body                  | Body - Scratch(es) - No deduction       |
| 2   | Interior              | Interior - Abrasion - No deduction      |
| 3   | Vehicle glazing       | Windscreen - Stone chips - No deduction |
| 4   | Door - rear left side | Door - dent(s) - No deduction           |

### Missing parts

| Missing part |
|--------------|
|--------------|

### Detected repainting

| No. | Location                           |
|-----|------------------------------------|
| 1   | Bonnet, Professionally carried out |

### Main tyres

| Axle | Tyre size       | Manufacturer | Type of tyre | Tread depth | Roadworthy | Permissibility |
|------|-----------------|--------------|--------------|-------------|------------|----------------|
| 1    | 255/55 R19 111H | Pirelli      | Winter tyres | 7mm - 7mm   | o.k.       |                |
| 2    | 255/55 R19 111H | Pirelli      | Winter tyres | 7mm - 7mm   | o.k.       |                |

**TÜV SÜD Auto Partner GmbH**  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

**Inspection location**  
Allane Mobility Consulting  
GmbH  
69190 Walldorf

Inspection date: 30 Apr 2025  
**Protocol number:** 39534226  
Delivery date: 30 Apr 2025



## Additional tyres

| Axle | Tyre size       | Manufacturer | Type of tyre | Tread depth | Roadworthy | Permissibility |
|------|-----------------|--------------|--------------|-------------|------------|----------------|
| 1    | 255/55 R19 111V | Bridgestone  | Summer tyres | 6mm - 6mm   | o.k.       |                |
| 2    | 255/55 R19 111V | Bridgestone  | Summer tyres | 7mm - 7mm   | o.k.       |                |

The wear and tear condition and possible damages to the tyres are considered in the value.

## Comments

Keine Gewähr auf Vollständigkeit und  
Richtigkeit der angezeigten Ausstattung.  
Techn. Änderungen vorbehalten  
Das Fahrzeug weist dem Alter, der Laufleistung und dem  
Einsatzzweck entsprechende Gebrauchsspuren auf.  
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, N.i.O

**TÜV SÜD Auto Partner GmbH**  
Gutenbergstr. 13  
70771 Leinfelden-Echterdingen

**Inspection location**  
Allane Mobility Consulting  
GmbH  
69190 Walldorf

Inspection date: 30 Apr 2025  
**Protocol number:** 39534226  
Delivery date: 30 Apr 2025



## Vehicle details

|                                      |                   |                             |            |
|--------------------------------------|-------------------|-----------------------------|------------|
| <b>Manufacturer</b>                  | Audi              | <b>Inspection condition</b> | Sufficient |
| <b>Type / Model</b>                  | e-tron 55         | <b>Mileage (Read)</b>       | 84,539 km  |
| <b>Vehicle Identification number</b> | WAUZZZGE9MB031127 | <b>First registration</b>   | 6 Apr 2021 |

**Vehicle identification:**

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

**Inspection conditions:**

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report.

**General condition:**

The vehicle shows traces of wear and tear corresponding to its age and purpose

## Overview pictures



**Figure 1:** Diagonal front



**Figure 2:** Diagonal front



**Figure 3:** Diagonal rear



**Figure 4:** Diagonal rear



**Figure 5:** Interior



**Figure 6:** Interior





Figure 7: Interior

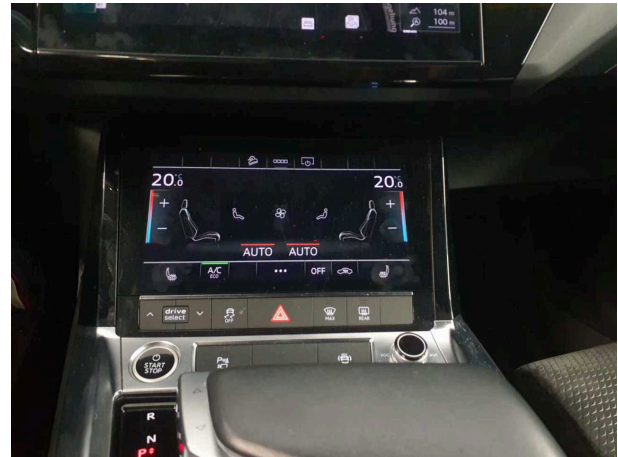


Figure 8: Interior

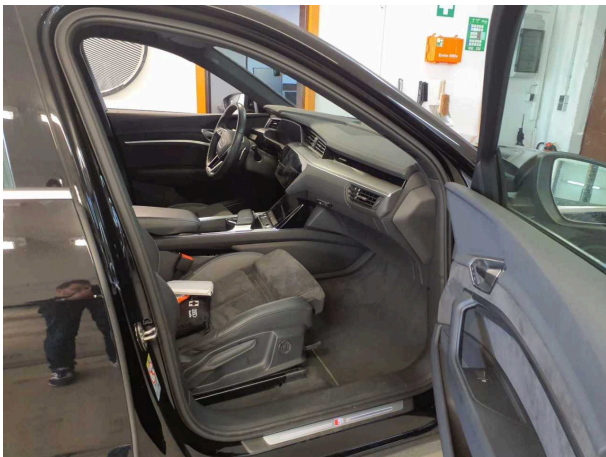


Figure 9: Interior



Figure 10: Misc.

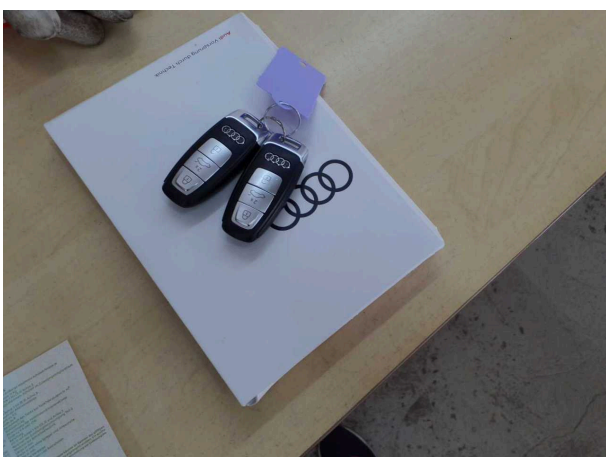


Figure 11: Misc.

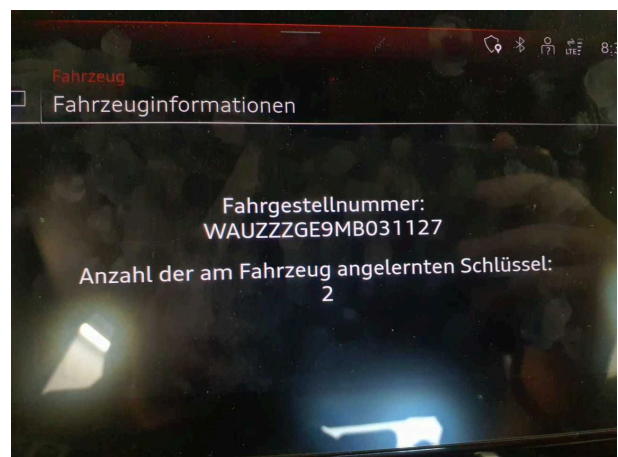


Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.

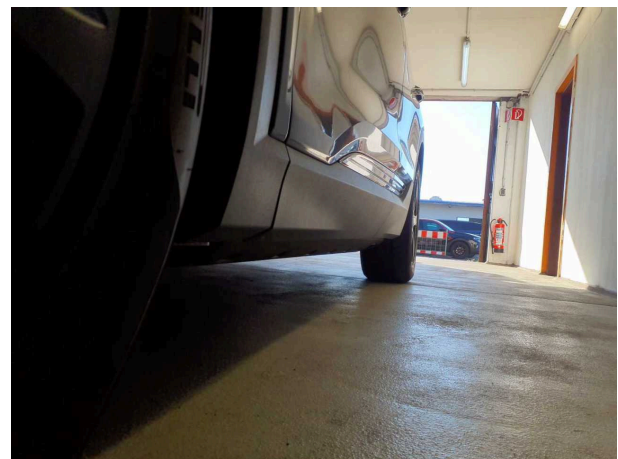


Figure 16: Misc.

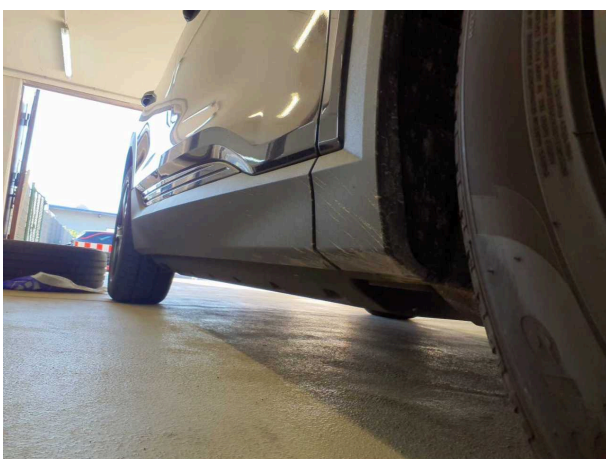


Figure 17: Misc.



Figure 18: Misc.



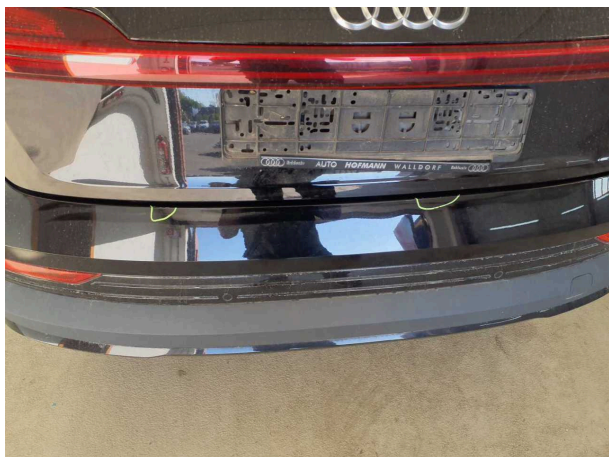


**Figure 19:** Misc.



**Figure 20:** Misc.

## Pictures of damage




**Damage #1:** Rear bumper: Rear bumper - Scratched - Cover / polish




**Damage #1:** Rear bumper: Rear bumper - Scratched - Cover / polish



**Damage #1:** Rear bumper: Rear bumper - Scratched - Cover / polish

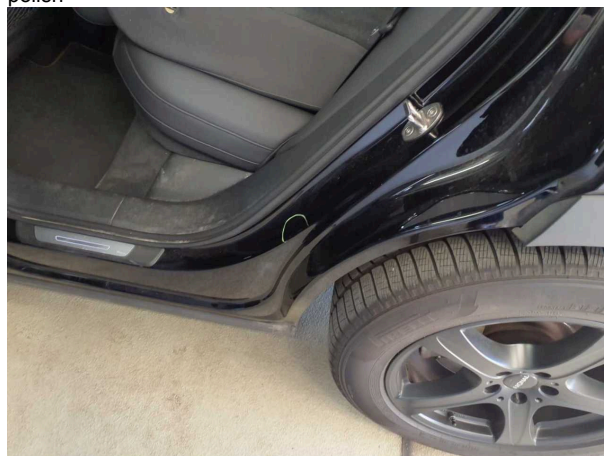

**Damage #2:** Side panel - rear left side: Sill - dent(s) - Smooth repair work

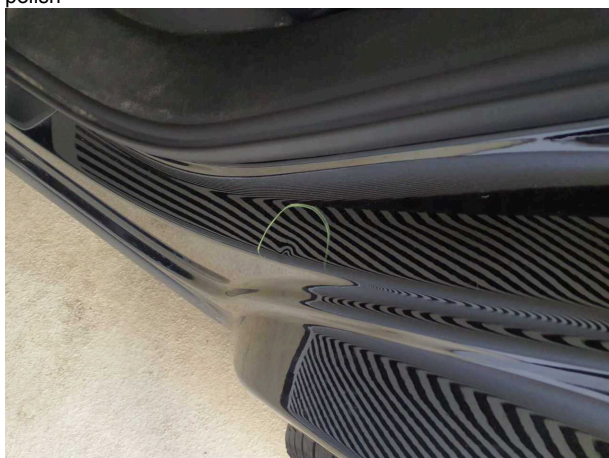

**Damage #2:** Side panel - rear left side: Sill - dent(s) - Smooth repair work



**Damage #3:** Wing mirror - left side: Cap - Scratched - Paint





**Damage #3:** Wing mirror - left side: Cap - Scratched - Paint



**Damage #4:** Side panel - rear left side: Side panel - Scratched - Paint



**Damage #4:** Side panel - rear left side: Side panel - Scratched - Paint