



WBA6N71070FL31039

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	84,687 km
Manufacturer	BMW	Next maintenance in	15,000 km
Type / Model	330e xDrive	Main inspection (Report not on hand)	05/2026
Vehicle Identification number	WBA6N71070FL31039	Power / Engine displacement	135 kW / 1,998 ccm
First registration	18 May 2021	Upholstery/Colour	/
Last maintenance	09/2024, 65,890 km	Paintwork	
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	2nd wheel set	2 tyres (innen abgefahren) - Worn - No deduction
2	2nd wheel set	2 alloy rims - Scratched - No deduction
3	Side panel - rear right side	Side panel - Scratch(es) - Cover / polish
4	Documents	Main inspection certificate (Fehlt) - Replace
5	Wing mirror - right side	Cap - Scratched - Smart repair
6	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
7	Measurement	Undercarriage - Malposition - Set / adjust
8	Trim / covers	Door trim - rear left side - Damaged - Replace
9	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Body	Body (Steinschläge) - Scratch(es) - No deduction
3	Interior	Interior - Abrasion - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 13 May 2025

Protocol number: 39676458

Delivery date: 13 May 2025



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/40 R19 93Y	Pirelli	Summer tyres	4mm - 4mm	o.k.	
2	255/35 R19 96Y	Pirelli	Summer tyres	6mm - 6mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/45 R18 95V	Pirelli	Winter tyres	5mm - 5mm	o.k.	
2	225/45 R18 95V	Pirelli	Winter tyres	3mm - 3mm	Not o.k.	

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten

Das Fahrzeug weist dem Alter, der Laufleistung und dem

Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 13 May 2025

Protocol number: 39676458

Delivery date: 13 May 2025



Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	330e xDrive	Mileage (Read)	84,687 km
Vehicle Identification number	WBA6N71070FL31039	First registration	18 May 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.



Figure 11: Misc.



Figure 12: Misc.



Figure 13: Misc.



Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.

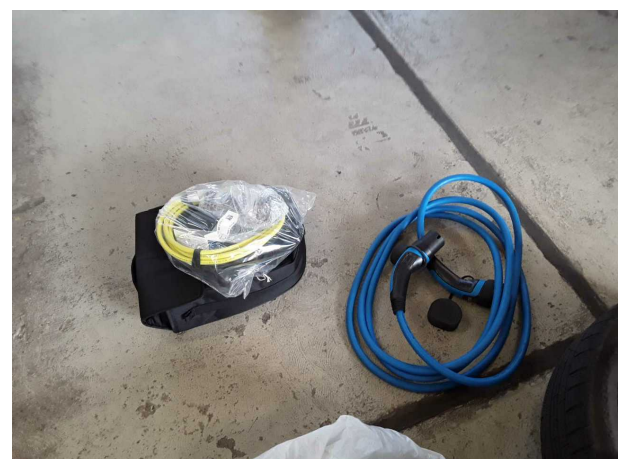


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

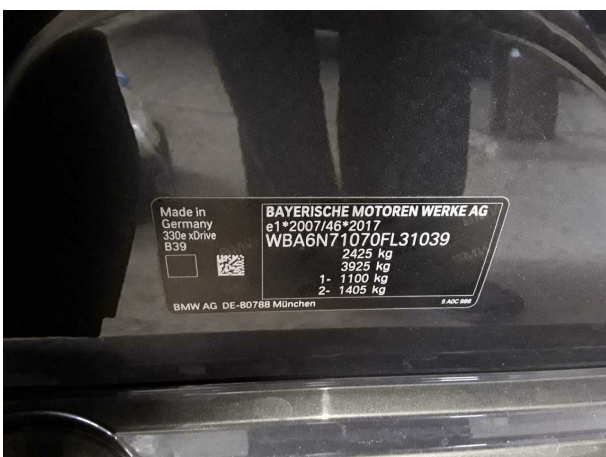


Figure 23: Misc.

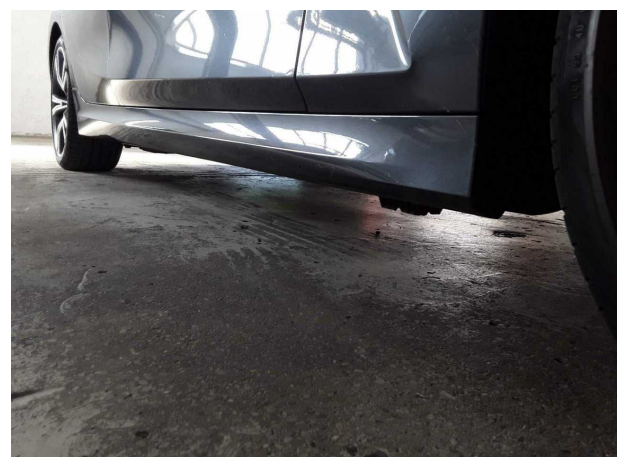


Figure 24: Misc.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Allane Mobility Consulting
GmbH

69190 Walldorf

Inspection date: 13 May 2025

Protocol number: 39676458

Delivery date: 13 May 2025

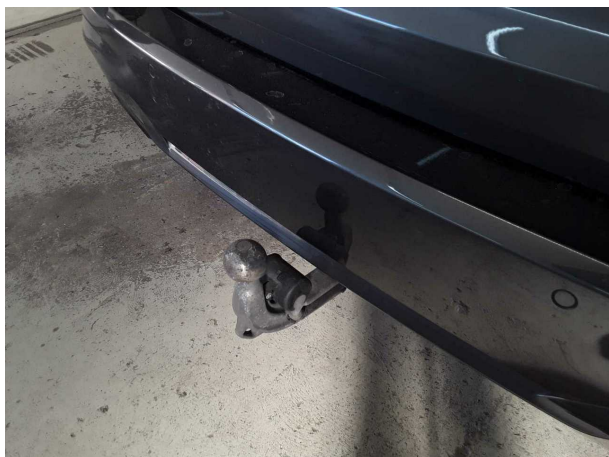


Figure 25: Misc.

Pictures of damage



Damage #1: 2nd wheel set: 2 tyres (innen abgefahren) - Worn - No deduction



Damage #2: 2nd wheel set: 2 alloy rims - Scratched - No deduction




Damage #2: 2nd wheel set: 2 alloy rims - Scratched - No deduction



Damage #2: 2nd wheel set: 2 alloy rims - Scratched - No deduction



Damage #2: 2nd wheel set: 2 alloy rims - Scratched - No deduction

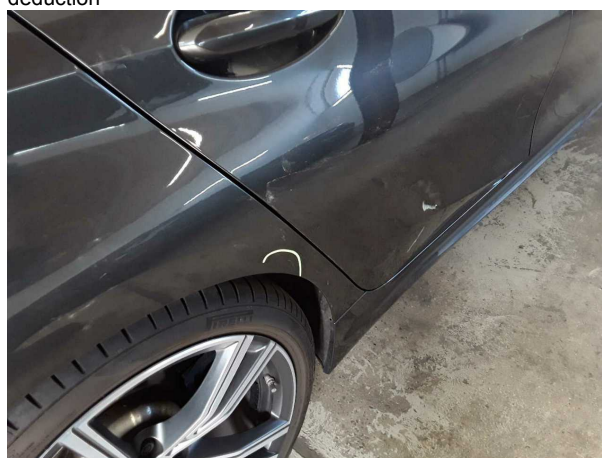

Damage #3: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Damage #3: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Damage #5: Wing mirror - right side: Cap - Scratched - Smart repair




Damage #6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage #6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage #8: Trim / covers: Door trim - rear left side - Damaged - Replace

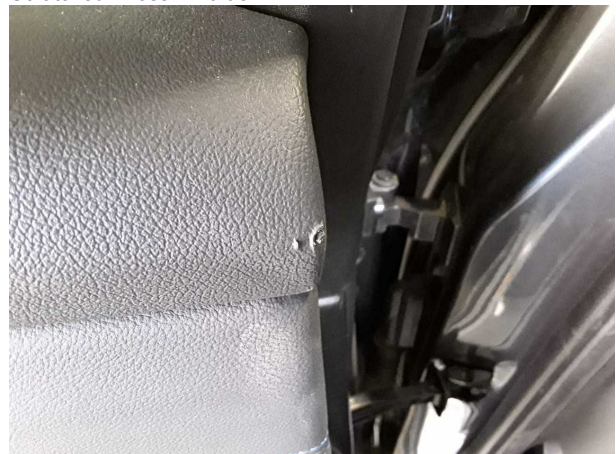

Damage #8: Trim / covers: Door trim - rear left side - Damaged - Replace



Damage #9: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

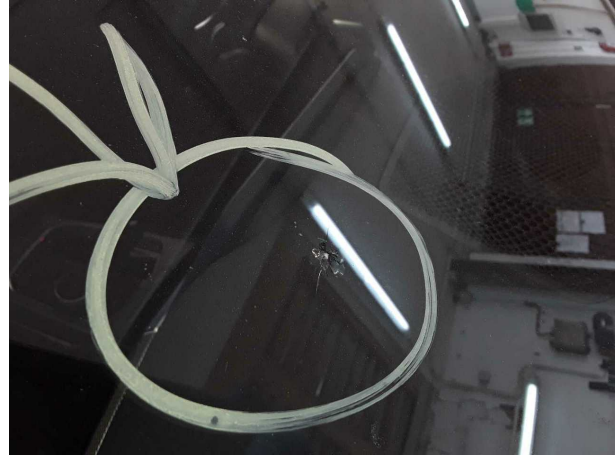

Damage #9: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace