

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Kfz-Natzius GmbH, Partner
TÜV SÜD
Carl-Hopp-Straße 4 B
18069 Rostock

Inspection date: 20 Dec 2024
Protocol number: 37692973
Created by: Gerd Bierschenk
Inspected by: Marcel Herrmann



WAUZZZF21MN035601

Vehicle details

Operator	Vertrags-Nummer: 23027075	Inspection condition	Sufficient
License number		Mileage (Read)	90,636 km
Manufacturer	Audi	Next maintenance in	8,400 km
Type / Model	A6 Avant 55 TFSI e	Main inspection (Read from ZBI)	02/2026
Vehicle Identification number	WAUZZZF21MN035601	Power / Engine displacement	185 kW / 1,984 ccm
First registration	5 Jan 2021	Upholstery/Colour	Alcantara / Leather / Black
Last maintenance	11/2024, 89,593 km	Paintwork	Blue
Fuel type	Hybr.B/E ext. edition	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lining (Abdeckung 12 Volt) - Missing - Replace
2	Side panel - rear right side	Side panel - Dent(s) - Smooth repair work
3	Sill - left side	Sill - Scratched - Smart repair
4	Side panel - rear left side	Sill - Scratch(es) - Smart repair
5	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
6	Vehicle glazing	Windscreen (Steinschlag) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Scratch(es) - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R18 102V XL	Bridgestone	Winter tyres	6mm - 6mm	o.k.	o.k.
2	225/55 R18 102V XL	Bridgestone	Winter tyres	7mm - 7mm	o.k.	o.k.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Kfz-Natzius GmbH, Partner
TÜV SÜD
Carl-Hopp-Straße 4 B
18069 Rostock

Inspection date: 20 Dec 2024
Protocol number: **37692973**
Created by: Gerd Bierschenk
Inspected by: Marcel Herrmann



Auto Plus

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	255/40 R20 101Y XL	Continental	Summer tyres	4mm - 4mm	o.k.	o.k.
2	255/40 R20 101Y XL	Continental	Summer tyres	5mm - 5mm	o.k.	o.k.

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					01/2026

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

- Winterradsatz kein Bestandteil des Auslieferungsumfanges.

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Kfz-Natzius GmbH, Partner
TÜV SÜD
Carl-Hopp-Straße 4 B
18069 Rostock

Inspection date: 20 Dec 2024
Protocol number: 37692973
Created by: Gerd Bierschenk
Inspected by: Marcel Herrmann



Auto Plus

Vehicle details

Manufacturer	Audi	Inspection condition	Sufficient
Type / Model	A6 Avant 55 TFSI e	Mileage (Read)	90,636 km
Vehicle Identification number	WAUZZZF21MN035601	First registration	5 Jan 2021

Vehicle identification:

The vehicle identification number (VIN) was read and its conformity with the documents submitted was verified during the inspection by the undersigned.

Inspection conditions:

The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions that can be reproduced using the photo system included in the report.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

A handwritten signature in blue ink, appearing to read 'Gerd Bierschenk'.

Expert's signature (Gerd Bierschenk)

The current printed copy was produced by electronic means. The named technical expert states that the content correctly represents his or her findings. It is valid without an original signature.

Overview pictures



Figure 1: VIN



Figure 2: Diagonal front



Figure 3: Diagonal front



Figure 4: Diagonal rear

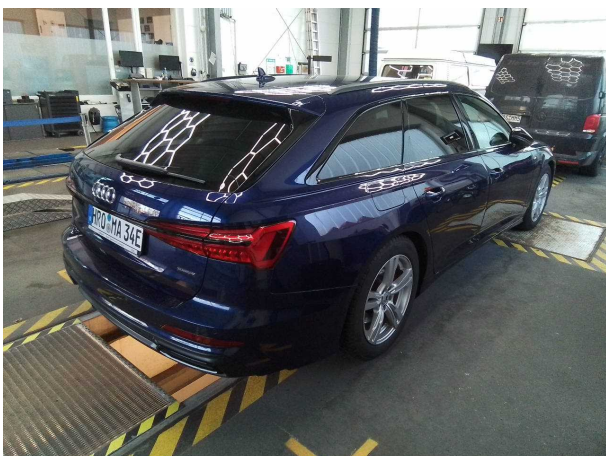


Figure 5: Diagonal rear



Figure 6: Mounted tyres

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Kfz-Natzius GmbH, Partner
TÜV SÜD
Carl-Hopp-Straße 4 B
18069 Rostock

Inspection date: 20 Dec 2024
Protocol number: 37692973
Created by: Gerd Bierschenk
Inspected by: Marcel Herrmann

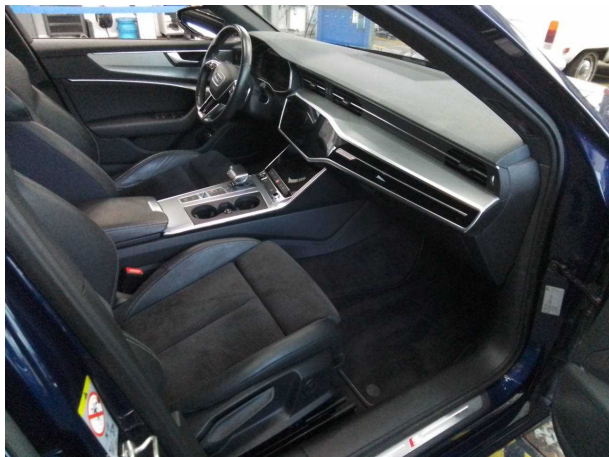


Figure 7: Interior - front

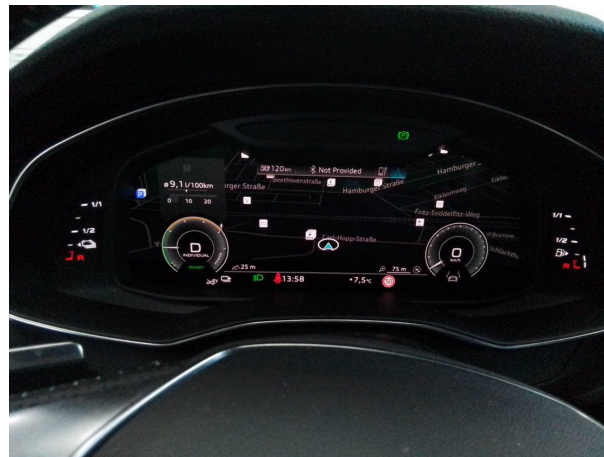


Figure 8: Instrument cluster



Figure 9: Instrument cluster



Figure 10: Instrument panel

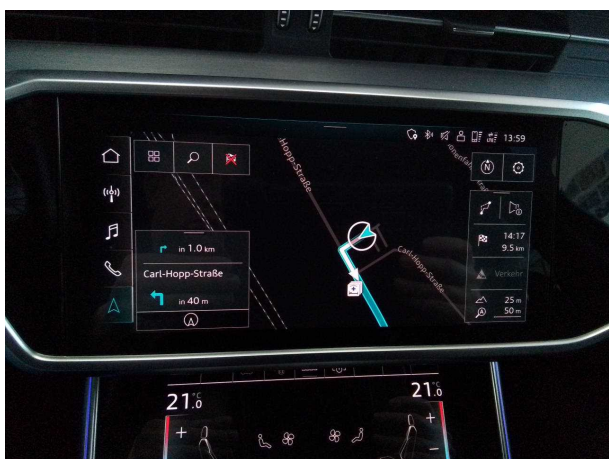


Figure 11: Instrument panel

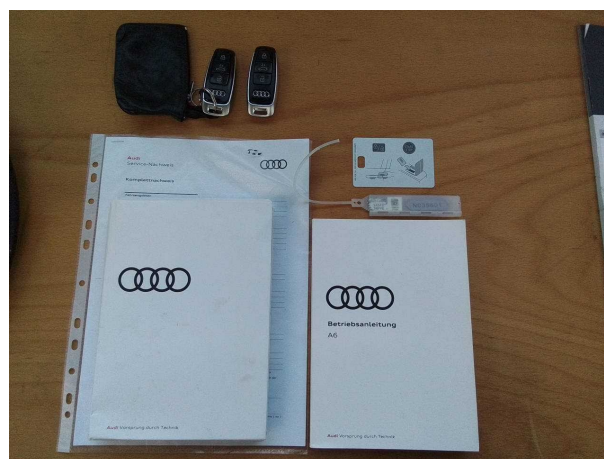


Figure 12: Documents

TÜV SÜD Auto Plus GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
Kfz-Natzius GmbH, Partner
TÜV SÜD
Carl-Hopp-Straße 4 B
18069 Rostock

Inspection date: 20 Dec 2024
Protocol number: **37692973**
Created by: Gerd Bierschenk
Inspected by: Marcel Herrmann



Auto Plus

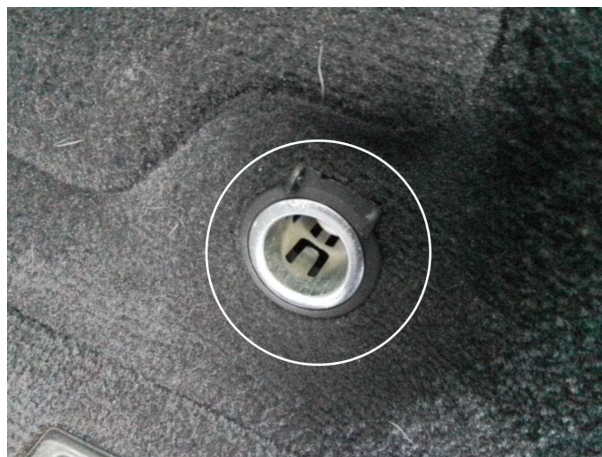


Figure 13: Additional tyres


Pictures of damage




Damage #1: Trim / covers: Boot lining (Abdeckung 12 Volt) - Missing - Replace



Damage #1: Trim / covers: Boot lining (Abdeckung 12 Volt) - Missing - Replace

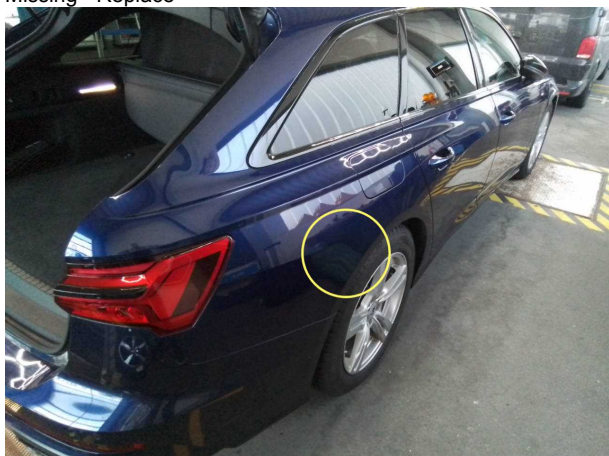

Damage #2: Side panel - rear right side: Side panel - Dent(s) - Smooth repair work

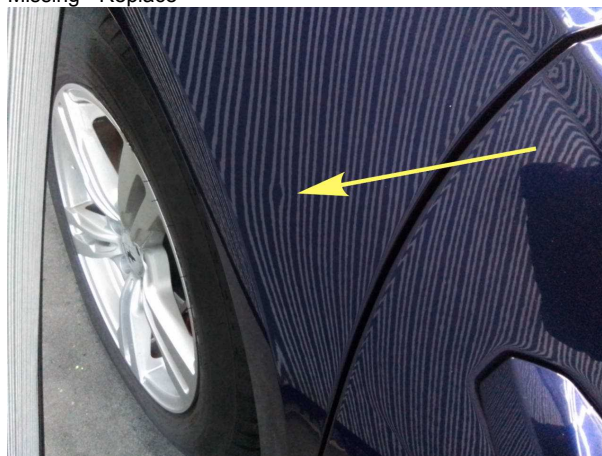


Damage #2: Side panel - rear right side: Side panel - Dent(s) - Smooth repair work



Damage #3: Sill - left side: Sill - Scratched - Smart repair




Damage #3: Sill - left side: Sill - Scratched - Smart repair

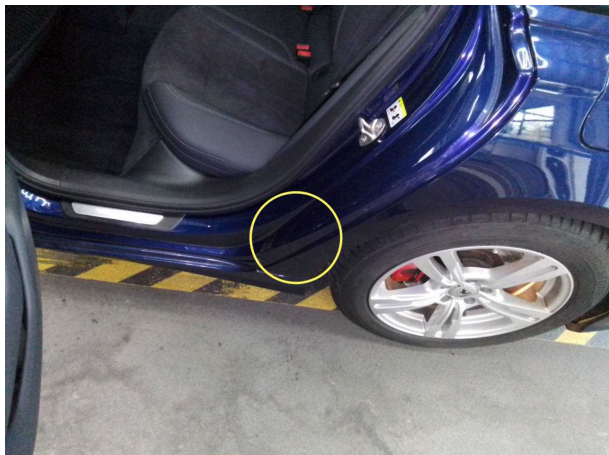


Damage #4: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage #4: Side panel - rear left side: Sill - Scratch(es) - Smart repair

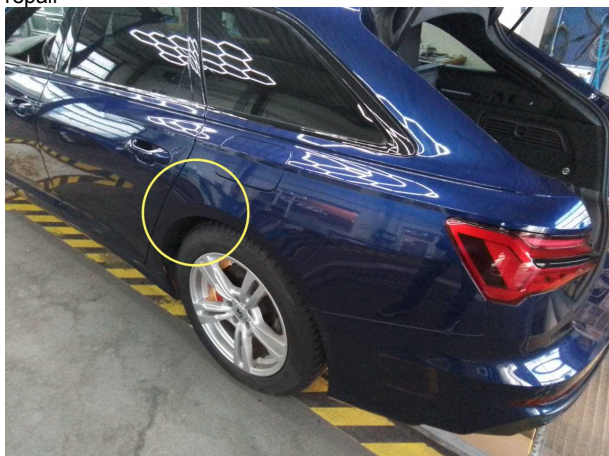


Damage #5: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

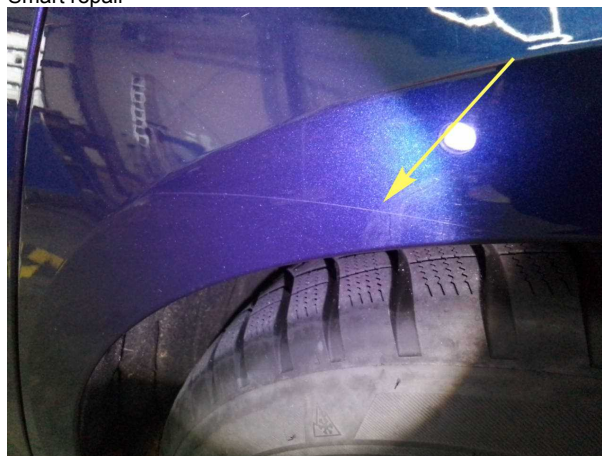

Damage #5: Side panel - rear left side: Side panel - Scratch(...) - Smart repair



Damage #6: Vehicle glazing: Windscreen (Steinschlag) - Broken / torn - Replace

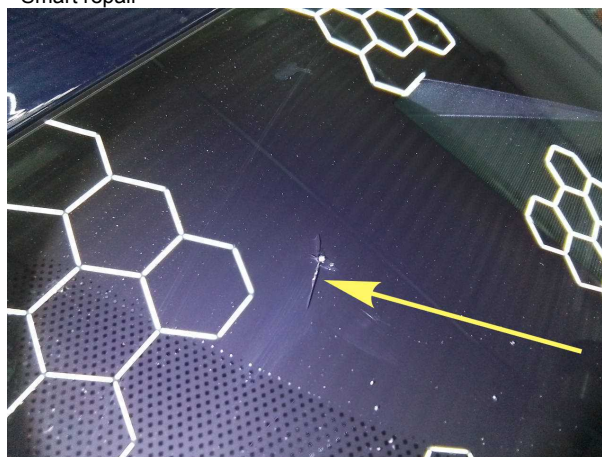

Damage #6: Vehicle glazing: Windscreen (Steinschlag) - Broken / torn - Replace