



WAUZZZF32N1117452

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	104,051 km
Manufacturer	Audi	Next maintenance in	9,600 km
Type / Model	Q3	Main inspection (Taken from ZBI)	05/2025
Vehicle Identification number	WAUZZZF32N1117452	Power / Engine displacement	110 kW / 1,968 ccm
First registration	11 May 2022	Upholstery/Colour	/
Last maintenance	03/2025, 100,220 km	Paintwork	
Fuel type	Diesel	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Documents	Service book (Wartungsnachweise fehlen) - No deduction
2	Screen cleaning	Wiper arm - rear - Damaged - Replace
3	Misc.	Main inspection - Due - Replace
4	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
5	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
6	Rear bumper	Spoiler - Damaged - Replace
7	Rear bumper	Rear bumper - Scratched - Repair and paint
8	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body (Steinschläge) - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction
3	Side panel - rear left side	Wheel well extension - Scratched - No deduction
4	Side panel - rear right side	Wheel well extension - Scratched - No deduction
5	Vehicle glazing	Windscreen - Stone chips - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	215/65 R17 99V	Goodyear	Winter tyres	5mm - 5mm	o.k.	
2	215/65 R17 99V	Goodyear	Winter tyres	8mm - 8mm	o.k.	

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	215/65 R17 99V	Goodyear	Summer tyres	7mm - 7mm	o.k.	
2	215/65 R17 99V	Hankook	Summer tyres	5mm - 5mm	o.k.	

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					03/2026

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.
elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 22 May 2025
Protocol number: 39862419
Delivery date: 22 May 2025



Vehicle details

Manufacturer	Audi	Inspection condition	Sufficient
Type / Model	Q3	Mileage (Read)	104,051 km
Vehicle Identification number	WAUZZZF32N1117452	First registration	11 May 2022

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient for the assessment of the vehicle.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
SAP SE
Dietmar-Hopp-Allee 16
69190 Walldorf

Inspection date: 22 May 2025
Protocol number: 39862419
Delivery date: 22 May 2025

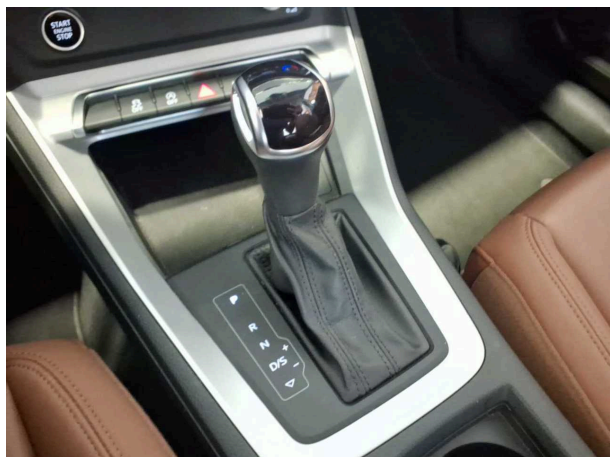


Figure 7: Interior



Figure 8: Interior



Figure 9: Interior



Figure 10: Misc.

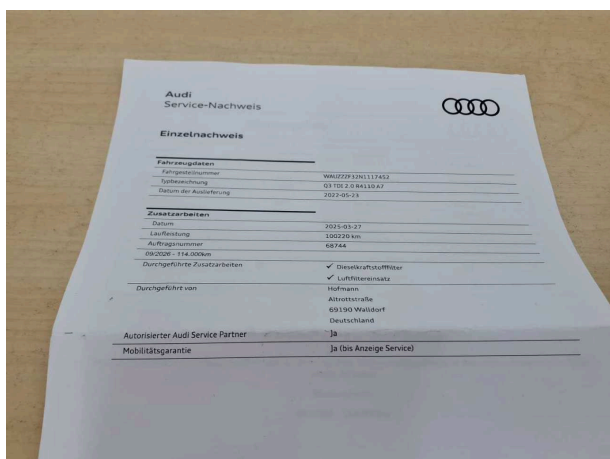


Figure 11: Misc.

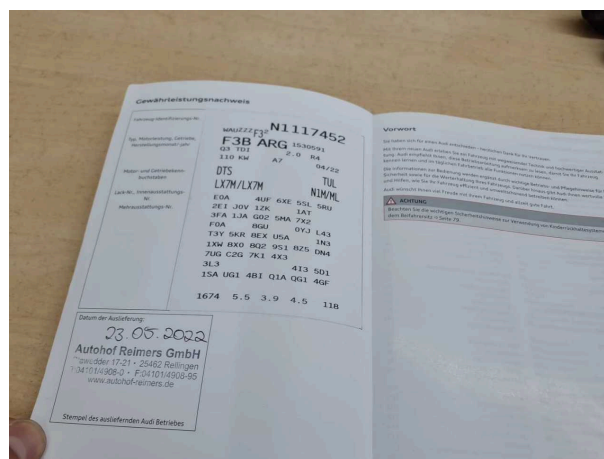


Figure 12: Misc.



Figure 13: Misc.

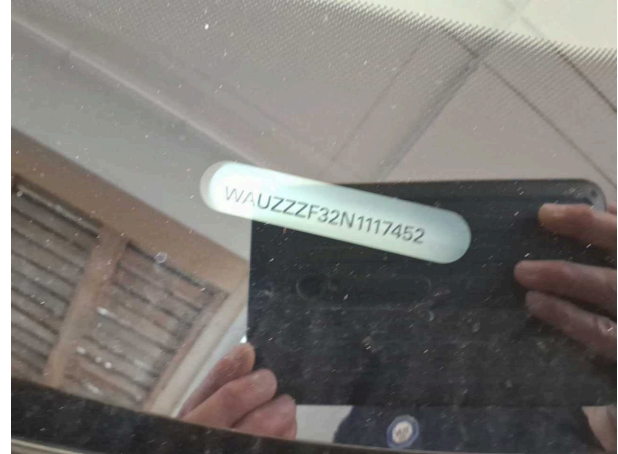


Figure 14: Misc.



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

Pictures of damage




Damage #2: Screen cleaning: Wiper arm - rear - Damaged - Replace




Damage #4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage #4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

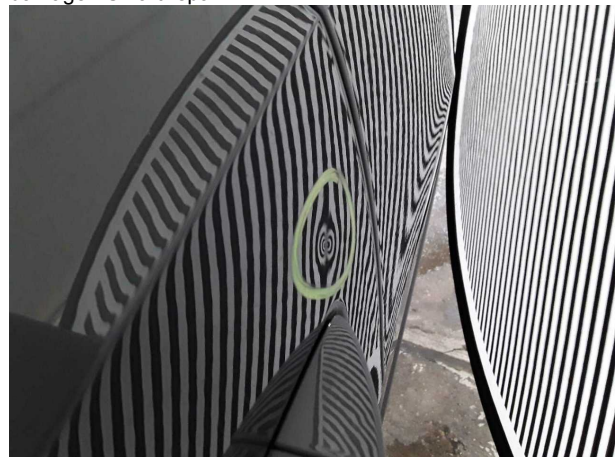

Damage #4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

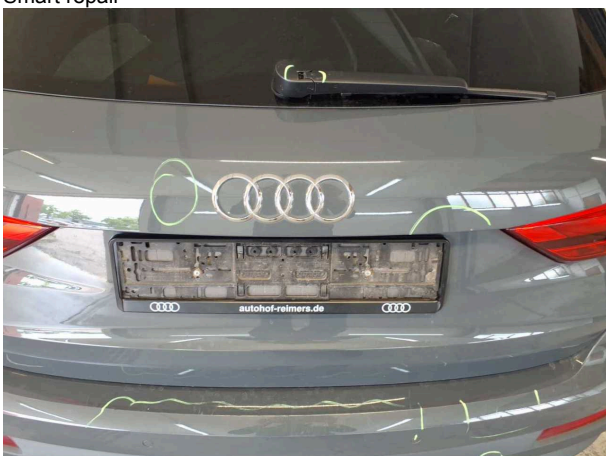

Damage #5: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair




Damage #5: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage #5: Boot lid / rear door: Boot lid - Dent / paintcoat damage
- Smart repair




Damage #6: Rear bumper: Spoiler - Damaged - Replace

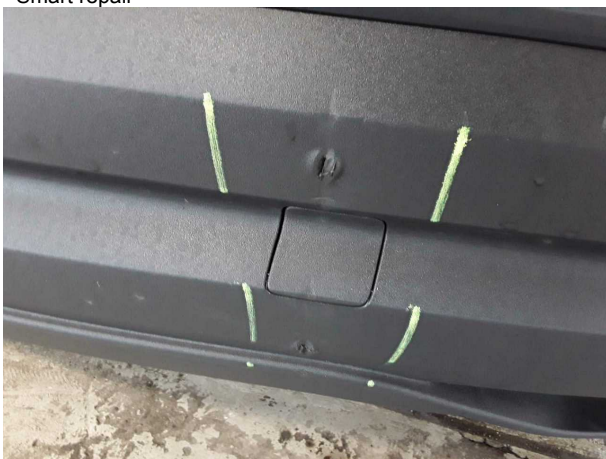

Damage #6: Rear bumper: Spoiler - Damaged - Replace



Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint

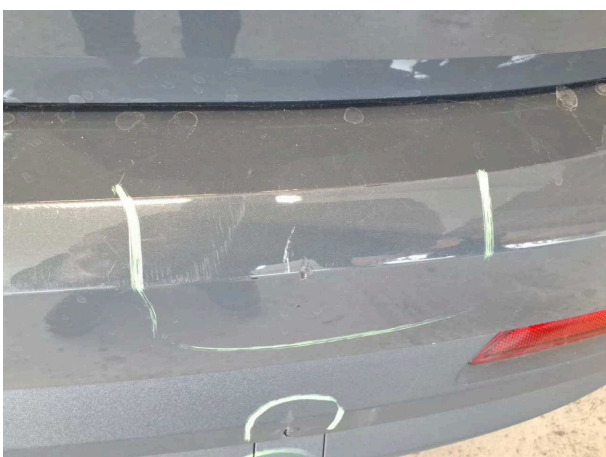

Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage #7: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

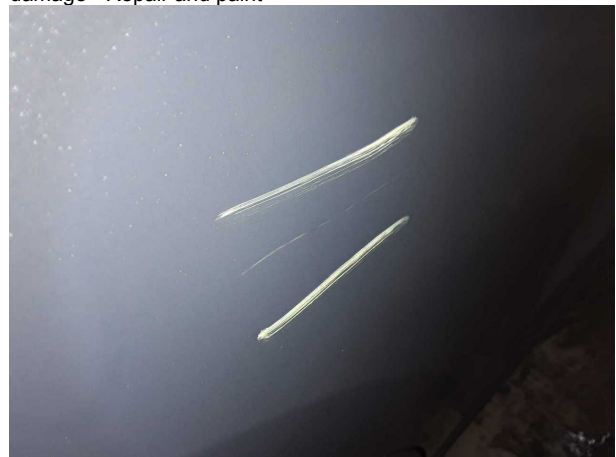

Damage #8: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage #8: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint