

WBA11AJ030CG64359

Vehicle details

Operator		Inspection condition	conditional: light/moisture/dirt
License number		Mileage (Read)	96,994 km
Manufacturer	BMW	Next maintenance in	-400 km
Type / Model	530d	Main inspection (Report not on hand)	02/2026
Vehicle Identification number	WBA11AJ030CG64359	Power / Engine displacement	210 kW / 2,993 ccm
First registration	25 Feb 2021	Upholstery/Colour	Cloth / Black
Last maintenance	10/2024, 81,307 km	Paintwork	Black
Fuel type	Hybrid Diesel / E	Gearbox	Automatic

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Sill - left side	Trim - Scratched - Smart repair
2	Sill - right side	Trim - Scratched - Smart repair
3	Side panel - rear left side	Sill - Scratched - Smart repair
4	Side panel - rear left side	Elbow - Scratched - Smart repair
5	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
6	Side panel - rear right side	Side panel - Scratched - Smart repair
7	Front bumper	Front bumper (unterhalb) - Scratched - Smart repair
8	Door - front left side	Door edge - Scratched - Smart repair
9	Documents	Main inspection certificate (fehlt) - Replace
10	Body	Door seal - front left side - Damaged - Replace
11	Boot lid / rear door	Trim - standard - lower - Scratched - Replace
12	Steering system	Steering wheel sheath - Scratched - Loss in value
13	Roof	Aerial - Damage caused by marten / rodent - Replace
14	Rear bumper	Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint
15	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
16	Braking system	Brake pads - rear (seit 400km / Mehrkosten möglich) - Due - Replace
17	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Body	Underbody panelling - Scratch(es) - No deduction
3	Electronic systems	Front camera - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction



No.	Component group	Description
5	Wheel / tyres	Alloy rim - front right side (Zubehörfelgen) - Scratched - No deduction
6	Door - rear left side	Door - Scratch(es) - Cover / polish
7	Door - rear right side	Door edge - Scratch(es) - Cover / polish

Missing parts

Missing part

Detected repainting

No.	Location
None detectable	

Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R17 97H	Michelin	Winter tyres	5mm - 5mm	o.k.	Not o.k.
2	225/55 R17 97H	Michelin	Winter tyres	5mm - 5mm	o.k.	Not o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R17 101Y	Pirelli	Summer tyres	5mm - 5mm	o.k.	Not o.k.
2	225/55 R17 101Y	Pirelli	Summer tyres	4mm - 4mm	o.k.	Not o.k.

The wear and tear condition and possible damages to the tyres are considered in the value.

Comments

Keine Gewähr auf Vollständigkeit und
Richtigkeit der angezeigten Ausstattung.
Techn. Änderungen vorbehalten.
Das Fahrzeug weist dem Alter, der Laufleistung und dem
Einsatzzweck entsprechende Gebrauchsspuren auf.

elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
AH Rhein Ludwigsburg
Zeissstr. 2
71679 Asperg

Inspection date: 28 Apr 2025
Protocol number: 39677755



Vehicle details

Manufacturer	BMW	Inspection condition	conditional: light/moisture/dirt
Type / Model	530d	Mileage (Read)	96,994 km
Vehicle Identification number	WBA11AJ030CG64359	First registration	25 Feb 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front

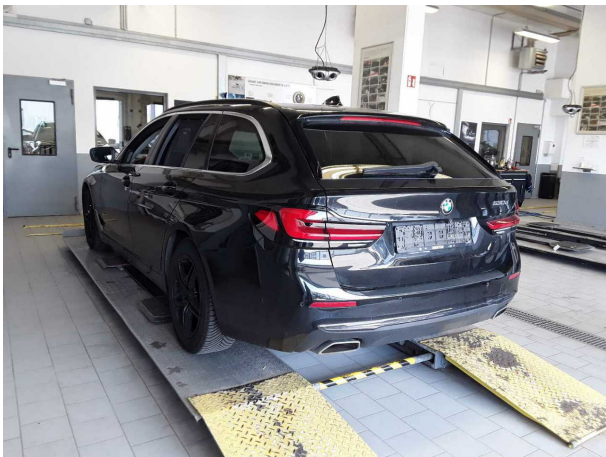


Figure 3: Diagonal rear

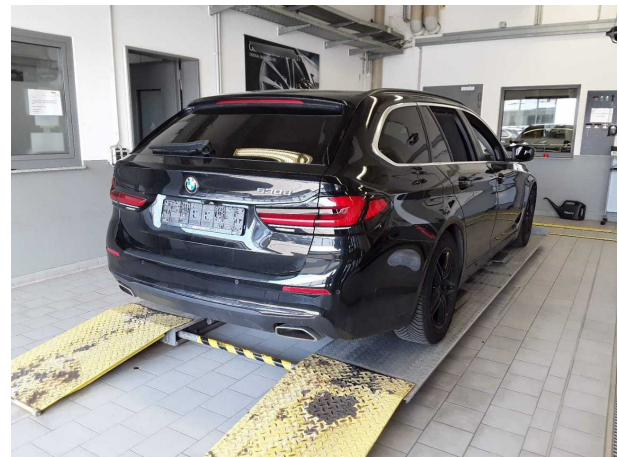


Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior

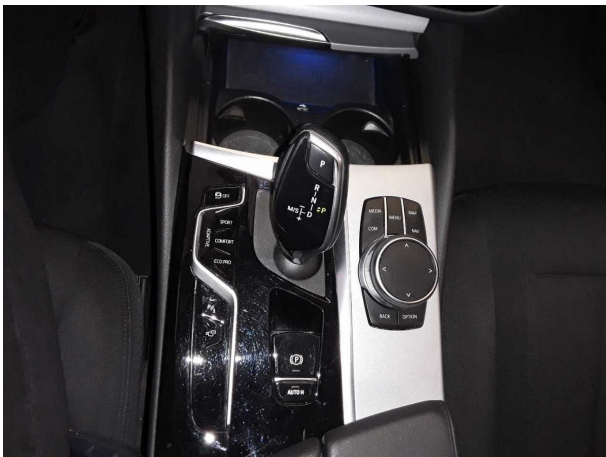


Figure 9: Interior



Figure 10: Interior

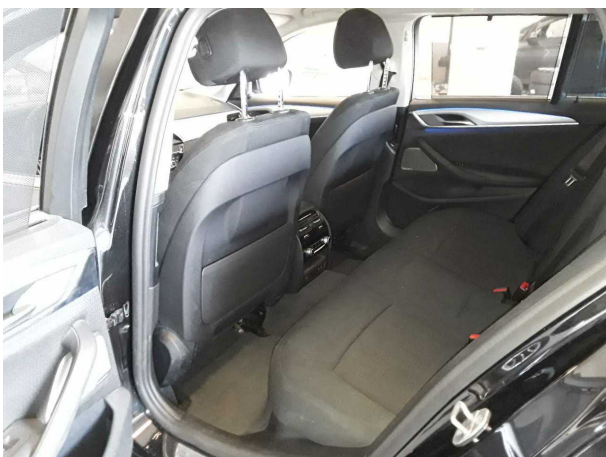


Figure 11: Interior



Figure 12: Interior



Figure 13: Interior



Figure 14: VIN

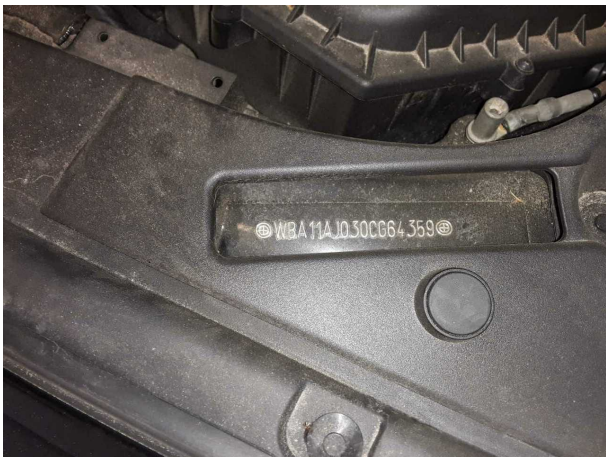


Figure 15: VIN

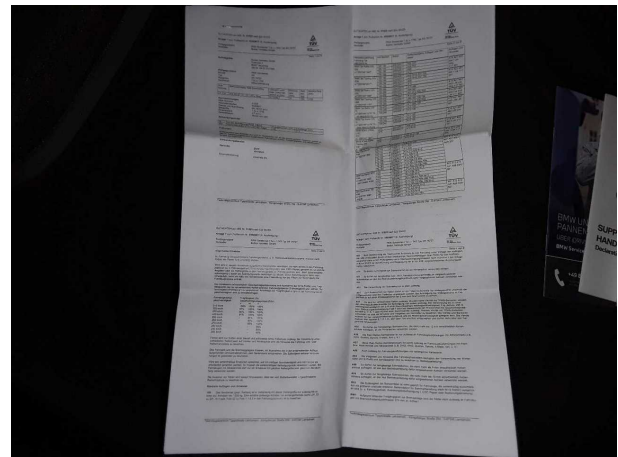


Figure 16: Accessories

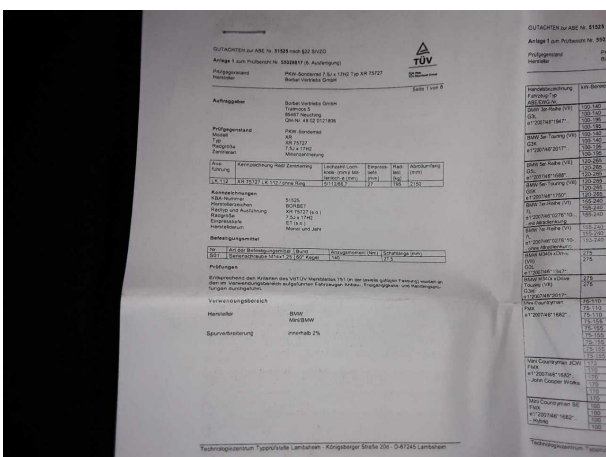


Figure 17: Accessories

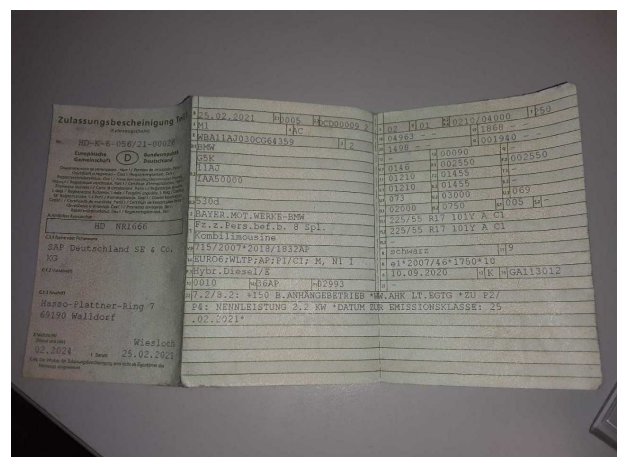


Figure 18: Documents



Figure 19: Documents



Figure 20: Mounted tyres



Figure 21: Mounted tyres

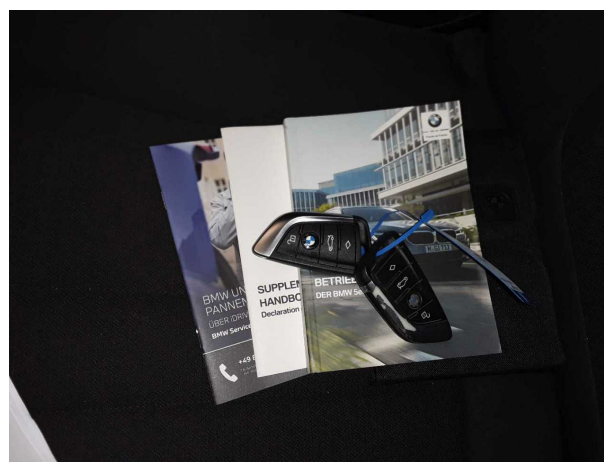


Figure 22: Misc.



Figure 23: Misc.

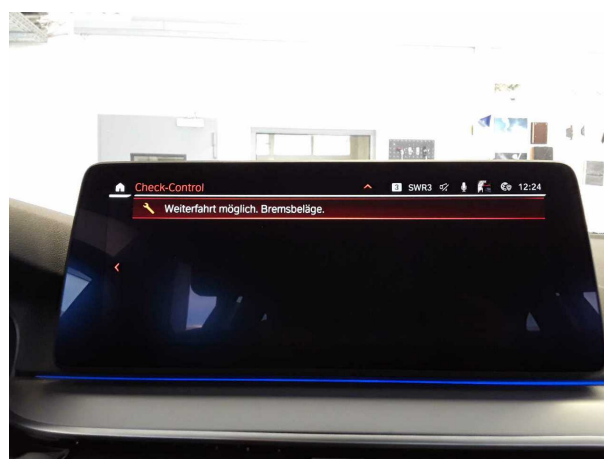


Figure 24: Misc.



Figure 25: Misc.

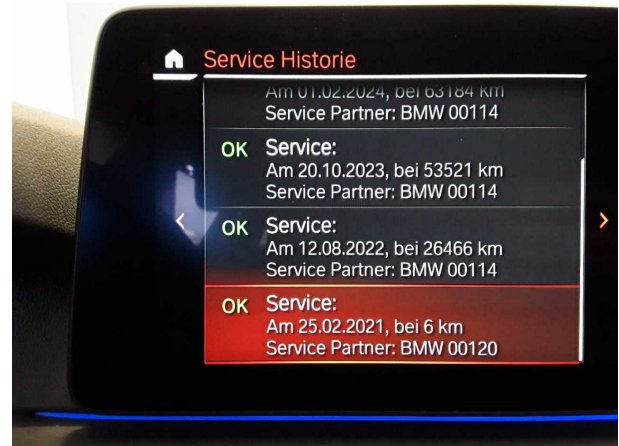


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

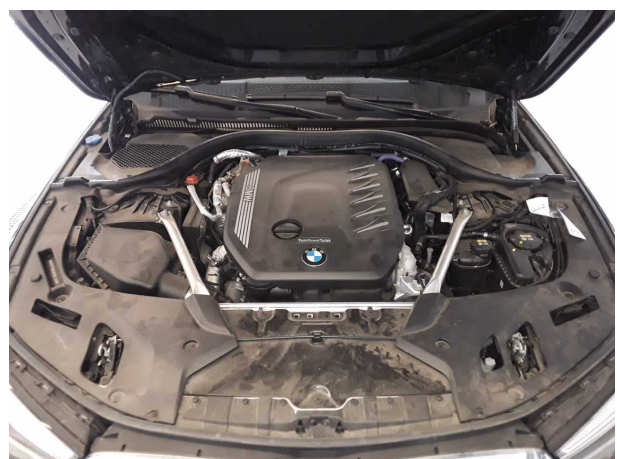


Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.

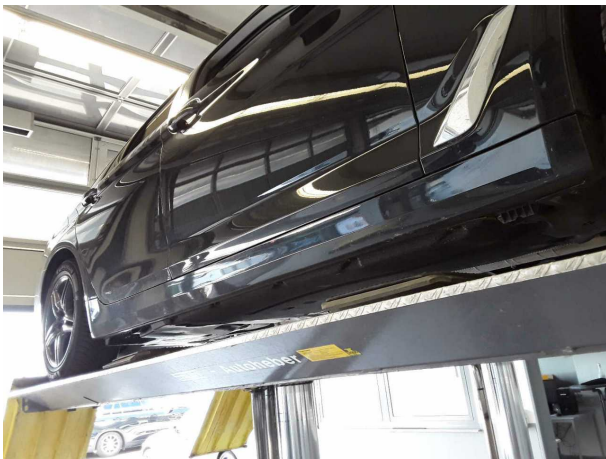


Figure 39: Misc.



Figure 40: Misc.


Pictures of damage



Damage #1: Sill - left side: Trim - Scratched - Smart repair




Damage #1: Sill - left side: Trim - Scratched - Smart repair

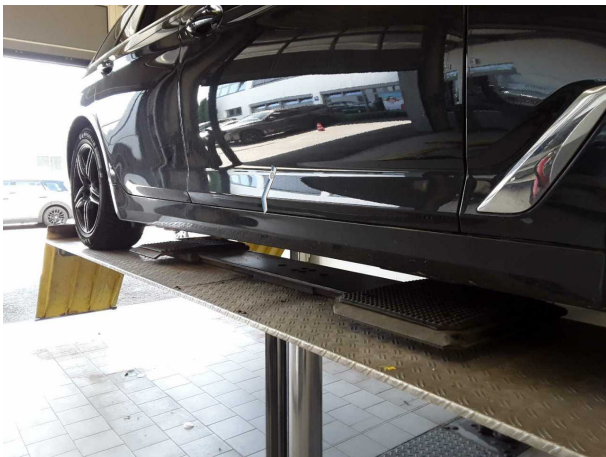


Damage #2: Sill - right side: Trim - Scratched - Smart repair



Damage #2: Sill - right side: Trim - Scratched - Smart repair

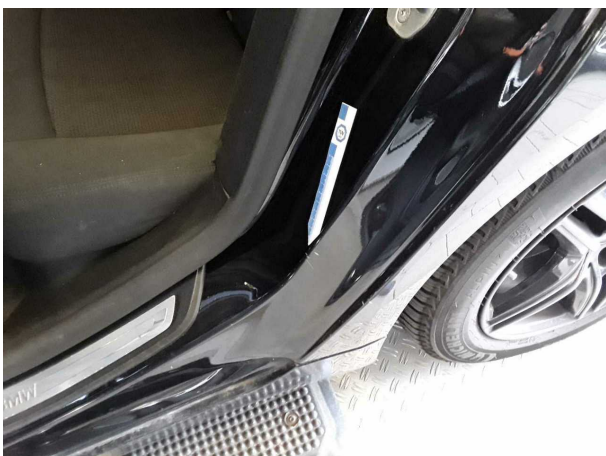

Damage #3: Side panel - rear left side: Sill - Scratched - Smart repair

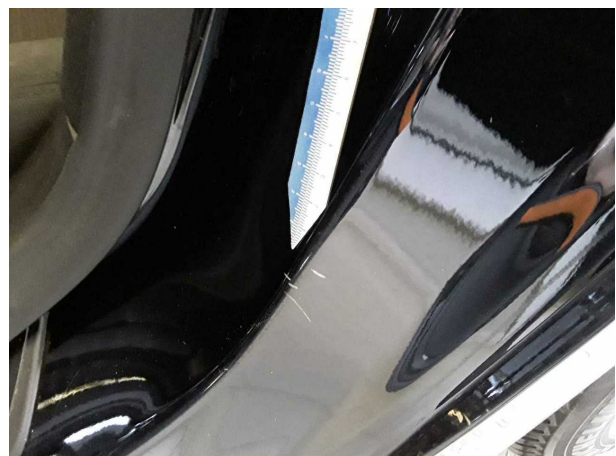


Damage #3: Side panel - rear left side: Sill - Scratched - Smart repair



Damage #4: Side panel - rear left side: Elbow - Scratched - Smart repair




Damage #4: Side panel - rear left side: Elbow - Scratched - Smart repair

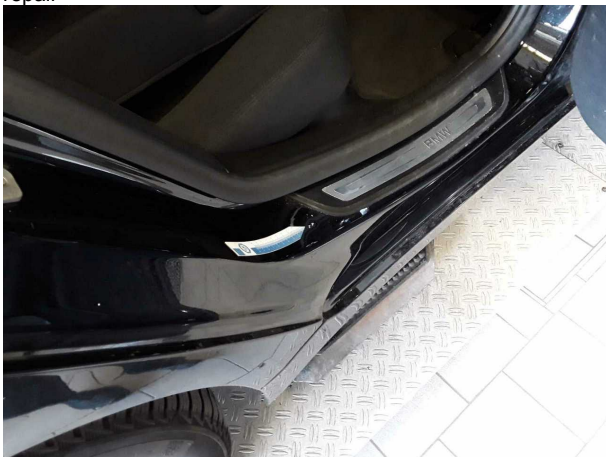


Damage #5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage #5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

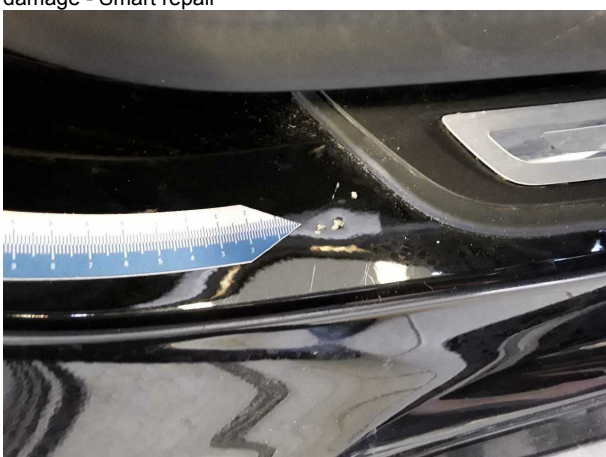

Damage #5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

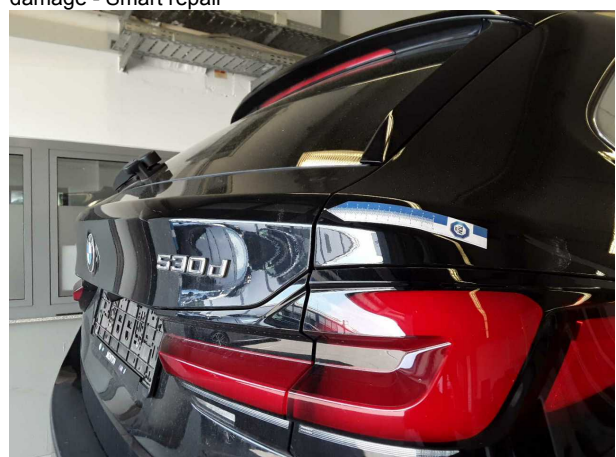

Damage #6: Side panel - rear right side: Side panel - Scratch... - Smart repair



Damage #6: Side panel - rear right side: Side panel - Scratched - Smart repair



Damage #7: Front bumper: Front bumper (unterhalb) - Scratched - Smart repair



Damage #8: Door - front left side: Door edge - Scratched - Smart repair



Damage #7: Front bumper: Front bumper (unterhalb) - Scratched - Smart repair



Damage #7: Front bumper: Front bumper (unterhalb) - Scratched - Smart repair




Damage #8: Door - front left side: Door edge - Scratched - Smart repair



Damage #10: Body: Door seal - front left side - Damaged - Replace



Damage #10: Body: Door seal - front left side - Damaged - Replace

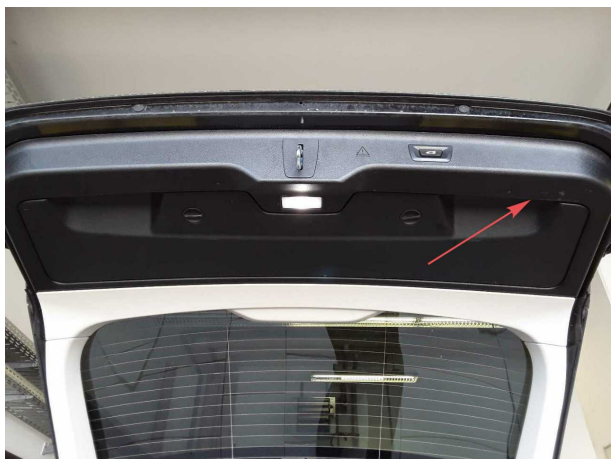

Damage #11: Boot lid / rear door: Trim - standard - lower - Scratched - Replace



Damage #11: Boot lid / rear door: Trim - standard - lower - Scratched - Replace



Damage #12: Steering system: Steering wheel sheath - Scratched... Loss in value



Damage #12: Steering system: Steering wheel sheath - Scratched - Loss in value




Damage #13: Roof: Aerial - Damage caused by marten / rodent - Replace




Damage #13: Roof: Aerial - Damage caused by marten / rode... - Replace




Damage #13: Roof: Aerial - Damage caused by marten / rodent - Replace

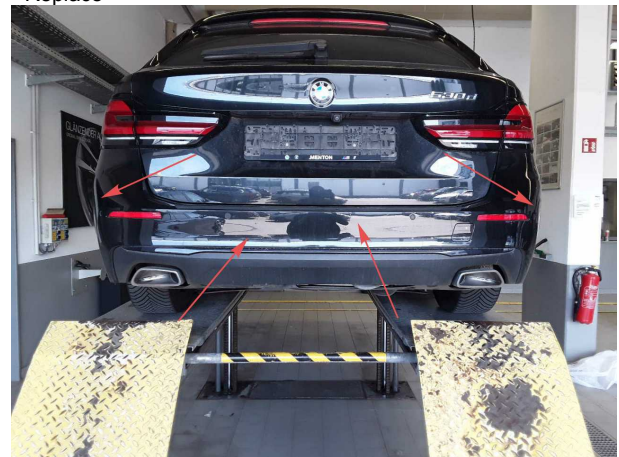

Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

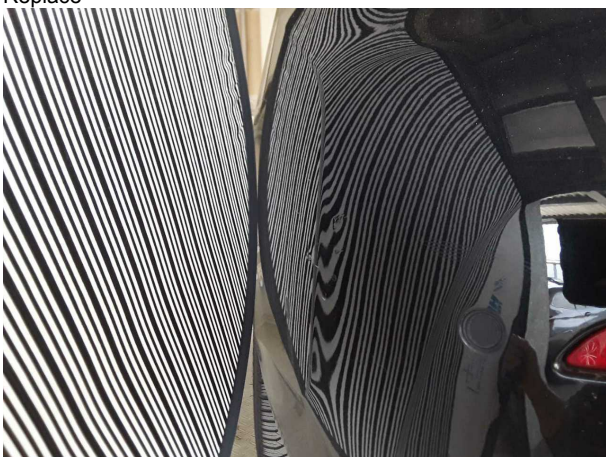


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

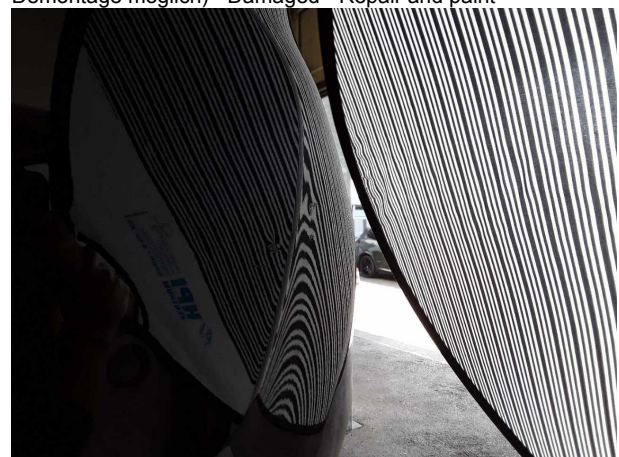


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint



Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

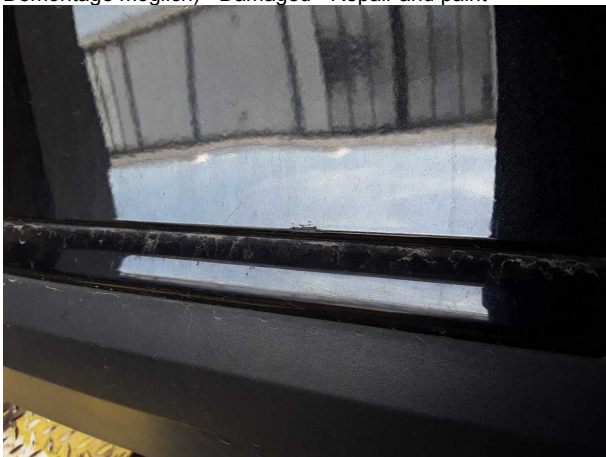


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

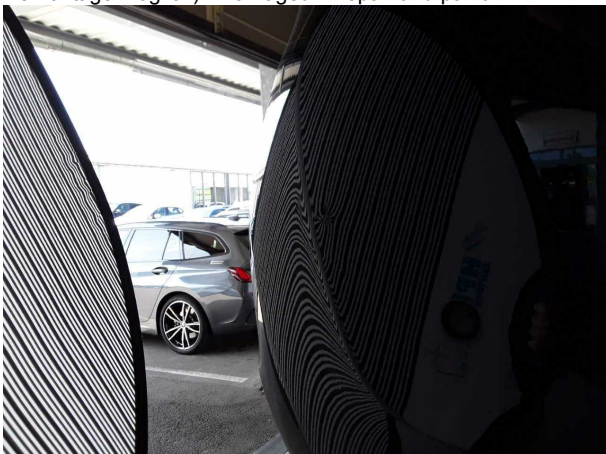


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint




Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

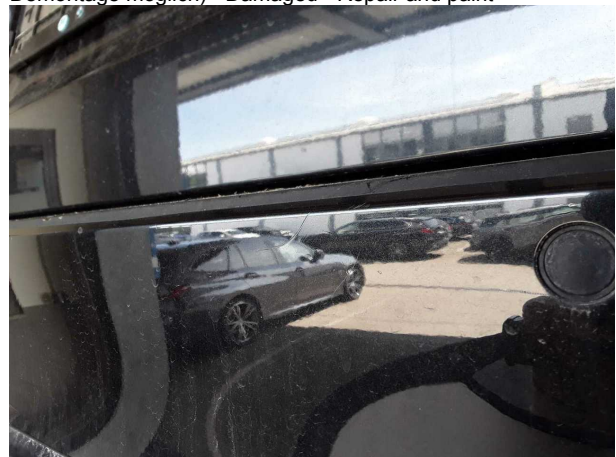


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

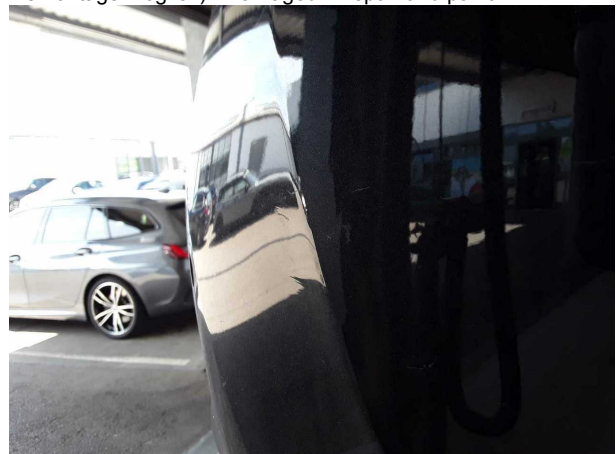

Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

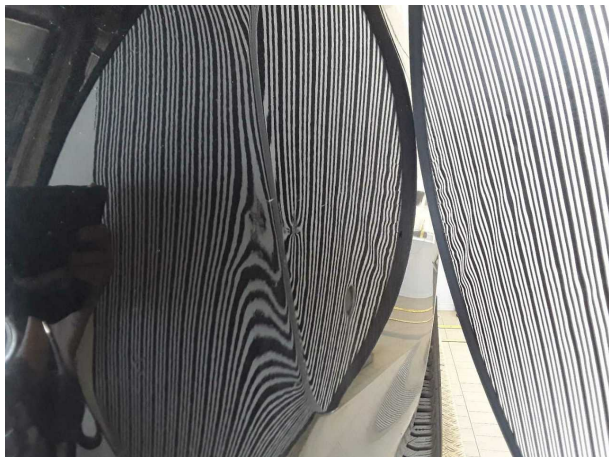


Damage #14: Rear bumper: Rear bumper (Mehrkosten nach Demontage möglich) - Damaged - Repair and paint

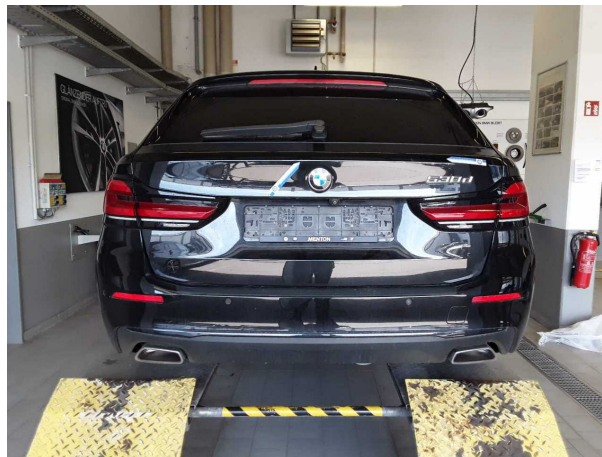


Damage #15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage #15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

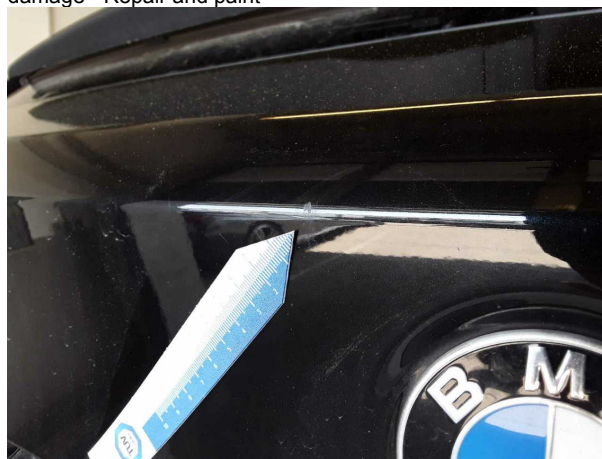


Damage #15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

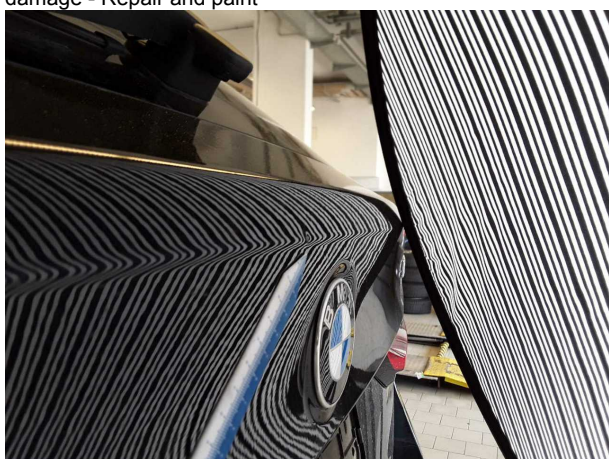

Damage #15: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

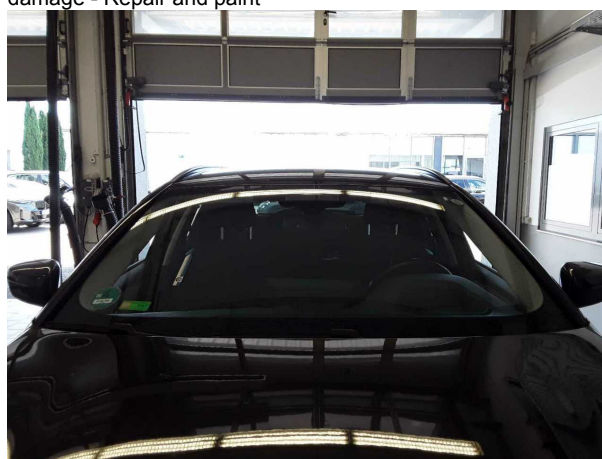

Damage #17: Vehicle glazing: Windscreen - Stone chips - Replace

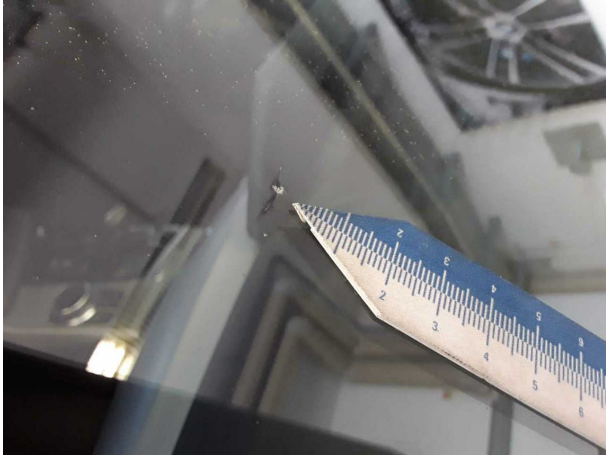

Damage #17: Vehicle glazing: Windscreen - Stone chips - Replace