



WBA11AJ000CH06535

Vehicle details

Operator		Inspection condition	Sufficient
License number		Mileage (Read)	81,220 km
Manufacturer	BMW	Next maintenance in	11,000 km
Type / Model	530d	Main inspection (Taken from ZBI)	05/2026
Vehicle Identification number	WBA11AJ000CH06535	Power / Engine displacement	210 kW / 2,993 ccm
First registration	11 May 2021	Upholstery/Colour	Cloth / Black
Last maintenance	05/2024, 60,307 km	Paintwork	Blue
Fuel type	Hybrid Diesel / E	Gearbox	

Zustandsbericht

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - front (Verschleißgrenze beachten) - No deduction
2	Documents	Documentation for retrofitted accessories (Winterradsatz / fehlt) - No deduction
3	2nd wheel set	2 tyres (Reifen HA Mischbereifung) - Differs from the original configuration - No deduction
4	Sill - left side	Sill - Scratch(es) - Smart repair
5	Front bumper	Front bumper - Scratched - Smart repair
6	Trim / covers	Door trim - rear left side - Broken / torn - Replace
7	2nd wheel set	2 alloy rims (Glanzgedreht) - Scratched - Loss in value

Wear and tear

No.	Component group	Description
1	Steering system	Steering wheel - Abrasion - No deduction
2	Side panel - rear left side	Elbow - dent(s) - No deduction
3	Rear bumper	Rear bumper - Deformed - No deduction
4	Mudguard - right side	Inner mudguard (Luftführung unten) - Broken / torn - No deduction
5	Trim / covers	Boot lid - interior trim - Scratched - No deduction

Missing parts

Missing part

Detected repainting

No.	Location
	None detectable



Main tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	225/55 R17 97H	Dunlop	winter tires (with run-flat tires)	4mm - 4mm	o.k.	Not o.k.
2	225/55 R17 97H	Dunlop	winter tires (with run-flat tires)	6mm - 6mm	o.k.	Not o.k.

Additional tyres

Axle	Tyre size	Manufacturer	Type of tyre	Tread depth	Roadworthy	Permissibility
1	245/45 R18 100Y	Pirelli	Summer tyres	5mm - 5mm	Not o.k.	o.k.
2	245/45 R18 100Y	unterschiedliche Hersteller	Summer tyres	7mm - 6mm	Not o.k.	o.k.

Replacement

Type	Tyre size	Manufacturer	Type of tyre	Tread depth	Expiration date
Tirefit					02/2027

The wear and tear condition and possible damages to the tyres are considered in the value.

Equipment

Equipment

Description
Roof rails
Parking assistance
Electric window lifter
Electric side mirrors
Electric seat adjustment
Automatic air conditioning
Navigation unit with map view
Radio with SD/USB interface
Rear view camera
Seat heater

Comments

Fahrzeugausstattungsliste und Reparaturhistorie lagen zum Zeitpunkt der Fahrzeugbesichtigung nicht vor. Folgekosten können entstehen.

Erhöhte Lackstärke am gesamten Fahrzeug. Nachlackierung nicht feststellbar. Mehrkosten können entstehen.

Keine Gewähr auf Vollständigkeit und

Richtigkeit der angezeigten Ausstattung.

Techn. Änderungen vorbehalten.

Das Fahrzeug weist dem Alter, der Laufleistung und dem Einsatzzweck entsprechende Gebrauchsspuren auf.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
GROßK. -LEISTUNGSZ. DER
VW GROUP RETAIL DR
Kesselsdorfer Straße 300
01169 Dresden

Inspection date: 12 May 2025
Protocol number: 39930026



elektr. Komponenten geprüft, i. O.

Lackwerte geprüft, i. O.

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
GROßK. -LEISTUNGSZ. DER
VW GROUP RETAIL DR
Kesselsdorfer Straße 300
01169 Dresden

Inspection date: 12 May 2025
Protocol number: 39930026



Vehicle details

Manufacturer	BMW	Inspection condition	Sufficient
Type / Model	530d	Mileage (Read)	81,220 km
Vehicle Identification number	WBA11AJ000CH06535	First registration	11 May 2021

Vehicle identification:

The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents submitted during the inspection.

Inspection conditions:

The inspection conditions were sufficient for the assessment of the vehicle.

General condition:

The vehicle shows traces of wear and tear corresponding to its age and purpose

Overview pictures



Figure 1: Diagonal front



Figure 2: Diagonal front



Figure 3: Diagonal rear



Figure 4: Diagonal rear



Figure 5: Interior



Figure 6: Interior



Figure 7: Interior



Figure 8: Interior



Figure 9: Interior

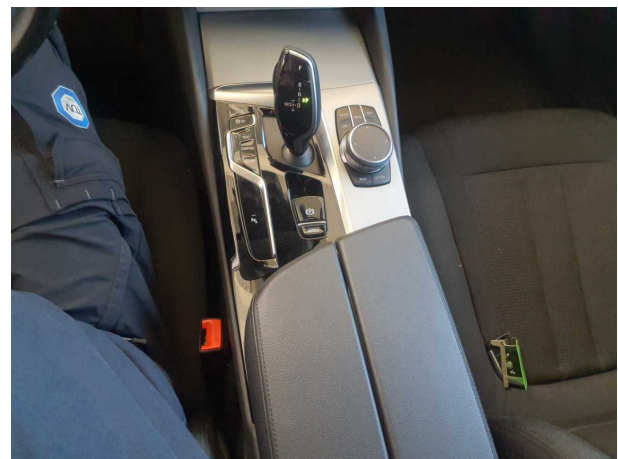


Figure 10: Interior



Figure 11: Interior

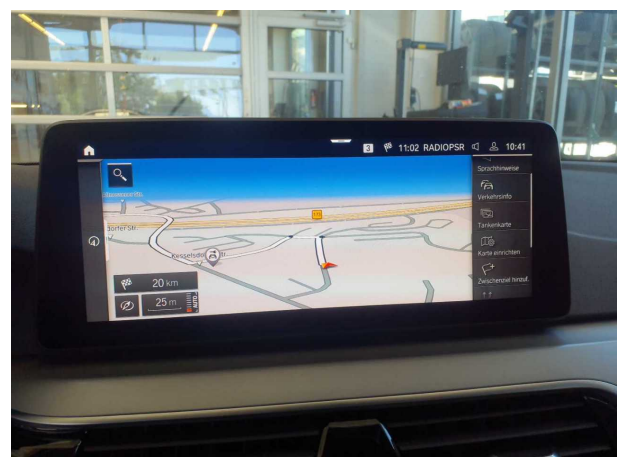


Figure 12: Interior

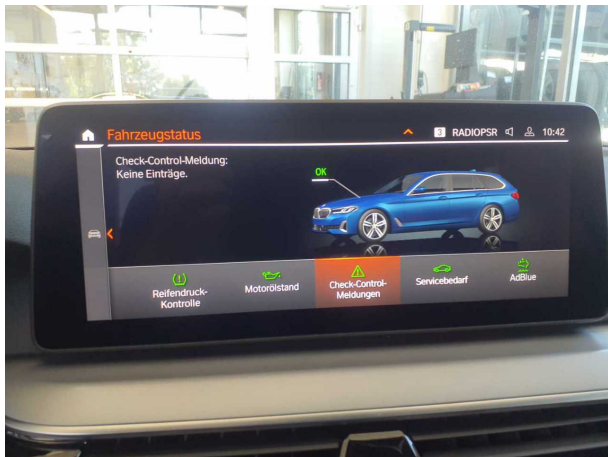


Figure 13: Interior

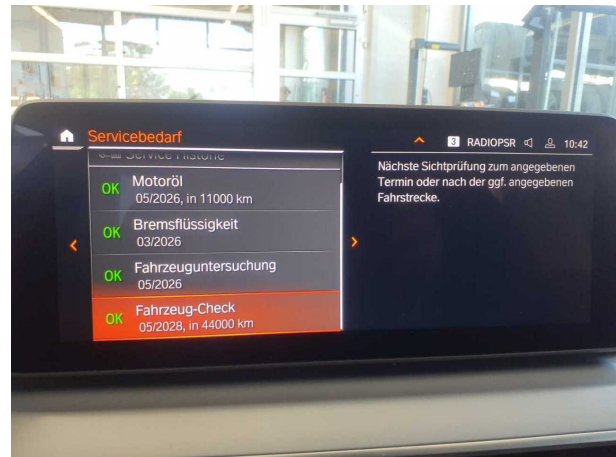


Figure 14: Interior

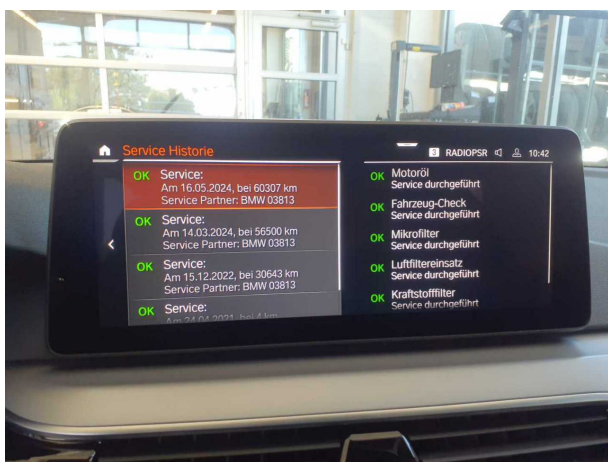


Figure 15: Interior



Figure 16: Interior

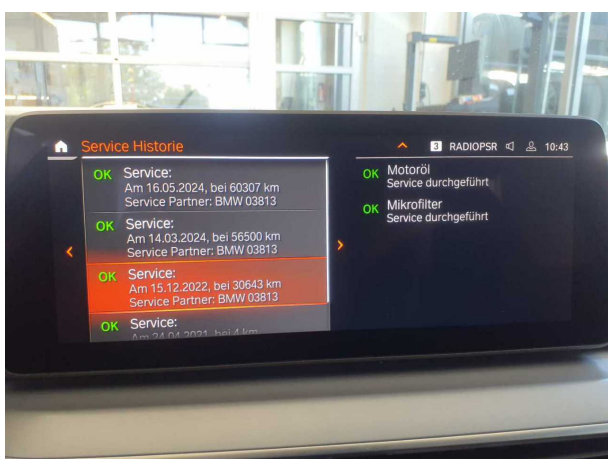


Figure 17: Interior

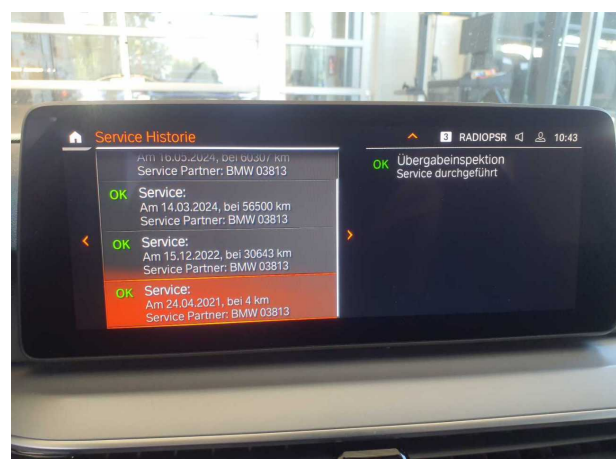


Figure 18: Interior



Figure 19: Interior



Figure 20: Interior



Figure 21: Interior

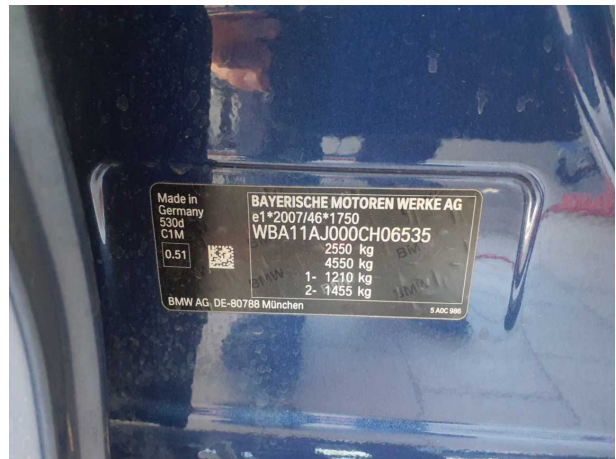


Figure 22: VIN



Figure 23: Accessories



Figure 24: Accessories

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
GROßK. -LEISTUNGSZ. DER
VW GROUP RETAIL DR
Kesselsdorfer Straße 300
01169 Dresden

Inspection date: 12 May 2025
Protocol number: 39930026



Figure 25: Accessories



Figure 26: Accessories



Figure 27: Accessories

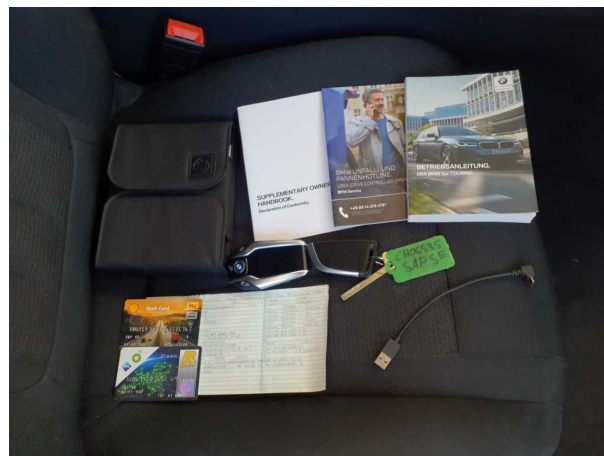


Figure 28: Documents

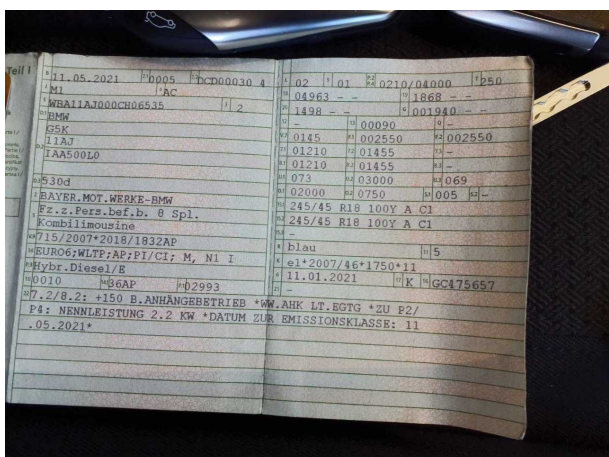


Figure 29: Documents

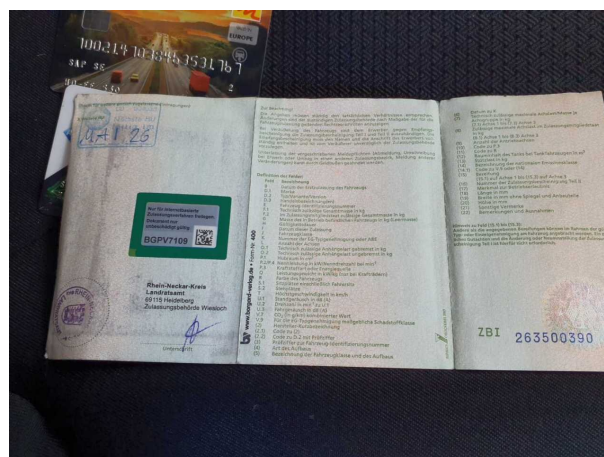


Figure 30: Documents



Figure 31: Mounted tyres



Figure 32: Mounted tyres



Figure 33: Mounted tyres



Figure 34: Mounted tyres



Figure 35: Mounted tyres

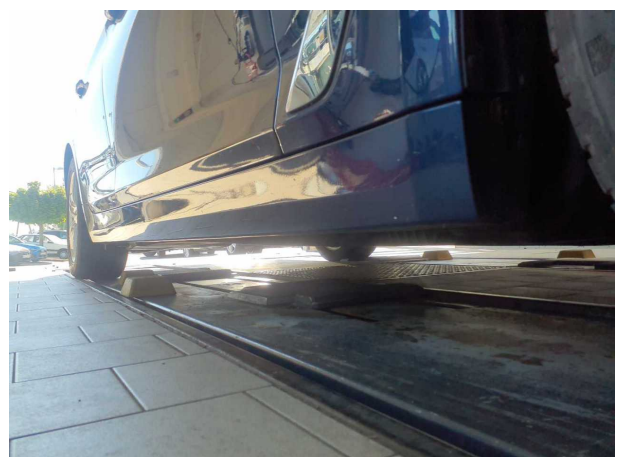


Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.

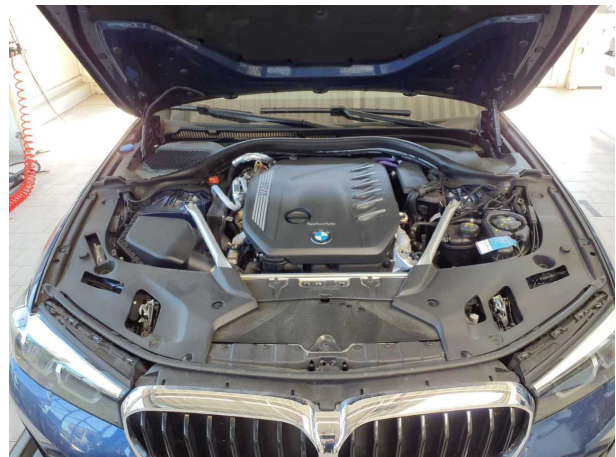


Figure 40: Misc.

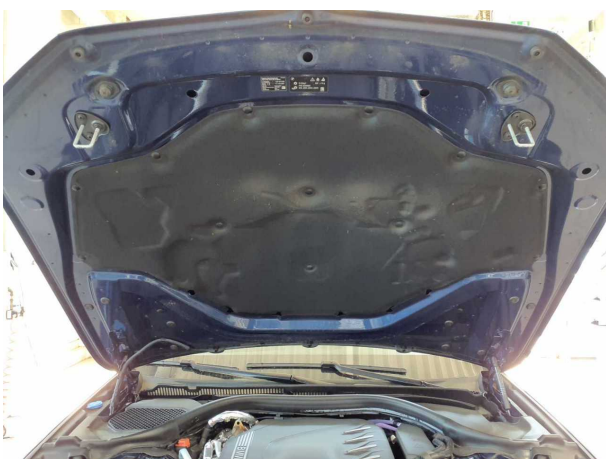


Figure 41: Misc.

Pictures of damage




Damage #3: 2nd wheel set: 2 tyres (Reifen HA Mischbereifung) - Differs from the original configuration - No deduction




Damage #3: 2nd wheel set: 2 tyres (Reifen HA Mischbereifung) - Differs from the original configuration - No deduction



Damage #4: Sill - left side: Sill - Scratch(es) - Smart repair

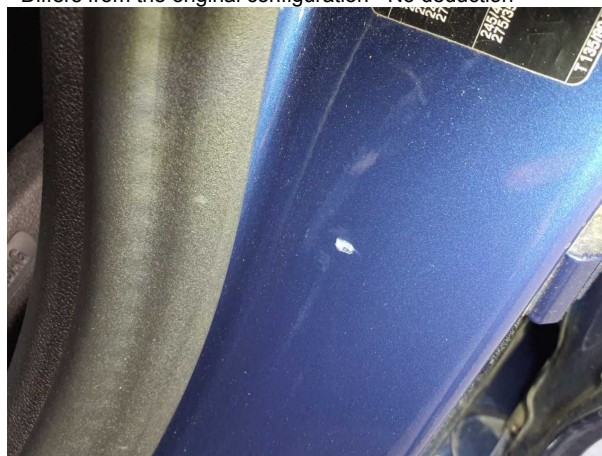

Damage #4: Sill - left side: Sill - Scratch(es) - Smart repair

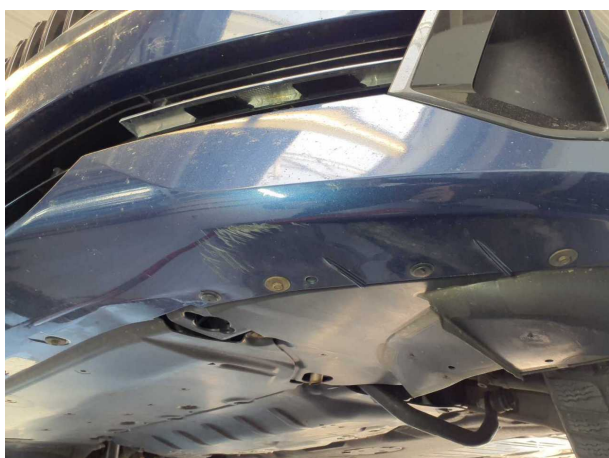

Damage #5: Front bumper: Front bumper - Scratched - Smart repair



Damage #5: Front bumper: Front bumper - Scratched - Smart repair



Damage #6: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage #6: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage #6: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage #7: 2nd wheel set: 2 alloy rims (Glanzgedreht) - Scratched - Loss in value



Damage #7: 2nd wheel set: 2 alloy rims (Glanzgedreht) - Scratched - Loss in value



Damage #7: 2nd wheel set: 2 alloy rims (Glanzgedreht) - Scratched - Loss in value

TÜV SÜD Auto Partner GmbH
Gutenbergstr. 13
70771 Leinfelden-Echterdingen

Inspection location
GROßK. -LEISTUNGSZ. DER
VW GROUP RETAIL DR
Kesselsdorfer Straße 300
01169 Dresden

Inspection date: 12 May 2025
Protocol number: 39930026



Damage #7: 2nd wheel set: 2 alloy rims (Glanzgedreht) - Scratch...
- Loss in value